AVIATION AND AERONAUTICAL ENGINEERING

(C) Underwood & Underwood. View of a Fighting Airplane Flying Above Clouds

JULY 15th 1917

SPECIAL FEATURES

AIRPLANE DOPES
KAPOK—AND SOME OF ITS USES
A THREE YEARS' FLYING EXPERIENCE
PSYCHOLOGICAL ASPECTS OF AERONAUTICS
COURSE IN AERODYNAMICS AND AIRPLANE DESIGN
TESTS ON A SERIES OF PROPELLER BLADE ELEMENTS
EXTRACTS FROM INSPECTORS MANUAL-SIGNAL CORPS

PRICE Fifteen Cents

PUBLISHED SEMI-MONTHLY BY
THE GARDNER-MOFFAT CO., Inc.
120 W. 32nd ST. NEW YORK

CONTRACTORS TO

The United States Army and Navy

The British Admiralty

THE BURGESS COMPANY

MARBLEHEAD, MASS.

Sole Licencees for the United States for the Dunne Patents

Member of the Aircraft Manufacturers Association

HALL-SCOTT

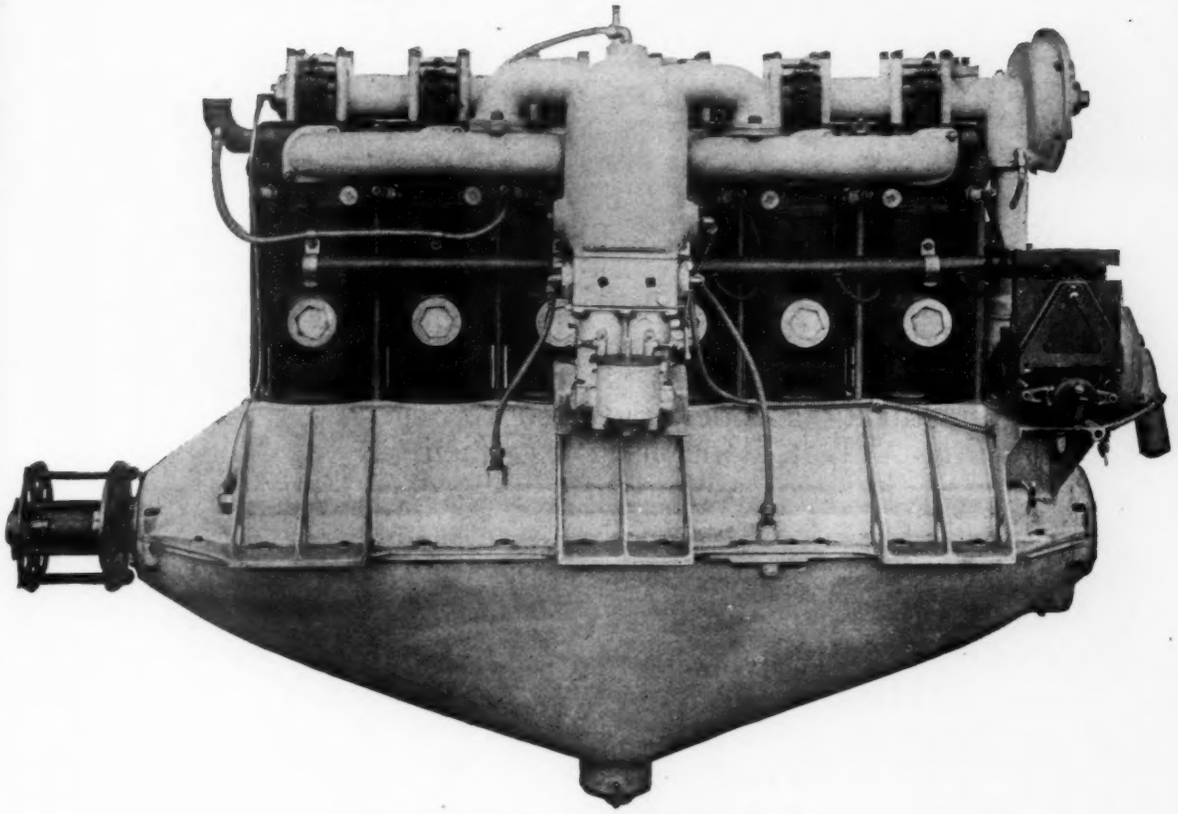

Intake Side Hall-Scott, "BIG SIX" Airplane Engine

This Hall-Scott, Type A-5a, rated at 150 H.P., is offered after having most successfully passed severe running tests as required by Hall-Scott engineers, and final 48 hour endurance, running test, on cradle type torque stand, with propeller directly connected, in accordance with U. S. Government requirements. (Spec. 1002.)

Total weight, complete and ready for service, ...	*578 lbs.*
Weight per H.P. (Based on actual H.P. development, at 1,300 R.P.M.)	*3.61 "*
Consumption gasoline in lbs. per H.P. hour, ...	*.565*
" lubricating oil " " "	*.025*

HALL-SCOTT AIRPLANE ENGINES, both four and six cylinder types, are used by U. S. Army and Navy Departments, and are generally used by all leading American airplane manufacturers.

Hall-Scott Motor Car Co., Inc.
General Offices
Crocker Bldg., San Francisco, Calif.

F. P. Whitaker
EASTERN REPRESENTATIVE
165 Broadway, New York City

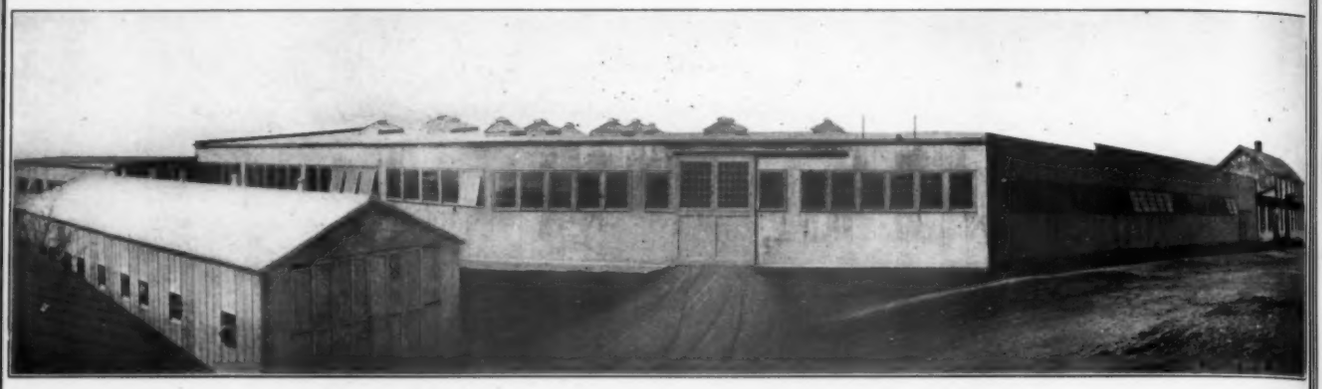

EXPANSION

From less than 50,000 square feet to more than 200,000 square feet, in two months, is the story not only of Standard manufacturing abilities, but also the story of Standard expansion. Not alone have our factories at Plainfield enlarged, but we employ the exclusive facilities of four outside shops covering 40,000 square feet.

Today our Government is on the brink of calling aircraft manufacturers to maximum performance. We are glad that in this crisis in the history of our Country our facilities for manufacture and expansion are unlimited.

Member Aircraft Manufacturers Association, Inc.

AERO STANDARD CORPORATION

Contractors to the United States Army and Navy

EXECUTIVE OFFICES, WOOLWORTH BLDG., N.Y.C.
FACTORY, PLAINFIELD, NEW JERSEY

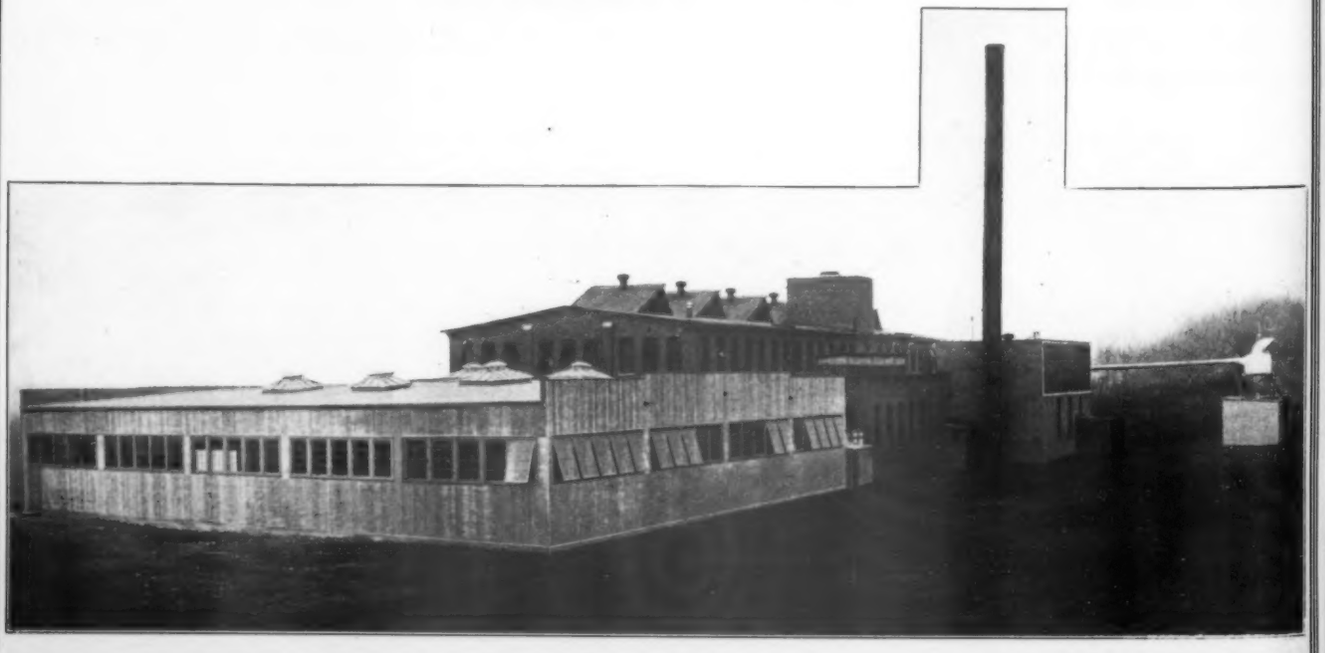

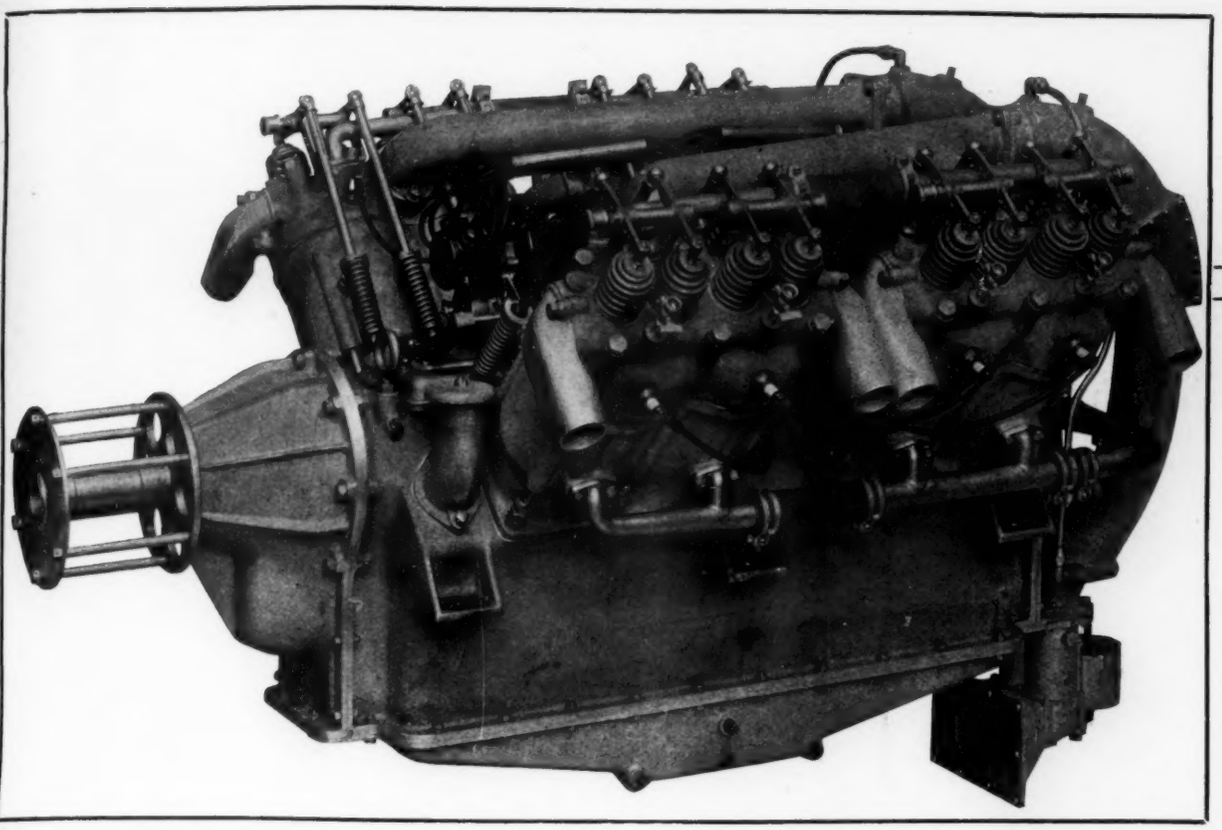

3.5 Pounds per horsepower

One of the lightest airplane engines built in America. Reliable, durable and capable of sustained effort over long periods of time, as demonstrated by repeated tests and flights.

Sturtevant
REG. U. S. PAT. OFF.
B. F. STURTEVANT COMPANY
Hyde Park, Boston, Massachusetts
Member of the Aircraft Manufacturers Association

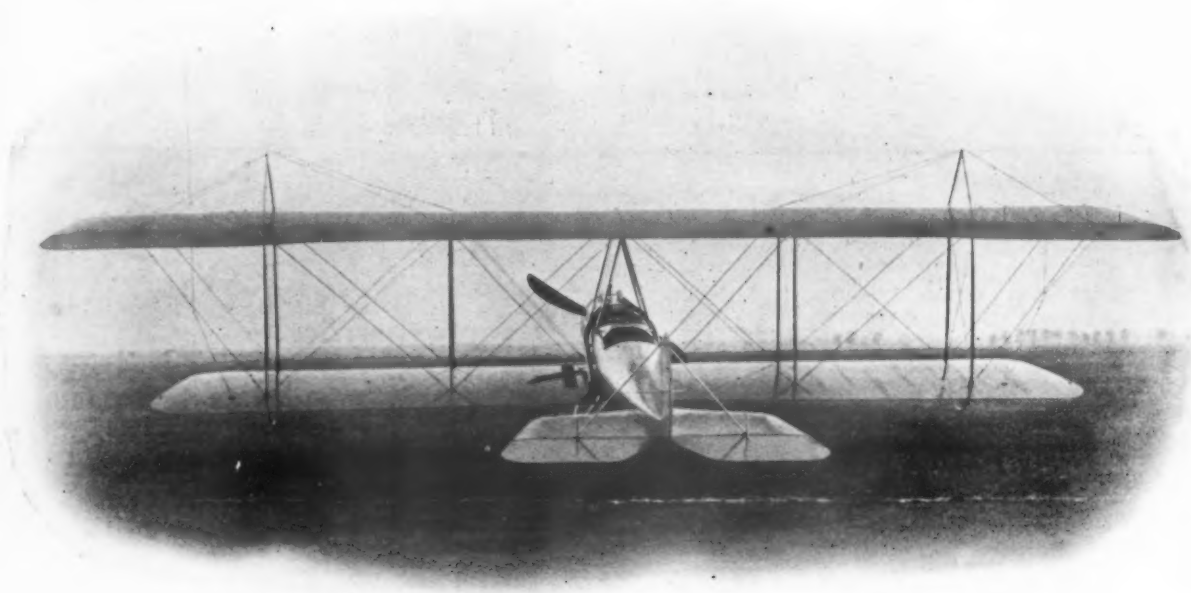

L·W·F·ENGINEERING·COMPANY·

Member, Aircraft Manufacturers' Assn., Inc.

GNOME!

Side view of engine mounted for test

Front view with propeller attached

Mounted in speed scout

Hundreds of these

100 H. P. MONOSOUPAPE GNOME ENGINES

have been built and exported by the

General Vehicle Company, Inc.

We are contractors also to the
United States Army and Navy

General Vehicle Company, Inc.

(Established 1901)

General Office and Factory

LONG ISLAND CITY, N. Y.

Aeromarine

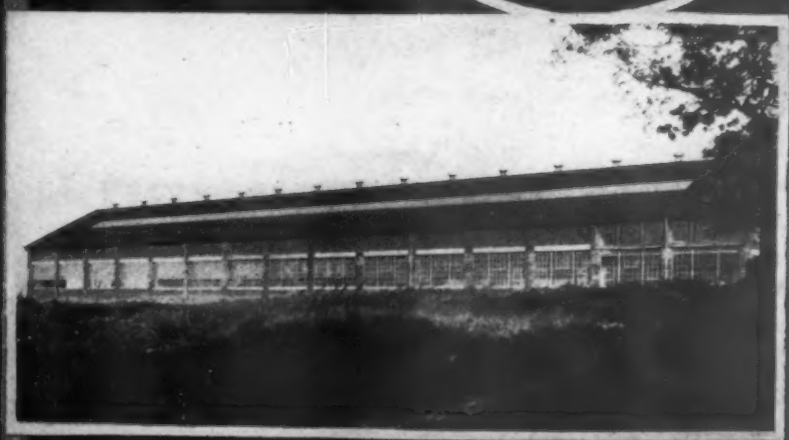

The Aeromarine Plane and Motor Co. is now located at Keyport, New Jersey, in a factory designed especially for the manufacture of aircraft

ENGINEERING and SALES CO.

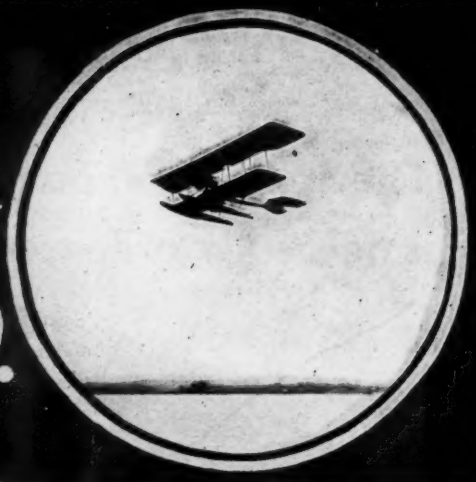

Manufacturers to Army and Navy. Member of Aircraft Manufacturer's Association, Inc.

New York Office Times Building

AERONAUTIC PREPAREDNESS

The Sperry Company is now fully prepared

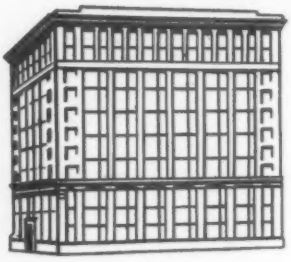

to supply all equipments for Airplanes

SPERRY AUTOMATIC PILOT

Gyro Unit

Servo Motors Encased

OPERATES ALL CONTROLS AUTOMATICALLY

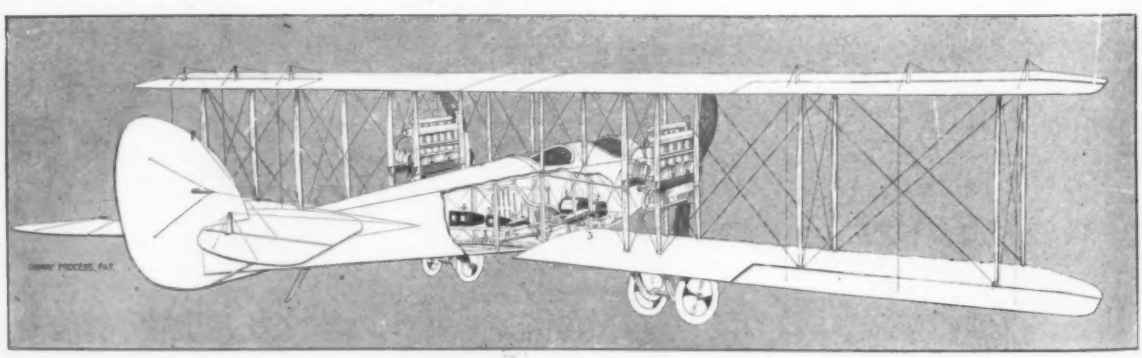

INSTALLATION

1—Gyro Unit; 2—Azimuth Gyro; 3—Generator; 4—Double Servo Motor; 5—Single Servo Motor; 6—Air Turbine

AERONAUTIC MOBILIZATION

SPERRY SYNCHRONIZED DRIFT SET

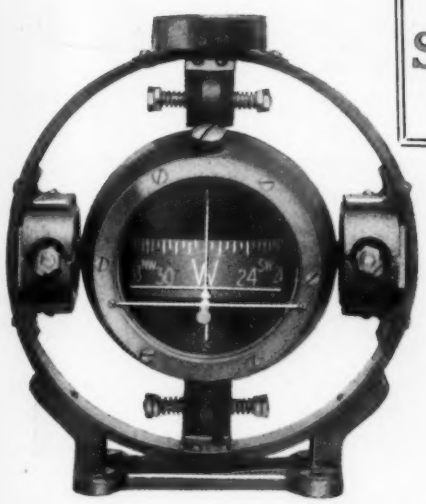

Creagh-Osborne Air Compass

Automatically Corrects the Compass for Drift

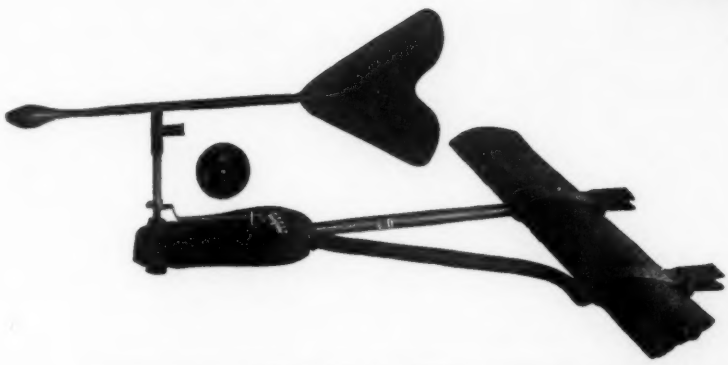

SPERRY INCIDENCE INDICATOR

Other Sperry Instruments

Banking Indicator	Radio Equipment	Chart Holders and Charts
Dead Beat Clinometer	Bomb Sights	Searchlights

Watch for these New Sperry Devices

Air Speed Indicator	Altimeters	Rate of Climb Indicator

THE SPERRY GYROSCOPE COMPANY

Manhattan Bridge Plaza,
Brooklyn, New York
U. S. A.

Rigid Construction, no shock absorbers needed. Wheels very effectively stream-lined.

ACKERMAN WHEELS provide the best insurance against landing accidents.

About 90% of the accidents on the training field are attributable to mistakes in landing—usually resulting in the collapse of wheels and their supports.

ACKERMAN WHEELS eliminate this source of trouble. They provide a greater factor of safety; they

THE ACKERMAN W

Rockefeller Building

are lighter in weight and their construction permits of better stream-lining. Both in landing and getting away they absorb shock and prevent rebound.

"AS SMOOTH AS VELVET" is the way an officer at one of the Government's large training fields describes his sensation in landing an airplane equipped with *ACKERMAN WHEELS.*

RESILIENCY—STRENGTH—HIGH RESISTANCE TO SIDE THRUSTS

make Ackerman Wheels *logical equipment* for the modern airplane. They have withstood every test that ingenuity and determination to secure ultimate efficiency could devise.

Write us for suggestions in building landing gear and axles for ACKERMAN WHEELS. Shock absorbers unnecessary.

Wheels built for any weight machine from 500 pounds up.

"IT'S IN

THE SPOKES"

WHEEL COMPANY

Cleveland, Ohio

DUESENBERG AIRPLANE ENGINE

Speed, Power, Freedom. All this is wrapt up in the wonderful flight of an airplane. To-day you're taking up aviation because your Country needs nerve, cool heads, and inherent courage in connection with its Aerial Fleet.

To-morrow you will be flying because of your very love for it. The experience gained in military and semi-military service will only tend to heighten your keen appreciation of the wonders of navigating the air.

The big outstanding feature of the airplane is the engine. On it depends your pleasure and your life. It must be powerful, compact, absolutely dependable and of a tried and proven design.

The Duesenberg four-cylinder, 125 H. P. sixteen valve airplane engine is that and more. It is the evolution of the wonderful four-cylinder sixteen valve motor that has driven Duesenberg cars to victory after victory on the speedways of America. It is the evolution of the same motor that powered more than 60% of the racing cars last year.

This Duesenberg Airplane Motor has all the proven features of Duesenberg design. It is no experiment, has no untried features, hence the reason for its almost uncanny jump into the lead amongst aviation motors.

Your Airplane should be Duesenberg-powered to be what you want it to be. Write us for details of the manufacturers using Duesenberg Airplane Engines, also for bulletin describing this engine.

DUESENBERG MOTORS CORPORATION, 120 BROADWAY, NEW YORK CITY

MAGNALITE PISTONS

"The Standard in Airplane Engine Construction"

The superiority of Magnalite is substantiated by the performance of thousands of engines equipped with MAGNALITE PISTONS under the terrific stress to which they are subjected on the Allied fronts and in the training camps of this country.

We are prepared for any demand for quantity production which may be made upon us.

WALKER M. LEVETT COMPANY

The Pioneer Aluminum Alloy Piston Manufacturer

417-419-421 East 23d Street **NEW YORK** 418-420-422-424 East 24th Street

Radiators
FOR
Aircraft

We build radiators that combine

Maximum Efficiency

Minimum Weight

Durability

Stability

We will be pleased to submit samples in accordance with your prints

---

The English & Mersick Co.

New Haven, Conn.

"USCO" NUMBER 72

THE STANDARD KITE BALLOON FABRIC OF AMERICA

A TWO-PLY BIASED FABRIC, COATED BETWEEN PLIES WITH A LIGHT, TOUGH LAYER OF PURE PARA RUBBER.

THIS FABRIC HAS BEEN DEVELOPED FROM YEARS OF LABORATORY EXPERIENCE, AND POSSESSES EVERY FEATURE AND QUALIFICATION NECESSARY TO A WELL-BALANCED PRODUCT, VIZ.:

STRONG
GAS-TIGHT
NEUTRAL, INVISIBLE COLOR
WITHSTANDS ALL WEATHER CONDITIONS
AND AGES WELL

UNITED STATES RUBBER COMPANY AND ASSOCIATED COMPANIES — US — RUBBER SYSTEM

MADE BY THE
WORLD'S LARGEST RUBBER COMPANY

UNITED STATES RUBBER COMPANY
NEW YORK

JULY 15, 1917

AVIATION
AND
AERONAUTICAL ENGINEERING

VOL. II. NO. 12

Member of the Associated Business Papers

INDEX TO CONTENTS

	PAGE
Editorial	555
Tests on a Series of Propeller Blade Elements	556
Method of Approximating Static Thrust of Propellers	558
Course in Aerodynamics and Airplane Design	559
Syllabus of Lectures at the School of Military Aeronautics, Massachusetts Institute of Technology	561
Psychological Aspects of Aeronautics	562
Airplane Dopes	563
Kapok and Some of Its Uses	565
Extracts from Inspector's Manual, Signal Corps, U. S. A.	566
A Three Years' Flying Experience	568
The Cleveland Aero Engine	572
The Akimoff Dynamic Balance	572
The Aviation Bill Passes the House	573
Navy Asks $45,000,000 for Aeronautics	573

THE GARDNER, MOFFAT COMPANY, Inc., *Publishers*

120 WEST 32D STREET NEW YORK

WASHINGTON OFFICE, 308-10 EVENING STAR BUILDING

SUBSCRIPTION PRICE: TWO DOLLARS PER YEAR. SINGLE COPIES FIFTEEN CENTS. CANADA AND FOREIGN: TWO DOLLARS AND A HALF A YEAR. COPYRIGHT, 1917, BY THE GARDNER, MOFFAT COMPANY, INC.

ISSUED ON THE FIRST AND FIFTEENTH OF EACH MONTH FORMS CLOSE FIVE DAYS PREVIOUSLY. ENTERED AS SECOND-CLASS MATTER, AUGUST 3, 1916, AT THE POST OFFICE AT NEW YORK, N. Y., UNDER ACT OF MARCH 3, 1879.

Warner & Swasey Screw Machines

The standard for rapid and accurate output of AIRPLANE parts,
From TURNBUCKLES to "GNOME" ENGINE CYLINDERS

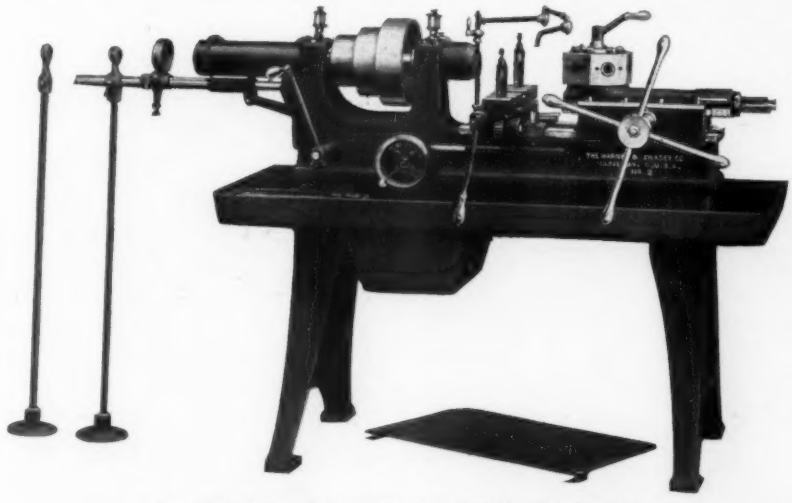

No. 2 Plain Head, 1" Bar Capacity, Best for Turnbuckles

There is nothing closer than Airplane work, and no machine so well adapted to the requirements. Screw Machines from 5/8" to 4 1/2" bar sizes, from 10" to 21" swing.

THE WARNER & SWASEY COMPANY
CLEVELAND, OHIO

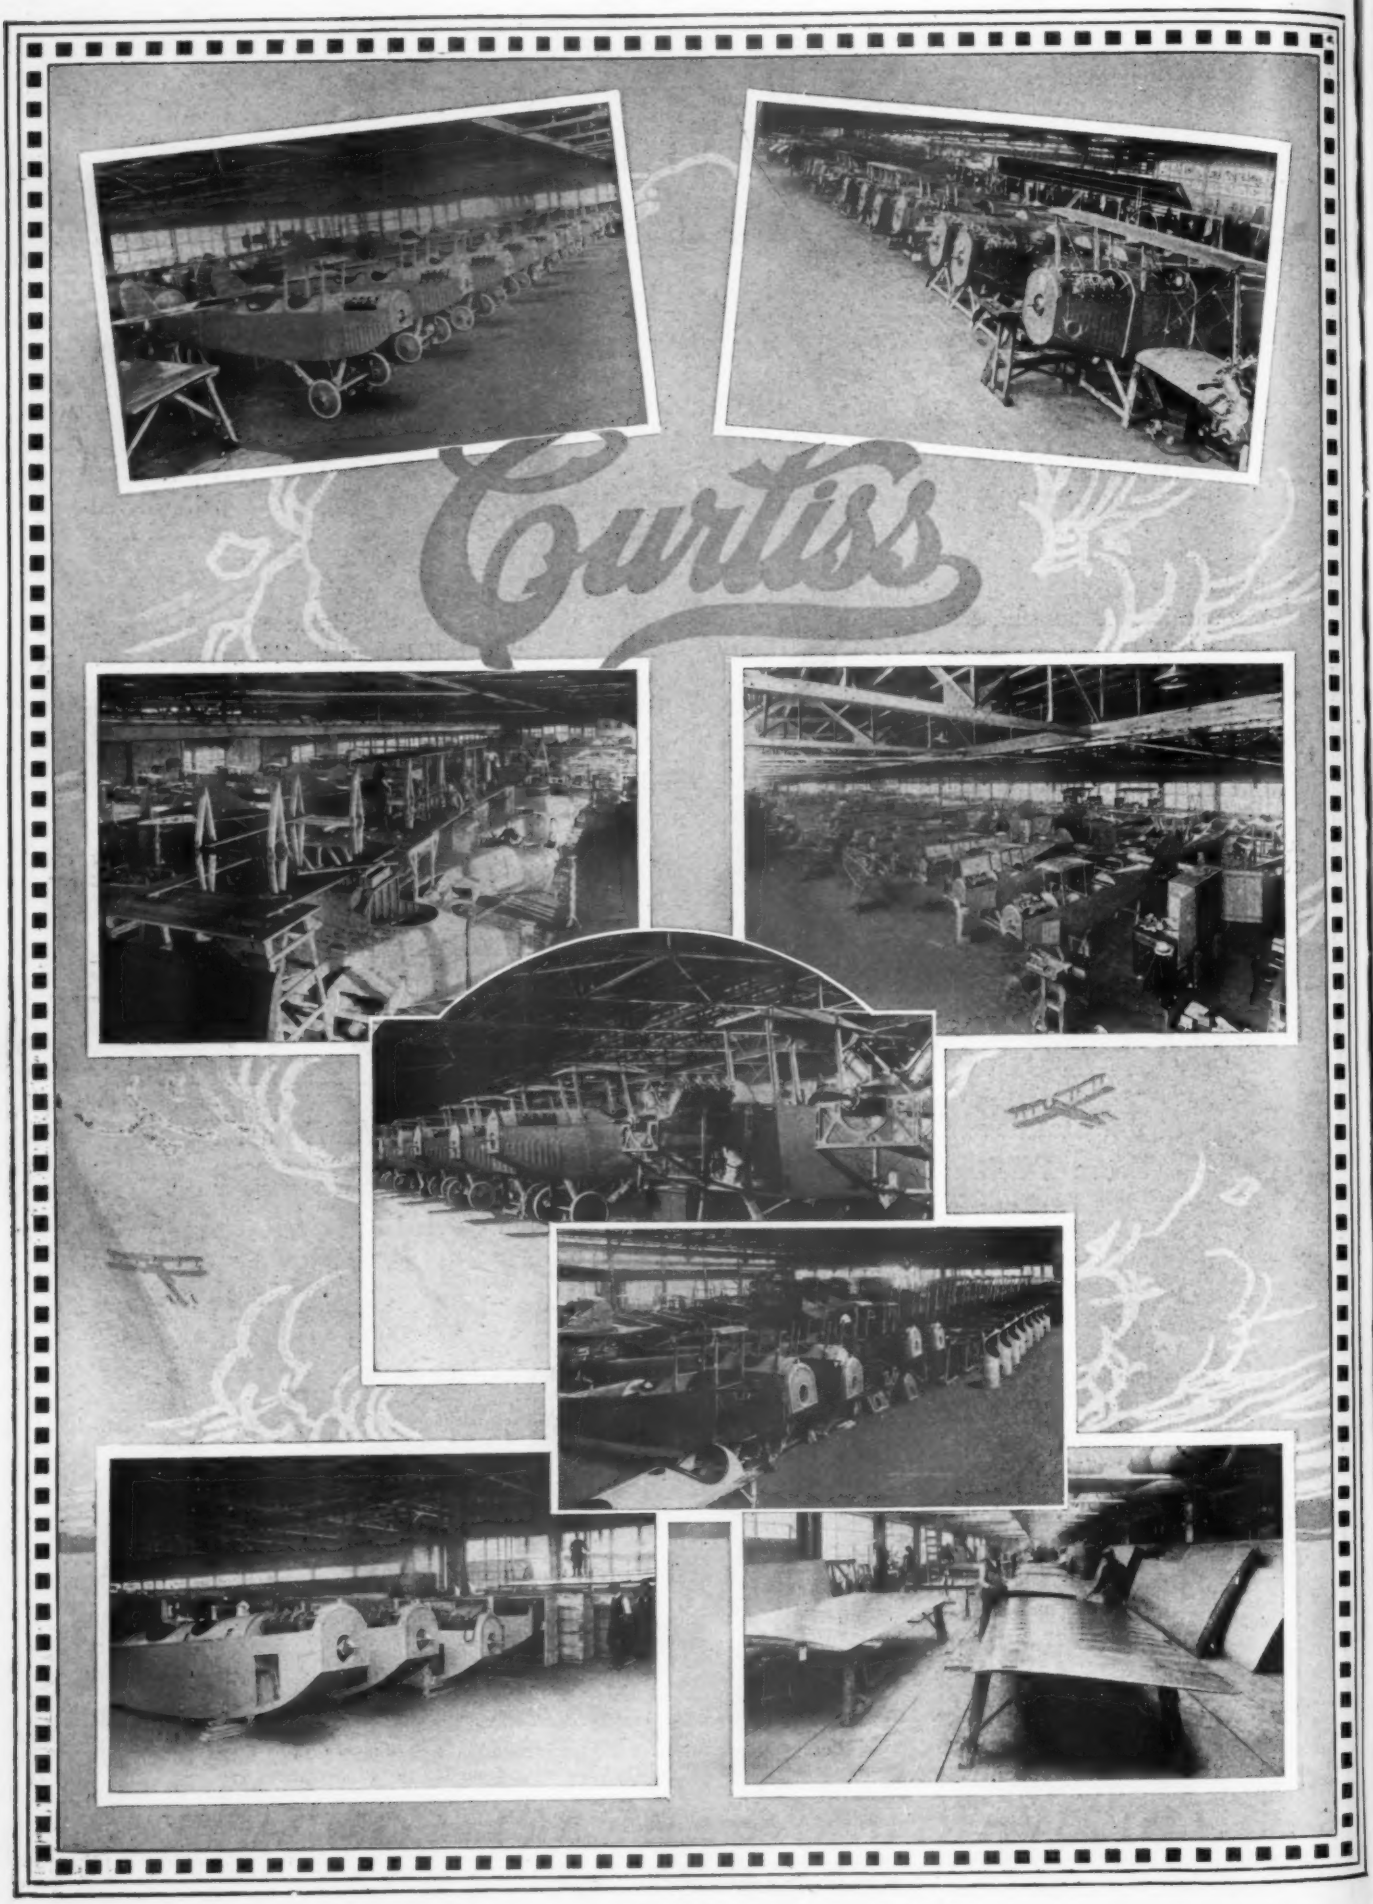

THE CURTISS AEROPLANE COMPANY, BUFFALO, N. Y.
Member Aircraft Manufacturers' Association, Inc.
America Trans Oceanic Company, 280 Madison Ave., New York City, New York Agents

PRESIDENT AND EDITOR
LESTER D. GARDNER

MILITARY EDITOR
1st Lieut. PHILIP J. ROOSEVELT*
*Absent on duty, Aviation Section, U. S. A.

AVIATION
AND
AERONAUTICAL ENGINEERING

TECHNICAL EDITOR
A. KLEMIN, A.C.G.I., B.Sc., S.M.
Instructor in Aeronautics
Massachusetts Institute of Technology

BUSINESS MANAGER
GEORGE NEWBOLD

Vol. II | July 15, 1917 | No. 12

THE House of Representatives in passing the Army Aviation Bill calling for $640,000,000 has done its part in expediting the aerial program which General Squier has submitted. With but a short discussion the bill was passed amid the cheers of members. It should be noted that the House Committee on Military Affairs, of which Mr. Dent is chairman, sponsored the bill and went over the plans for our air fleet with the leading authorities in Washington. On this committee's recommendation the House passed the bill blindly, leaving the whole expenditure in the hands of the President, the Secretary of War and General Squier.

The Senate, which usually inquires very closely into bills passed hurriedly by the House, can, from all reports, be relied upon to pass the measure in record time. The President has given his unqualified support, and the appropriation ought to become available within a week or two.

The bill provides that the appropriation covers the fiscal year ending June 30, 1918. So that this vast sum will have to be expended by that time. It is a tribute to the officers who have had a part in drawing up the aviation program which calls for this expenditure, that it was so convincing that the House was willing to take their assurances for its immediate necessity.

The development of aeronautics in this country is at last assured, where for so many years appeals for the proper provision for this arm of the service fell upon deaf ears. There is a tremendous task ahead of the aeronautical industry, which without doubt will rise to the occasion with energy and ability. With the support of the Aircraft Production Board and its broad and far-seeing plans for quantity production, the country may look forward to a realization of the aims and purposes for which these huge sums have been appropriated, at the earliest possible time and with the utmost efficiency.

The Navy Appropriations

Secretary Daniels has asked for $45,000,000 for aeronautics in the Navy. It is probable that his request will be granted and the Navy will be able to begin the expansion of the aerial branch of its service. Evidently the Navy feels that it should be cautious, but with the information that is now available regarding the naval uses of seaplanes, flying boats and dirigibles, there will become necessary a development far beyond the present plans.

In the navy the policy of silence may be misconstrued for inaction by those unacquainted with methods of naval bureaucracy. Local papers in various parts of the country have printed news which would indicate that the navy contemplates more activity in aeronautics than has been authoritatively announced.

The establishment of coastal stations for strategic as well as training purposes will help greatly to stimulate activity, for the practical experience gained from the use of aircraft has always broadened the plans of any service.

Italy's Quiet Progress

So much has been written of French, English and German progress in the air that the work of Italy in aeronautics has been overshadowed. Reports now reaching this country indicate that Italy has produced the fastest airplane, the best climber, the largest machine and a fleet of dirigibles which have performed marvelous work along the seacoast.

As submarine chasers the non-rigid dirigible type has been very effective. Italy is placing the greatest reliance on her dirigibles, and it will be well for the United States to profit by her experience.

The secret of Italy's success in aviation is due to the powerful and reliable engines which have been developed. It is asserted that the large Italian engines of 500-700 horse-power have proven that larger airplanes than have been thought possible from an engineering standpoint can be built and flown successfully. To demonstrate this point there is under construction an airplane using 3000 horse-power and designed to carry fifty passengers.

The Aircraft Production Board

Too great credit cannot be given to the members of the Production Board for their unselfish work on behalf of aviation. It will always be recognized as a great piece of constructive planning.

It has been unfortunate that the board has had to operate without its power being definitely understood or defined. It also has suffered because other similar boards have been under attack in Congress. Its powers, functions and authority should be closely defined. The clause in the aviation bill authorizing the board's expenses to be paid was taken out so that the future of the board will have to be carefully considered. The way out of the situation is for the members to accept commissions and in that way become the official purchasing and producing force of the Air Service. By doing this, the Army would have in its personnel some of the best business men in the country.

Tests on a Series of Propeller Blade Elements*

By Alexander Klemin

The object of the tests was to provide the designer of aerial propellers with information relative to a series of standard sections, from the thinnest to the thickest in practical use as elements of propeller blades, which might be readily employed

TABLE 1

TABLE FOR DIMENSIONS OF SECTIONS

Table of heights above Index Line in terms of c

Section	Index Ratio	$=\frac{h}{c}$	0	1	2	3	4	5	6	7	8	9	10
1	.050	....	.011	.039	.050	.055	.049	.040	.034	.028	.021	.013	.010
2	.075	....	.0115	.052	.071	.078	.071	.063	.055	.043	.031	.019	.011
3	.100	....	.0150	.053	.077	.090	.094	.087	.077	.060	.043	.026	.012
4	.150	....	.018	.088	.130	.147	.150	.135	.115	.093	.068	.039	.013
5	.175	....	.019	.097	.148	.170	.170	.155	.137	.111	.081	.049	.014
6	.200	Above Below	.021 .000	.105 .016	.158 .021	.190 .024	.197 .024	.185 .023	.165 .022	.131 .020	.094 .015	.053 .008	.014 .000
7	.250	Above Below	.023 .000	.177 .033	.200 .050	.232 .063	.250 .070	.240 .069	.205 .060	.165 .050	.120 .037	.070 .017	.014 .000
8	.300	Above Below	.025 .000	.150 .060	.235 .103	.276 .143	.300 .160	.290 .153	.250 .140	.200 .113	.146 .077	.090 .040	.015 .000

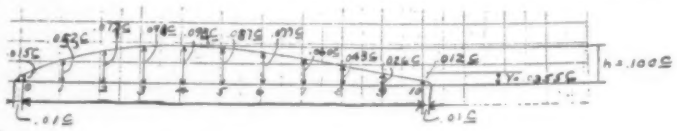

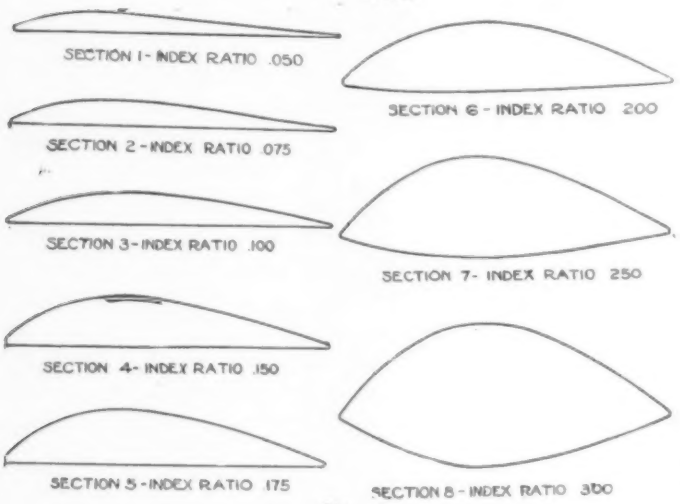
SECTION 1 - INDEX RATIO .050
SECTION 2 - INDEX RATIO .075
SECTION 3 - INDEX RATIO .100
SECTION 4 - INDEX RATIO .150
SECTION 5 - INDEX RATIO .175
SECTION 6 - INDEX RATIO .200
SECTION 7 - INDEX RATIO .250
SECTION 8 - INDEX RATIO .300

FIG. 1

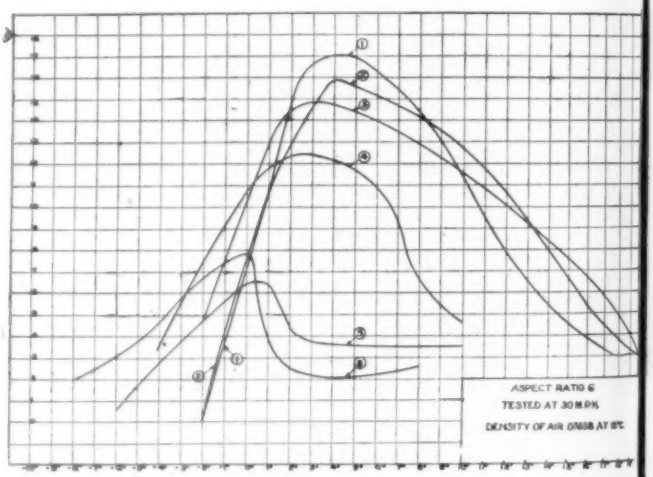
ASPECT RATIO 6
TESTED AT 30 M.P.H.
DENSITY OF AIR .0988 AT 8°C
ANGLE OF INDEX LINE TO WIND
SECTIONS 7 & 8 HAVE NEGATIVE L/D FOR VALUES SEE TABLE 3

FIG. 2

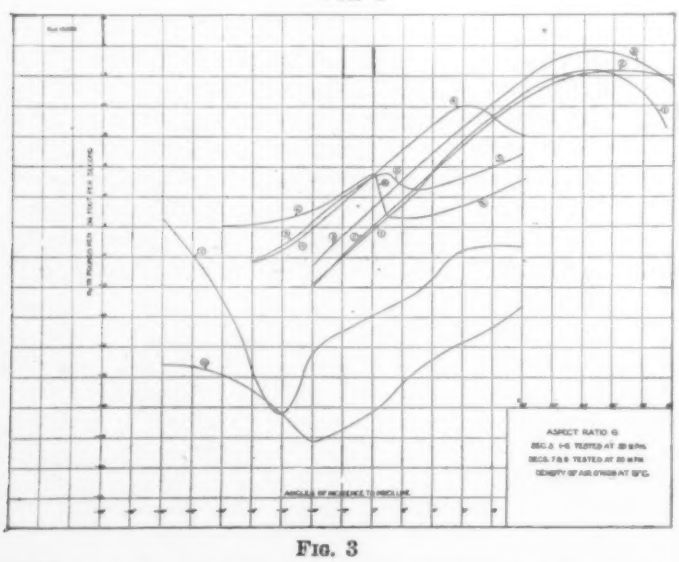

FIG. 3

in making a design in accordance with the Drzewiecki method.

The eight sections were developed on empirical grounds from consideration of a variety of sections and propellers.

The maximum thickness of the first section in the series developed occurs at about 25 per cent of the chord length from the leading edge, and gradually shifts back as the section thickens. Experiments on aerofoils, of constant camber with the position of maximum ordinate varied, tend to show that this maximum is 1/3 of the chord from the leading edge.

The N.P.L. experiments were conducted for one camber, however, and it does not follow that the same position of maximum thickness would be most suitable for sections of other camber. Moreover within the range of angles commonly employed in propeller design, 4 to 10 degrees, these experiments show no important variation in either K_y or K_x values as the position of maximum ordinate was varied.

Since in actual practical fairing the maximum thickness of necessity moves back, the above development seems legitimate. The edges both at leading edge and trailing edge have been slightly rounded off to correspond with actual propeller design

* Abstract of a Thesis presented at the Massachusetts Institute of Technology.

where a section brought to a sharp edge is liable to breakage.

A series of exponential curves were developed giving the thickness of the section at any point for any ratio of maximum depth/chord. These are not readily used however, and are not included. Interpolation between the values given in the tables for the eight sections should be sufficient for all practical purposes.

The index line is the term employed for the length c between the points where the rounding off of the sections begins, as illustrated in sketch under TABLE 1. The maximum height of the section above the index line is termed h. The ratio $\frac{h}{c}$ is termed the index ratio i, and serves to define any section. The development of the sections from the dimensions in TABLE 1 is sufficiently illustrated by the same sketch.

TABLES 2 and 3 give the results for K_y, K_x and L/D at various angles of incidence, for both the single cambered and the double cambered surfaces.

In TABLE 4 a comparison is made between the single cambered sections tested, and a series tested by the N.P.L. The Massachusetts Institute of Technology series seems to be considerably more efficient, but with smaller lift values for the angles of attack commonly used in propeller design and therefore less thrust. Where the index ratio is as high as .175, the N.P.L. section is better aerodynamically. This section is so thick, however, that it would be employed near the hub where little load is taken up by the element in any case.

In Fig. 1 the sections are developed, and in Figs. 2 and 3, the L/D and K_y curves are given for each section for varying angles of incidence.

TABLE 2

SINGLE CAMBERED SURFACES

Aspect Ratio 6. K_y and K_x in pounds/sq. foot per foot second

Section		−10°	−8°	−6°	−4°	−2°	0°	1°	2°	4°	6°	8°	10°	12°	16°	18°	20°
1	K_y×10,000	....	....	....	−1, 85	+0, 03	1, 36	....	3, 43	5, 75	7, 72	9, 40	10, 85	...	12, 02	10, 58	...
	K_x×10,000	....	....	....	0, 42	+0, 26	0, 19	....	0, 23	0, 33	0, 48	0, 65	0, 95	...	3, 16	3, 67	...
	L/D	....	....	....	....	0, 05	7, 15	....	14, 85	17, 10	16, 25	14, 40	11, 40	...	3, 82	2, 88	...
2	K_y×10,000	....	....	....	−1, 96	+0, 14	2, 01	2, 92	3, 80	5, 50	7, 27	9, 10	...	11, 55	12, 30	12, 25	11, 49
	K_x×10,000	....	....	....	0, 53	0, 48	0, 27	0, 27	0, 29	0, 347	0, 48	0, 64	...	1, 08	2, 33	3, 310	3, 920
	L/D	....	....	....	....	....	7, 54	10, 95	12, 90	15, 85	15, 15	14, 20	...	10, 70	5, 30	3, 90	2, 94
3	K_y×10,000	....	....	....	−0, 60	1, 45	3, 28	4, 14	5, 16	7, 05	8, 77	10, 20	...	13, 10	13, 40	12, 20	11, 30
	K_x×10,000	....	....	....	0, 435	0, 312	0, 312	0, 312	0, 353	0, 476	0, 625	0, 815	...	1, 25	2, 16	3, 40	4, 02
	L/D	....	....	....	....	4, 65	10, 55	13, 25	14, 60	14, 60	14, 00	12, 80	...	10, 45	6, 20 (?)	3, 60	2, 82
4	K_y×10,000	....	−0, 081	−0, 01	2, 12	3, 74	5, 60	6, 47	7, 25	8, 86	10, 40	9, 30	8, 05	...	...	...	...
	K_x×10,000	....	+0, 150	0, 83	0, 587	0, 505	0, 518	0, 545	0, 586	0, 736	0, 926	1, 33	1, 76	...	...	...	...
	L/D	....	....	....	3, 61	7, 42	10, 80	11, 85	12, 35	12, 00	11, 22	6, 50	4, 56	...	...	...	...
5	K_y×10,000	−0, 60	−0, 29	+0, 64	2, 34	3, 84	5, 30	5, 56	4, 70	4, 62	5, 28	6, 07	6, 82	...	...	...	...
	K_x×10,000	1, 61	1, 34	1, 06	0, 86	0, 80	0, 82	0, 91	1, 10	1, 32	1, 47	1, 74	2, 00	...	...	...	...
	L/D	....	....	0, 60	2, 72	4, 76	6, 50	6, 10	4, 26	3, 50	3, 62	3, 50	3, 40	...	...	...	...

TABLE 3

DOUBLE CAMBERED SURFACES

Aspect Ratio 6. K_y and K_x in pounds/sq. foot/per foot sec.

Section		−18°	−14°	−10°	−8°	−6°	−4°	−2°	0°	1°	2°	4°	6°	8°	10°
6	K_y×10,000	2, 10	...	2, 10	2, 12	2, 57	3, 00	4, 23	5, 52	2, 66	2, 68	2, 68	3, 47	4, 34	5, 15
	K_x×10,000	...	...	1, 44	1, 07	0, 76	0, 65	0, 63	0, 66	0, 71	0, 90	1, 28	1, 49	1, 73	1, 97
	L/D	...	...	1, 45	1, 98	3, 00	4, 62	6, 70	7, 76	3, 74	2, 44	2, 09	2, 33	2, 50	2, 62
7	K_y×10,000	2, 29	2, 62	−2, 86	−7, 72	−10, 45	−6, 40	−5, 04	−3, 90	−3, 33	−2, 88	−1, 54	−0, 50	0, 61	1, 71
	K_x×10,000	2, 72	2, 44	2, 06	1, 90	1, 81	1, 75	1, 78	1, 78	1, 78	1, 78	1, 86	1, 99	2, 14	2, 35
	L/D	...	...	...	...	...	...	...	...	...	...	...	...	...	...
8	K_y×10,000	−3, 07	−7, 20	−7, 96	−8, 85	−10, 45	−12, 30	−11, 40	−10, 35	−9, 50	−7, 90	−6, 85	−5, 70	−4, 72	−3, 26
	K_x×10,000	2, 95	2, 84	2, 78	2, 66	2, 54	2, 38	2, 36	2, 38	2, 38	2, 38	2, 38	2, 41	2, 54	2, 74
	L/D	...	...	...	...	...	...	...	...	...	...	...	...	...	...

TABLE 4

SINGLE CAMBERED SURFACES

Aspect Ratio 6. K_y and K_x in pounds/per sq. foot/foot sec.

Comparison with N. P. L. Sections

			2°		4°		6°		8°	
			K_y×10,000	L/D	K_y×10,000	L/D	K_y×10,000	L/D	K_y×10,000	L/D
Section 1	Index Ratio	.05	3, 43	14, 85	5, 75	17, 10	7, 72	16, 25	9, 40	14, 40
N.P.L. 2	Ordinate / Chord	.05	3, 93	13, 10	5, 75	14, 8	7, 70	14, 10	9, 75	13, 1
Section 2	Index Ratio	.075	3, 80	12, 90	5, 50	15, 85	7, 27	15, 15	9, 10	14, 20
N.P.L. 3	Ordinate / Chord	.075	5, 50	13, 5	17, 20	14, 10	8, 75	13, 1	11, 60	11, 70
Section 3	Index Ratio	.100	5, 16	14, 60	7, 05	14, 60	8, 77	14, 00	10, 20	12, 80
N.P.L. 4	Ordinate / Chord	.100	6, 10	11, 80	8, 10	12, 8	9, 80	12, 10	11, 40	11, 50
Section 4	Index Ratio	.150	7, 25	12, 35	8, 86	12, 00	10, 40	10, 30	9, 50	6, 50
N.P.L. 4	Ordinate / Chord	.150	7, 75	11, 00	9, 05	11, 40	10, 45	10, 30	12, 35	9, 80
Section 5	Index Ratio	.175	4, 70	4, 26	4, 62	3, 50	5, 28	3, 62	6, 07	3, 50
N.P.L. 7	Ordinate / Chord	.175	5, 85	9, 6	9, 85	10, 20	11, 35	9, 70	7, 97	5, 20

The thick double cambered sections show a pronounced negative lift at small angles. This is in accordance with previous experimental results. Considerable care must be exercised in employing such sections. It would seem safer to enclose the center portion of a propeller with a stream-line cowl.

References

Notes on Aerial Propellers, by H. Bolas. *British Report*, 1911-1912.
Luftschrauben-untersuchungen, by Bendemann. *Zeitschrift für Flugtechnik*, 1911-1912.
Aerofoils with Plane Under Surface and Varying Camber of Upper Surface. *British Report*, 1911-1912.

In connection with the Army tests of wing sections, as reported in AVIATION AND AERONAUTICAL ENGINEERING, April 15, 1917, two propeller sections, U. S. A. 10 and U. S. A. 11, were tested. The results are given herewith, both graphically and in tabular form. The values of L/D obtained were comparable with those secured from the very best wing sections, being well above sixteen in both cases. These sections are of such thickness that they would be suitable for use in the other quarter of the blade.

TABLE OF CAMBER FOR U. S. A. 10 AND 11

Distance from leading edge	Camber of upper surface U. S. A. 10	U. S. A. 11
0	.0125	.0125
.0125	.0243	.0232
.025	.0343	.0321
.050	.0470	.0445
.075	.0573	.0530
.100	.0632	.0585
.200	.0727	.0678
.300	.0750	.0712
.400	.0745	.0705
.500	.0710	.0663
.600	.0643	.0595
.700	.0538	.0500
.800	.0420	.0392
.900	.0292	.0277
1.000	.0150	.0150

TABLE OF CHARACTERISTICS FOR U. S. A. 10 AND 11

Angle	U. S. A. 10 Ky	Kx	L/D	U. S. A. 11 Ky	Kx	L/D
0	.000550	.0000711	7.73	.000490	.0000681	7.20
2	.001030	.0000666	15.50	.000985	.0000681	14.45
3	.001235	.0000755	16.40	.001220	.0000740	16.45
4	.001425	.0000932	15.98	.001400	.0000830	16.55
5	.001620	.0001045	15.50	.001590	.0001008	15.80
8	.002200	.0001660	13.28	.002195	.0001600	13.70
10	.002575	.0002161	11.90	.002540	.0002100	12.10
12	.002870	.0002902	9.90	.002850	.0002890	9.85
14	.002510	.0005130	4.90	.002585	.0004900	5.27

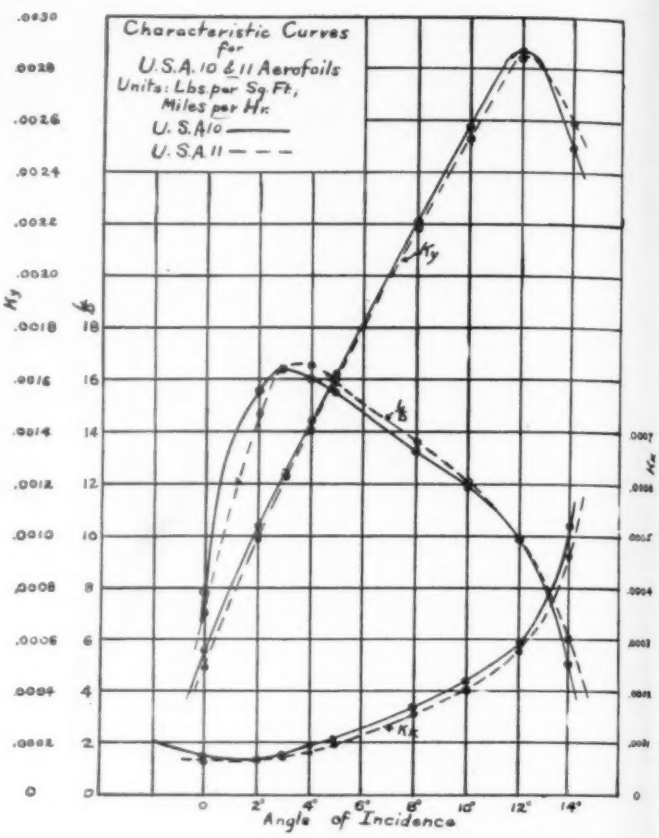

Method of Approximating Static Thrust of Propellers

By Frank W. Caldwell

It is often desirable to know roughly what static thrust a propeller will develop. Computations based on the coefficients of elemental aerofoils are rather involved and do not give a satisfactory analysis of static conditions.

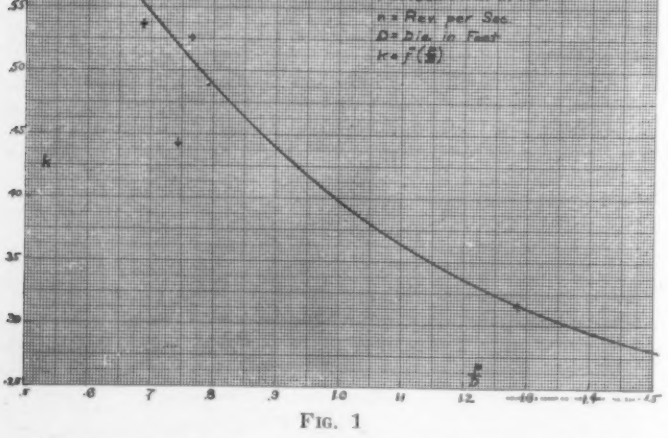

FIG. 1

It is thought that it may be possible to estimate the thrust within 15 or 20 per cent by ignoring the width of the blade and the shape of the sections.

The graph in Fig. 1 shows a formula which is based on tests on a number of propellers. The extreme limits are: a propeller of 8 ft. 6 in. diameter and 10.92 ft. pitch turning at 458 r.p.m., and a propeller of 9 ft. diameter and 5 ft. 6 in. pitch turning at 1500 r.p.m.

It is desirable to obtain more points for this curve, since the number of propellers tested is rather small. The formula is derived as follows:

Suppose a column of air, whose cross section has an area equal to $\frac{\pi D^2}{4}$ where D is the diameter of the propeller in feet, is set in motion and given a velocity knP where n is the number of revolutions per second, P is the mean pitch and k is a constant for any given propeller. The reaction of such a column of air will be equal to MV. M is equal to $\frac{W}{g}$, which is equal to the density of the air times the area of the column times the velocity of the column. Then M is equal to $\frac{1}{12.4_g} \times \frac{\pi D^2}{4} \times knP$. The velocity V is equal to knP. Therefore, the static thrust T_o is equal to $\frac{1}{12.4 \times 32.2} \times \frac{\pi D^2}{4} \times knP \times knP$. This reduces to the form $T_o = \frac{(knPD)^2}{508}$.

The value of k was solved for in each case, and the results were plotted against ratio $\frac{P}{D}$.

Editor's Note.—It is hoped that other engineers will send in similar figures, so that further comparisons may be made.

Course in Aerodynamics and Airplane Design

By Alexander Klemin, A.C.G.I., B.Sc., S.M.

Instructor in Aeronautics, Massachusetts Institute of Technology, Member of the Aeronautical Society of Great Britain and Ireland,

and

T. H. Huff, S.B.

Instructor in Aeronautics, Massachusetts Institute of Technology

Copyright, 1917, by A. Klemin. All Rights Reserved.

PART II—SECTION 11

Wing Structure Analysis for Biplanes

There are many difficulties in the analysis of a biplane structure: the distribution of loading between upper and lower planes; the resolution of loading in the planes of the lift truss and the internal bracing; the resolution of loading to give bending moments on the spars, and the alternative methods which may be employed in drawing up the stress diagrams. But in the following notes is developed a system which is now generally employed, and which although it is not rigidly exact,

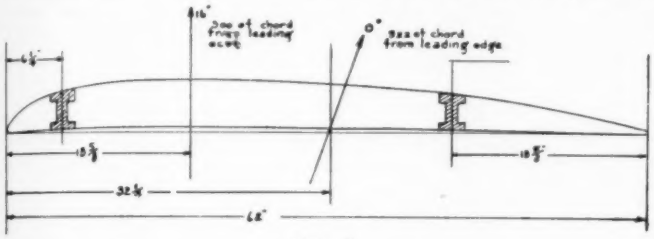

FIG. 1

gives sufficiently accurate results for practical needs, and as a system of comparison for machines which have been successful in flight.

Distribution Between Planes

The information available regarding distribution of loads between planes is scanty and contradictory. In practice it is sufficient to follow this equation:

(1) $W = (A_u x)\frac{11}{9} + A_l x$, where W = gross loading of the machine, A_u = area of upper wing, A_l = area of lower wing, x = gross loading per square foot on lower wing, $\frac{11}{9}x$ = gross loading per square foot on upper wing.

Unless the biplane truss falls away very much indeed from the conventional form, this will be a fair approximation.

Spacing of Wing Spars—Limiting Angles of Incidence

As the angle of incidence of a wing changes its center of pressure moves, and accordingly varying loads are placed on the rear and front spars (the center of pressure motion in a biplane is assumed to be identical with that of a monoplane). The spar spacing has to be so arranged that too great a proportion of the load is not thrown on either of the spars within the range of the usual angle of flight. This would be the case were the spars too close together or placed so that one of them would be quite close to one center of pressure. At the same time, the spars must not be placed too near either the front or the rear edge, so that there is always sufficient depth of spar. Thus in the machine design of which we are carrying through, the spars are placed as shown in Fig. 1, about 10 per cent from leading edge and about 30 per cent from trailing edge, where the centers of pressure at 0 deg. and at 16 deg. are indicated. The loading is in this case

	Front spar	Rear spar
At 0°	29.8%	60.2%
At 16°	66.6%	33.3%

0 deg. and 16 deg. are taken in our design as the limiting angles of incidence, although very possibly the machine might fly both at some negative angle, and at some angle above 16 deg.

Running Loads

Applying equation (1) where $W = 1850$ lb. and $A_u = 188$ sq. ft., $A_l = 188$ sq. ft. for our machine, we find that the gross loading per square foot on the upper wing is 5.4 lb./sq. ft. and on the lower wing it is 4.43 lb./sq. foot. In the same manner the total gross weight supported by the upper wing is 1020 lb. and the total gross weight supported by the lower wing is 830 lb.

For simplicity, the running load is assumed to be uniform from tip to tip of the wings, and hence the gross running lifts are for a span of 36 ft. 5 in., 28.0 lb./foot on upper wing and 22.8 lb./foot on lower wing.

It is from the gross running lifts per foot that we obtain the running drifts per foot run, by dividing the L/D ratio. Thus we have

	L/D	Upper wing running drift in lb./ft. run	Lower wing running drift in lb./ft. run
At 0°	7.2	3.90	3.18
At 16°	6.92	4.05	3.30

Next it is necessary to determine the net running lift. To do this it is necessary to make assumptions for the weight of the wings and the weight of the interplane bracing.

Thus for the upper wing, assuming a weight of .73 lb./sq. ft., and half the weight of the interplane bracing of 91.5 lb. to be carried by it, we have a net lift of 1020 — 137 — 45.7 = 837.3 lb. or 22.9 lb./ft. run, and for the lower wing 830 — 137 — 45.7 = 647.3 lb. or 17.7 lb./ft. run.

We can now tabulate our results in such form that they can be used in resolving forces in planes of lift trussing and of the wings.

At 0°	Upper wing	Lower wing
Gross loading per foot run..	28 lb.	22.8 lb.
Drift per ft. run front spar.	1.06 lb.	.865 lb.
Drift per ft. run rear spar..	2.34 lb.	1.90 lb.
Net lift per ft. run front spar	6.85 lb.	5.60 lb.
Net lift per ft. run rear spar	13.80 lb	11.2 lb.

Percentage front spar 29.8
Percentage rear spar 60.2

At 16°	Upper wing	Lower wing
Drift per ft. run front spar..	2.70	2.17
Drift per ft. run rear spar..	1.35	1.09
Net lift per ft. run front spar	15.20	12.20
Net lift per ft. run rear spar	7.65	6.15

Percentage front spar 66.6
Percentage rear spar 33.3

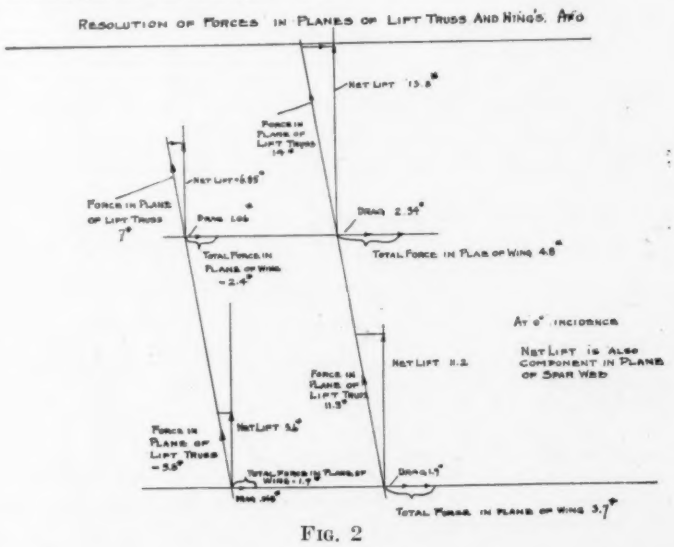
RESOLUTION OF FORCES IN PLANES OF LIFT TRUSS AND WING'S. AT 0
NET LIFT 13.8
FORCE IN PLANE OF LIFT TRUSS 14.4
NET LIFT=6.85
FORCE IN PLANE OF LIFT TRUSS 7°
DRAG 2.34
TOTAL FORCE IN PLANE OF WING 4.8
TOTAL FORCE IN PLANE OF WING = 2.4
AT 0° INCIDENCE
NET LIFT 11.2
NET LIFT IS ALSO COMPONENT IN PLANE OF SPAR WEB
FORCE IN PLANE OF LIFT TRUSS 11.3
NET LIFT 5.6
FORCE IN PLANE OF LIFT TRUSS = 5.8
TOTAL FORCE IN PLANE OF WING = 1.7
DRAG 1.7
TOTAL FORCE IN PLANE OF WING 3.7

FIG. 2

Resolution of Forces in Planes of Wing Trussing and of Wings, and in Plane of Spar Web

In Figs. 2 and 3 are shown the resolutions of forces at 0 deg. and 16 deg. respectively. It will be noticed that the resultant

force in the plane of the wings is decomposed in plane of the spar web. It is this component in the plane of spar web which is subsequently used to draw the bending moment diagrams

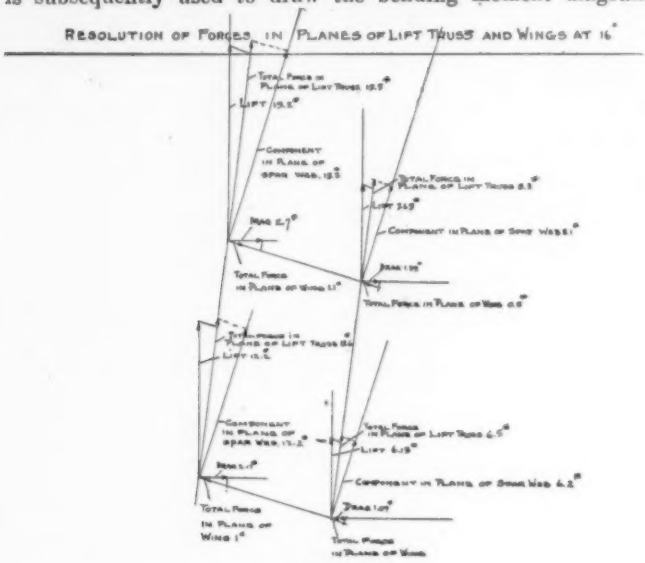

FIG. 3

for the spars. This is a slightly arbitrary procedure. It would be more accurate to take the force in the plane of the lift truss as producing bending, but there would then be the complication of computing moments of inertia about an axis not perpendicular to the web.

From these resolutions it is now possible to tabulate figures which can be employed in the lift truss stress diagram, the drift bracing stress diagram, etc.

At 0°

Upper wing.		Lower wing.	
Front spar.	Rear spar.	Front spar.	Rear spar.
Force in plane of lift truss/ running foot.		Force in plane of lift truss/ running foot.	
7 lb.	14 lb.	58 lb.	11.5 lb.
Force in plane of wing/running foot.		Force in plane of wing/running foot.	
2.4 lb.	4.80 lb.	1.9 lb.	3.7 lb.
Force in plane of spar web/ running foot.		Force in plane of spar web/ running foot.	
6.85 lb.	13.8 lb.	5.6 lb.	11.2 lb.

At 16°

Upper wing.		Lower wing.	
Front spar.	Rear spar.	Front spar.	Rear spar.
Force in plane of lift truss/ running foot.		Force in plane of lift truss/ running foot.	
15.5 lb.	8.3 lb.	12.6 lb.	6.5 lb.
Force in plane of wing/running foot.		Force in plane of wing/running foot.	
1.1 lb.	0.5 lb.	1.0 lb.	.3 lb.
Force in plane of spar web/ running foot.		Force in plane of spar web/ running foot.	
15.2 lb.	8.1 lb.	12.2 lb.	6.2 lb.

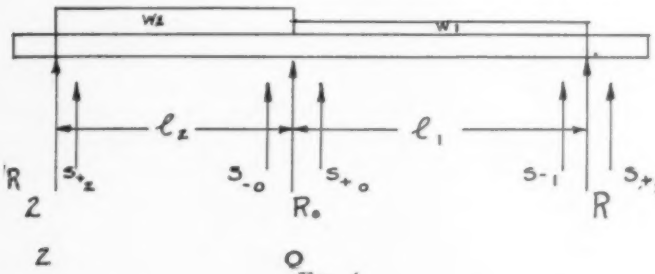

FIG. 4

Figs. 2 and 3 indicate some peculiar results. Thus at 0 deg., part of the net lift is resolved into the plane of the wing, greatly increasing the demands on the internal wing bracing. Were the stagger of the biplane more pronounced, this effect would be still greater, and that is one of the disadvantages of excessive stagger. But at 16 deg., in this particular case, the component of the net lift along the plane of the wing relieves the internal wing bracing.

Different Methods Employed in Stress Diagrams for Lift Truss

Two distinct methods have been adopted in getting out stress diagrams for the lift truss.

(1) The trussing is treated as if pin jointed throughout by the ordinary bridge truss method, and the bending moments for the spars found as if they were freely supported at the ends, with uniformly distributed loads.

(2) The spars are treated as if continuous, so that bending moments in them and reactions at their supports are found by theorem of three moments. Then the reactions having been found, the stress diagram is drawn with such reactions as a basis.

The first method has the advantage of simplicity and of giving a very large factor of safety. The second method is much more difficult, but probably is nearer the mark, and we shall employ it accordingly.

Bending Moment Diagrams: Theorem of Three Moments

Any good text book on applied mechanics treats fully of the theorem of three moments, so that the following notes will be of the briefest:

In Fig. 4 is shown a beam loaded with unequal distributed loads over the two spans. At the three supports, 0, 1, 2 M_0, M_1, M_2 are corresponding bending moments; R_0, R_1, R_2 are corresponding reactions; $S+_0$, $S-_0$; $S+_1$, $S-_1$; $S+_2$, $S-_2$ are shears on either side of the supports.

If the beam is continuous over the three supports and has the same cross-section throughout, the bending moments at the supports and the loads are connected by the following formula:

$$M_1 l_1 + 2(l_1 + l_2) M_0 + M_2 l_2 = -\frac{w_1 l_1^3}{4} - \frac{w_2 l_2^3}{4}.$$

All difficulties in working the theory of three moments are due to mistakes in the conventional signs.

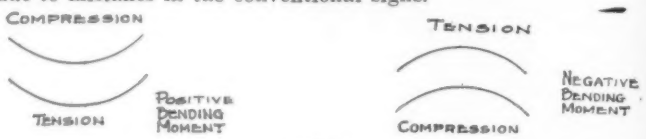

FIG. 5

The convention for bending moments is shown in Fig. 5. From this follows the rule:

Forces to left of a point must tend to turn a beam clockwise about that point in order to give a positive bending moment at that point—anti-clockwise to give a negative bending moment.

Forces to the right of a point must turn the beam anti-clockwise about that point in order to give a positive bending moment at that point—clockwise to give a negative bending moment.

If these rules are observed, the effect of the fixing moments is also automatically determined. Thus if a fixing moment is found to be negative at a support, and the above rules are followed, its effect will be negative on either side of that support.



FIG. 6

The convention for shear is shown in Fig. 6. If forces to the left of a point tend to sheer beam upward, the shear at this point is positive.

Observance of this rule is not so important as the observance of the rule for bending moments. It is generally easier to see what happens physically.

Working Out of Bending Moment and Shear Diagrams for Upper Rear at 0 Deg.

The principles of the preceding paragraph will be best illustrated by working out the above case fully. In Fig. 7 is shown the disposition of the wing. With a total span of 36 ft. 6 in. and an engine panel of 2 ft. 6 in., we allow an overhang of 2 ft. 6 in., 7 ft. 9 in. for outer span between struts, and a smaller inner span of 6 ft. 9 in., which seems a reasonable spacing. The loading in plane of spar web as previously found is 13.8 lb./ft. run. For simplicity's sake, we neglect the engine panel, and loads are taken as acting down for same reason.

To get bending moments at supports:

(a) $M_1 = O$, since wing is hinged at engine panel;

(b) $M_2 = -\frac{13.8(2\frac{1}{2})^2}{2} = -43.3$ ft. lb. negative in accordance with our rule;

(c) to find M_0 we write $M_1 1_1 + 2(1_1 + 1_2)M_0 + M_2 1_2 = -\frac{1}{4}w_1 1_1^3 - \frac{1}{4}w_2 1_2^3$, from which M_0 becomes 80.5 ft. lb.

To get shears at supports:

(a) $S_{-2} = (2\frac{1}{2})(13.8) = 34.4$ lb. Therefore $S_{-2} = 34.4$;

(b) Taking moments about support 1 we have $M_2 + S_{+2} 1_2 - \frac{W_2 1_2}{2} = M_0$; $-43.3 + S_{+2}(7.75) - \frac{13.8(7.75)^2}{2} = -80.5$: therefore $S_{+2} = 48.7$;

(c) Taking moments about support 2 we have $M_0 - \frac{w_2 1^2 2}{2} + S_{-0} 1_2 = M_2$; $-80.5 - \frac{13.8(7.75)^2}{2} + S_{-0}(7.75) = 43.3$: . $S_{-0} = 58.0$;

(d) Taking moments about support 1, we have $M_0 - \frac{w_1 1^2 1}{2} + S_{-1} 1_1 = M_0$, or $-\frac{13.8(6.75)^2}{2} + S_{-1}(6.75) = -80.5$: . $S_{-1} = 34.6$.

To get reactions, we have

$$S_{-2} + S_{+2} = R_2 = 83.1$$
$$S_{-0} + S_{+0} = R_0 = 116.5$$
$$S_{-1} = R_1 = 34.6$$

After having found bending moments, shears and reactions at supports, it is very easy to draw the entire bending moment diagram by finding points of zero shear and maximum bending moment:

Thus in outer span, if x is distance to right of Support 2 of point of zero shear, $S_{+2} = xw_2$ and $x = \frac{48.7}{13.8}$ 3.52 ft.

Bending moment at this point is (taking forces to left) $M_2 = \frac{w_2 x^2}{2} + S_{+2} x = 42.2$ ft. lb.

Similarly in inner span if x = distance to right of support 0 of point of zero shear $S_{+0} = xw_1$ and $x = 4.25$.

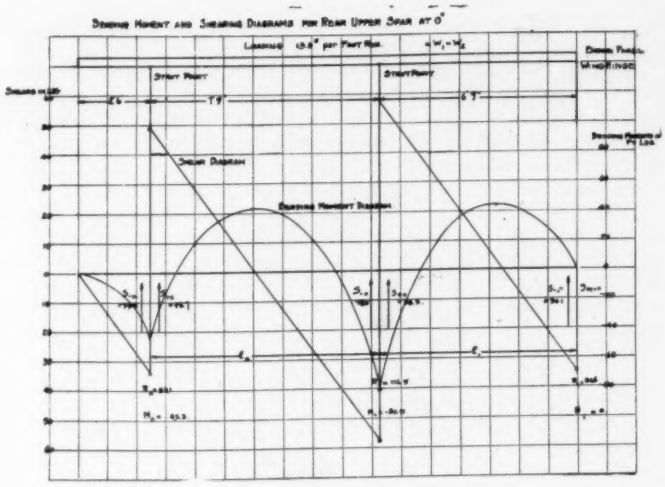

FIG. 7

Bending moment at this point is (taking faces to left) $M_0 = \frac{w_1 x_2}{2} S_{+0} x = 43.5$ ft. lb.

These points having been found, the bending moment diagram can be sketched in.

References

"Wing Data and Analysis for a Staggered Biplane by Dr. A. F. Zahm, Franklin Institute, December 1914.

British Report 1912-1913. No. 83. A preliminary note on methods of calculation which may be employed in the determination of the stresses in the spars of airplane wings by Bairstow and MacLachlan.

Syllabus of Lectures on Meteorology Given in the Course in Aeronautical Engineering at the Massachusetts Institute of Technology in Cooperation with Harvard University

Part I

Ten Lectures by Robert De C. Ward, Professor of Climatology, Harvard University

Introductory

Importance of Meteorology in aviation; aircraft and weather in war:

(a) General climate;

(b) Weather and weather forecasts; military field meteorological services.

The Atmosphere

Composition; height; "Troposphere" and "Stratosphere"; general characteristics of each.

Temperatures in the Free Air

Vertical temperature gradients; temperatures at various heights; inversions; stable and unstable conditions in relation to flying.

Pressure

Importance; comparison with water; decrease with altitude; physiological effects of diminished pressure; measurement; mercurial and aneroid barometers and barographs: use, errors, corrections; determination of altitudes by means of barometers; isobars; pressure gradients.

The Wind in Relation to Pressure at Earth's Surface

Wind direction; deflection of winds from gradient; earth's rotation and friction; cyclonic and anticyclonic wind systems; "Gradient Wind"; Buys Ballot's Law; isobaric types. Wind velocity; general relation to gradient; Beaufort Scale and its equivalents in force, and in velocity in miles an hour; Anemometers; Robinson and Dines; gustiness of wind.

Conditions of the Atmosphere Affecting Aviation

General and Local: (a) General air movements, essentially horizontal; atmospheric layers and waves. (b) Local convectional currents, essentially vertical, due to thermal controls; causes and conditions. (c) Effects of topography upon air movements, combining both horizontal and vertical elements, due to mechanical controls; effects of friction, topography, and character of surface; vertical and horizontal movements in general in relation to flight.

Weather Forecasting

Explanation of daily weather map; principles of forecasting explained by reference to type maps, for United States and for Europe; general characteristics of cyclones and anticyclones; tracks; velocities of progression.

Non-Instrumental Local Forecasts

Barometric tendency; veering and backing winds; changes in wind velocity; weather proverbs.

Clouds

Types; cloud classification; methods of determining cloud heights and velocities, and results; value as weather prognostics; fair and wet weather clouds; fog, special consideration of cumulus and cumulo-nimbus.

Forecasts of Wind Velocity and Direction Aloft

Direct observation by means of pilot balloons, kites and cloud movements; directions of cloud movements in cyclonic and anticyclonic systems in the United States and in Europe; estimates based on surface conditions and on general knowledge of upper air currents; "gradient wind"; diurnal variation in wind velocity and direction; changes due to progression of cyclones and anticyclones; wind and cloud directions and night flying.

Favorable and Unfavorable Weather for Flying

Wind; clouds; haze, etc.

Part II

Laboratory Work at Blue Hill Observatory (10 hours); Alexander G. McAdie, Abbott Lawrence Rotch Professor of Meteorology, Harvard University, and Director of the Blue Hill Meteorological Observatory, Readville, Mass.

Psychological Aspects of Aeronautics

By Harold E. Burtt, Ph.D.

During the past year there has been in progress in the Harvard Psychological Laboratory a study of certain psychological aspects of aviation. Experiments upon the first problem as to the delicacy of perception of changes in equilibrium in various directions have already been recounted.* It was found that a change of equilibrium in a lateral direction (roll) is generally perceived much more readily than in a longitudinal direction (pitch), and the possible practical implication of this fact in the selection or arrangement of airplane controls was noted. The following is an account of the study of a related problem—the comparative rapidity of reaction to sudden changes of equilibrium with various types of airplane control.

It seemed possible from theoretical considerations that a reaction with a dep control, for example, might involve a mental and motor attitude appreciably different from that involved in a reaction with a stick control. In banking the wings, the wheel warp and the lateral motion of the stick employ quite different muscular performances, and consequently different regions of the brain governing the muscles, and even in controlling pitch, the use of two hands and of one hand in moving the control backward and forward are two distinctly different operations. It was suspected that an aviator might actually react more quickly when making one form of motion than when making another. Accordingly, this hypothesis was subjected to the experimental test.

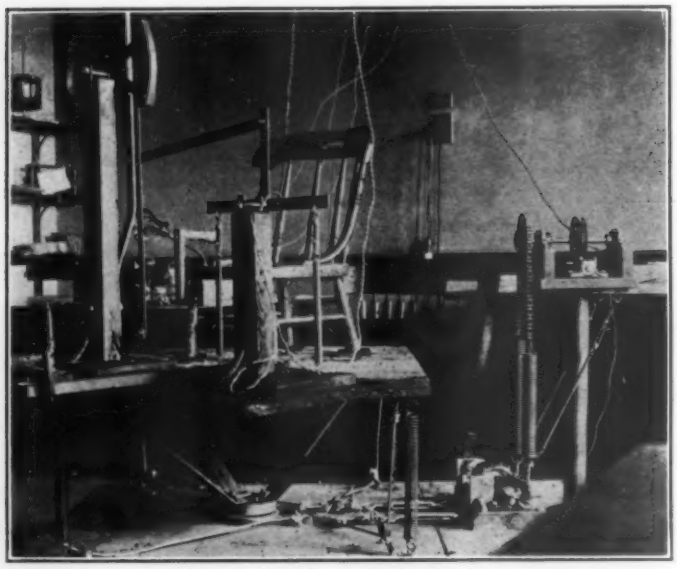

Apparatus Used in the Tests

The same apparatus was used as in the earlier work. The subject on whom the experiments were performed sat on a chair upon a square platform which rocked on a rounded plate a foot below its center and was held in a horizontal position by heavy spiral springs attached from its four corners to the floor. Wire ropes from the corners passed through pulleys directly below and were attached to short chains, each of which passed over a sprocket on the same shaft with a ratchet. Heavy spiral springs on the other ends of these chains could be placed under tension by a crank and worm gear on their upper end, while the lower end was held by the ratchet. When this ratchet was released, the tension of the spring took up the given wire rope and quickly lowered the desired corner of the platform. Thus the person sitting on the platform could be tilted suddenly in any of the four directions, left, right, front or back.

A dep and a stick control were mounted on this platform in front of the chair on which the subject sat. The dimensions of these and their location with reference to the position of the person operating them followed the standard army specifications. A foot bar was also placed at the regulation distance. The controls were both arranged so that a very slight movement of either broke an electric contact. This contact and another made by the ratchet and its pawl actuated a device which measured time to fiftieths of a second.

The individual sitting on the platform in the same bodily position he would be in an airplane could thus be suddenly tilted in one of four directions. He then reacted as quickly as possible with the given control, just as he would when an airplane was tilted by a puff of wind. If he tipped to the right, he warped the wheel clockwise or moved the stick to the right, and vice versa. If he tipped forward he pulled the wheel or stick toward him, and vice versa. Trials with dep and with stick were intermixed in irregular orders to avoid any practice effect influencing the results. The actual time that elapsed between the instant the platform started to tip and the beginning of the movement of the control by the subject was accurately measured for a large number of reactions under the various conditions. Five individuals participated in the experiments some fifteen hours apiece.

Prior to the actual experiments in which the subjects were instructed in which manner to react, each was given a chance to react to the sudden tip in the manner that "seemed most natural to him." In these first reactions, four of the five subjects moved the control toward the high side of the platform. It is interesting to note the instinctive tendency to react toward the high side, the form of reaction that has been adopted in standard airplane controls.

The results of the investigation of this problem are negative. Nothing in the nature of the dep as contrasted with the stick control facilitates or retards the speed of reaction. It seems to be rather a question of the amount of muscular force necessary to move the lever. Thus averaging the results for the five subjects on lateral movement (roll), when a force of approximately 7 lb. on either control is necessary to break the contact, the average reaction times with the dep and with the stick are very nearly the same. There are minor variations in both directions, but the average difference (including plus and minus values) is less than 1 per cent. When, however, the dep requires a force of 4 lb. and the stick a force of 10 lb., the average reaction times with the dep are 16 per cent quicker. And when the dep requires 12 lb. and the stick 4 lb., the reactions with the latter are 9 per cent quicker. That is, the control possessing the greater inertia yields a slower reaction time, but when the forces required to move the dep and the stick are approximately equal, there is little difference in the speed of reaction. A similar result is found with longitudinal motion. When both controls require about 5 lb. force to break the contact, the difference in reaction times is slight, averaging only about 2 per cent.

The result is thus evident that from the standpoint of efficient action with dep as contrasted with stick controls psychological factors do not play a part. Reactions to a sudden change of equilibrium are equally rapid with both types of control when there is no difference in the force required to overcome the inertia of the mechanism. Where such differences in force are required, the reaction time with the control possessing the greater inertia is the slower.

* Aviation and Aeronautical Engineering. April 1, 1917, p. 218. A technical account of the entire research will be published later in one of the current psychological periodicals.

Aeronautical Patents

Copies of these patents may be obtained for five cents each, by addressing the "Commissioner of Patents, Washington, D. C."

ISSUED JUNE 12, 1917.

1,229,503. Filed August 28, 1916. To Knute W. Olson, St. Paul, Min. Safety Device for Aviators.

1,229,297. Filed July 21, 1916. To Geo. Lehberger, Newark, N. J. Undercarriage or Chassis for Flying Machines.

1,230,045. Filed Feb. 25, 1913. To Vladimir Skrivanek, Ft. Wayne, Ind. Flying Machine.

1,229,410. Filed Jan. 4, 1916. To John R. Campbell, Austin, Tex. Airplane.

1,229,713. Filed Apr. 24, 1916. To Geo. A. Chaddock, Broad Green, Liverpool, Eng. Mechanical Air-Borne Ship.

1,229,649. Filed Feb. 20, 1917. To Lafayette Pace, LaFollete, Tenn. Safety Appliance for Airplanes.

JUNE 26, 1917.

1,231,387. Filed Apr. 4, 1916. To Joseph H. F. Laflamme and Omer Gravel, Toronto, Ont., Canada. Bomb Dropper.

1,231,881. Filed Mar. 9, 1917. To Isaac Francis Taylor, E. Dulwich, London, Eng., assignor of one-half to Samuel Peck, London, Eng. Aerial Apparatus for Defense against Hostile Aircraft and for Other Purposes.

1,231,444. To Ruter William Spruger, Springfield, Ill. Wing or Propeller for Aerial Dynamics and other purposes.

Airplane Dopes

By Gustavus J. Esselen, Jr.

The development of the airplane has been so rapid that it is natural for one to assume that the present methods of wing manufacture were coeval with the airplane itself. Yet it is only about six years ago that the more prominent German manufacturers first experimented, in a practical way, with the methods at present in use. At that time they were using for their wing covering cotton or silk, oiled or varnished, or some of the various rubberized fabrics which had been adapted from balloon manufacture. None of these were satisfactory. Some presented difficulties in getting them sufficiently taut; some of the fabrics had been weakened in the coating process, and all were more or less affected by the oil and gasoline from the motors. It was not long, therefore, before the general superiority of the methods of to-day was demonstrated.

Fabrics

Before considering in detail these modern methods and the dopes used in them, it may be well to look briefly into the matter of wing fabrics, because the behavior of any given dope depends, to a considerable degree, on the fabric, and on the treatment which that fabric has undergone previous to the application of the dope. At present the fabric most in demand is linen, because of its strength and the toughness and difficulty with which it tears. Owing, however, to the present scarcity of linen, specially woven cotton fabrics are coming on the market. The chief drawbacks to these cotton fabrics at present are the comparative ease with which they tear, especially when once started; and the fact that they do not take the dope so well as linen. It is not unreasonable to hope, however, that dopes will be compounded to work as well on cotton as the present ones do on linen. The weight of the linen in use varies from 3½ to 4¾ ounces per sq. yd., and the tensile strength ranges from 60 to 100 pounds per inch, depending somewhat upon the weight. As for the cotton fabrics, they weigh from about 1½ to 4 ounces per sq. yd., and the tensile strength varies anywhere from 25 to 80 lb. per inch. As a general rule, those fabrics are chosen which have about the same strength in the direction of the warp as in that of the filler.

The general procedure in making up a wing is so well known as to require little comment. A linen or cotton fabric is applied to the wing frame, and then several coats of a suitable dope are applied. The chief function of the dope is to tighten up the fabric and give a smooth, taut surface, resistant to the weather, and preferably also to oil and gasoline. It also adds materially to the tensile strength, the increase ranging from 10 per cent to 50 or 60 per cent, depending upon the fabric used, and how much the fabric has been stretched before doping. Further reference will be made to this last point later.

Relative Inflammability of Dopes

The dopes which are at present in use may be divided into two classes; first, those made from a base of cellulose nitrate or pyroxylin; and second, those made with a cellulose acetate base. In either case, the base is dissolved in a suitable solvent, and often some substances are added to preserve the flexibility of the coating or to modify the shrinkage. These added substances are, in other words, somewhat analogous to the camphor in celluloid. The great outstanding difference between cellulose acetate and cellulose intrate dopes is the inflammability of the latter, a difference which will probably be emphasized more and more as the use of airplanes for peaceful purposes increases. On the other hand, the initial cost of cellulose acetate dopes is somewhat greater than that of pyroxylin dopes. Some manufacturers have found a happy medium in applying three coats of pyroxylin and finishing with two or three coats of acetate. This gives a fire-resisting surface, even though the coating is not non-inflammable all the way through. To give an idea of the relative behavior of the coatings left by the two types of dope, the concrete example of the application of a lighted match to a finished wing may be cited. In the case where an acetate dope has been used, the fabric is not ignited until the coating has melted or charred away. However, with pyroxylin, the coating itself starts to burn at once, and in turn sets fire to the cloth. Still more striking is the fact that two drops of gasoline can be put on a small piece of fabric coated with a cellulose acetate dope, and allowed to burn, without causing any injury to the fabric. The same test applied to a pyroxylin-coated cloth, however, results in the immediate ignition of the coating, which sets fire to the cloth as before. From the point of view of resistance to fire, therefore, cellulose acetate dopes are much safer.

When we come to consider the actual doping of wings, we find almost as many methods as there are different concerns in the business. Some engineers prefer to stretch the fabric as tight as possible on the frame, and apply a dope of only slight shrinkage power; others stretch the fabric less taut, and rely more on the shrink of the dope; while still others adopt an intermediate course. This is probably because up to the present very little scientific attention has been paid to the doping. Most of it has gone along by rule of thumb.

Properties of a Good Wing Surface

There is, however, practical unanimity as to what constitutes a good wing surface after it is dry. In the first place, it must, of course, be smooth. A very appropriate measure of the smoothness is given by the wind resistance. Measurements of this value have been made by Zahm,[1] by Gibbons,[2] and several others. It has been found that taking plate glass as the standard, doped or varnished wing surfaces have a wind resistance of not over 1.2. Such materials as wire gauze or singed cotton have wind resistances between 1.35 and 1.70. Unsinged cotton may go even higher. As to the effect of variation of speed, for very smooth surfaces, such as plate glass and doped wings, the surface friction varies as the 1.8-1.85 power of the velocity. As a general rule, the rougher the surface, the higher the exponent, which reaches 2 for surfaces with nap. (Gibbons[2] has pointed out that there are exceptions.) An interesting calculation has been made by Gibbons,[2] in which he shows that the difference in resistance between an uncoated fabric, such as unsinged cotton and plate glass, amounts to 0.013 lb. per sq. ft. at 70 m.p.h. He figures that in a large machine this would amount to a total head resistance of about 18 lb., or 150-180 lb. decrease in lifting power.

The next quality a good surface should possess is that it should adhere well to the fabric. The reason for this is obvious. In case of an accident causing a break in the cloth, it ought not to be possible to start the coating and peel it off. The surface should furthermore be taut, and should be waterproof and unaffected by gasoline or oil. The value of water-resistance speaks for itself. A moment's consideration of the amount of gasoline and oil which gets on the wings of an airplane in service is sufficient to convince one of the necessity of resistance to gasoline and oil. If further argument were needed, it would only be necessary to recall that some of the earlier fabric coatings had to be rejected because they lacked this property.

It has just been remarked that the wing surface should be taut, or, in other words, should not sag. On the other hand, it is desirable that the wing should yield, to a certain extent, under a load. In this way the stress will be reduced and the surface may stand, whereas an unyielding surface might break. Gibbons and Smith[3] have shown that a convenient way to get an idea of the relative value of this property of "give," or, as they term it, the "efficiency," is to measure the area under the stress—elongation curve for a given sized piece of fabric. This, of course, represents the work necessary to break the fabric. They took pieces twelve inches long and one inch wide, and measured the stretch as the load increased. In general, it was found that the stretch up to a load of about 20 lb. was greater with uncoated, than with coated, fabrics. That is, with uncoated fabrics there seemed to be a certain slack which was taken up at first under light loads, and, as soon as that was taken up, the stretching proceeded more slowly. Furthermore, it was found that linen coated under no tension gave a much greater elongation than linen coated under tension. In some cases it required two and one-half times as much work

[1] *Phil. Mag.*, VIII, 58 (1904).
[2] *Report of Nat. Advisory Com. for Aeronautics for 1916*, pp. 178, ff.
[3] *Report of Nat. Advisory Com. on Aeronautics for 1916*, pp. 143, 154, ff.

to break linen coated under no tension as to break the same linen uncoated. On the other hand, the work required to break a piece of linen coated under tension was about the same as that needed to break the uncoated linen, and that in spite of the fact that the coated linen seemed to have a higher tensile strength. In other words, uncoated linen and linen coated under tension have about the same "efficiency," but linen coated under no tension has an "efficiency" about two and one-half times as great. As has already been mentioned, it is the usual practice to stretch the fabric somewhat on the frame before doping, the degree of stretching varying with the individual plant. In view of these results, however, it is recommended to stretch the fabric as little as possible. Then, in case of an accidental blow to the wing, the increased elongation will tend to reduce the stress, and if the stress is not too great, save the wing from injury.

Methods of Obtaining a Good Wing Surface

With this discussion of the desirable properties of wing surfaces in mind, the next question is as to the methods employed in the dope room to obtain these qualities. In the first place, smoothness. The smoother the fabric to start with, of course, the easier to get a smooth surface. The ordinary nap, however, is easily taken care of by the dope. Given a suitable fabric, precautions should obviously be taken to keep dirt away from the dope before it is used, and from the wings before they are dry. As a rule, from four to six coats of dope are applied, and in some plants, in order to obtain proper smoothness, each coat is sand-papered before the next one is applied. It has been found good practice to work the first coat well into the fabric in order to ensure the maximum adhesion. Subsequent coats it is well to brush out more, although the last coat may be applied heavier if desirable, from the point of view of build-up.

When one comes to discuss the matter of adhering to the fabric, dopes are often blamed where the fault lies in the sizing of the cloth. As a general thing, dopes do not penetrate well on sized fabrics. There are exceptions to this rule, and the explanation may be that in those cases where dopes do penetrate well on sized fabrics, the particular sizing involved is soluble in the solvent of the dope. Another factor which probably enters in, is the character of the solution which constitutes the dope. The indications are that the more nearly the dope approaches to being a true solution, the greater the penetration, whereas the more colloidal it is, the less it will penetrate. For any given dope, it has been demonstrated that it will penetrate better, adhere better, resist atmospheric conditions better, and wear better in every way, when applied on an unsized fabric, than it will on the same fabric sized. A reasonable way of accounting for this is to assume that where there is no sizing, the dope penetrates the fibres of the fabric rather than merely between the fibres, and thus when dry it is almost a part of the fibre. Since most sizing can readily be removed by boiling, either in plain water or a weakly alkaline solution, it is a simple matter to insure good adhesion.

As to tautness, very little need be said. All dopes of today render the surface taut, and it is possible to obtain dopes which give much or little shrinkage at the fancy of the engineer in charge. All dopes are also waterproof, but the extent to which they resist the continued action of water, such, for example, as exposure to the weather in a rainy period, varies with the dope. The writer has seen test panels exposed to three months of spring weather from which the dope had almost all disintegrated. This, of course, was a very extreme case. On the other hand, one of the leading manufacturers exhibited one of their machines at the Aero Show in New York last February, just after it had seen six weeks' service on the North Atlantic seaboard during the height of winter. In addition to being subject to the ordinary rigorous conditions of this time of the year, this machine had returned from its last trip covered with ice, and yet the wings were still in good condition. This particular machine had been doped with a cellulose acetate dope, and then given one or two coats of spar varnish. It is the general practice with some companies to finish with spar varnish, this being used to make the surface more waterproof. The use of spar varnish has one disadvantage, however, and that is in the matter of patching. As a rule, a hole in a wing can be patched with a piece of fabric by using dope as a glue. On spar varnish, however, most dopes do not stick, so that in order to make a repair the varnish has to be removed first.

There is one bane of the dope room which has not yet been mentioned, and that is the formation of white spots. These occur more frequently with pyroxylin dopes than with acetate dopes. They are due to moisture condensation during the drying, and show up, as a rule, only on humid or rainy days. They can be removed by going over them with a little solvent, or, better, by applying a cellulose acetate dope designed for the purpose, which leaves a fire-resisting surface, as well as removing the white spots. Of course, the white spots can be prevented, even on damp days, by regulating the amount of moisture in the air of the dope room; but this, as a rule, requires a rather elaborate ventilating system.

Covering Power

One question that is of interest to the manufacturer is, "What is the covering power of this or that dope?" It is almost impossible to answer this question categorically, because of the personal equation that enters in, and because of the difference in behavior of different fabrics. A given dope contains so much solid (or non-volatile) matter per gallon, and will, therefore, cover much or little surface, according as it is applied, thick or thin. However, different dopes with the same weight of solids per gallon may vary in their covering power when this is measured by the amount necessary to give a proper surface on any particular fabric. In view of these complicating factors, the best that can be said is that, in general, dopes cover from about two and one-half to five square yards per gallon, when applied so as to give a suitable surface themselves, without any finishing coat, such as spar varnish. This may be accomplished with from four to six coats, according to the individual practice, but, in any case, the weight of the resulting coating for a given dope and degree of finish will be approximately the same. This weight ranges from one and one-half to about three and one-half ounces to the square yard.

Durability

Another question which is of immediate interest is that of the length of time that a good wing surface will last; and this, too, is very difficult to answer with any exactness. The chief determining factor in this case is the dope itself, although there are conditions which have already been considered which affect the wearing qualities of wing surfaces somewhat. Some results are given in the *Report of the National Advisory Committee for Aeronautics for 1916* which indicate that, in general, cellulose acetate dopes are far superior to cellulose nitrate dopes for use on cotton; that is, the decrease in tensile strength of the doped fabric on exposure to the weather is much less with acetate than with nitrate dopes. The same seems to be, in general, true for linen, but not in so marked a degree.

In testing dopes, it is customary to make up test panels and expose them to the continuous action of the weather. This, of course, is much more severe treatment than airplanes ordinarily receive. The first desirable property to disappear is usually the flexibility, and the length of time before this happens can, therefore, be taken as a measure of the relative value of different dopes. Because of the wide variations in atmospheric conditions with the season of the year and the locality, it is not possible to give any definite length of time as a standard during which a dope should not show marked signs of deterioration. The best that can be said is that in general practice it is found necessary to redope wings every three or five months.

While not coming strictly under the head of "dopes," it may be of interest to refer briefly to the transparent, non-inflammable wings which have been reported in the press as being used in certain instances abroad. The material in question is made from cellulose acetate. In a thickness of .010 of an inch, this material weighs nine ounces per square yard, and has a tensile strength of about 72 lb. per inch. It is claimed that an airplane with wings of this material is almost invisible at a height of a few thousand feet. In any case, it is obvious that the field of vision of the pilot would be much increased. One difficulty with these sheets is that, when once started, they tear very readily. A patent has been taken out for remedying this difficulty by reinforcing the transparent sheet by means of a fabric, such as silk, woven rather loosely. While it may not have any great tensile strength of its own, it serves to arrest any tearing which may get started. It has the disadvantage, however, over the clear material, that the fibres must interfere with the more extended view of the operator.

Kapok—And Some of Its Uses

By Charles Garrison

Kapok is the name given the fibre which envelops the seeds in the pods of the tropical trees of the *Bombax* family. The pods are about the size and shape of our common milkweed and the down has a similar silky lustre.

Kapok has many interesting characteristics not found in other fibres. Of these its great buoyancy and resilience are of special value. The fibres are short and smooth, have thin walls and contain a large amount of air, probably the largest amount found in any fibre. They are also oily, giving them a water-resisting quality.

The Bombax family is widely distributed in tropical countries but the species which has the buoyant and resilient qualities in the highest degree is the *Ceiba Pentandra.* The word *Ceiba* means "canoe" since the natives use the trunks of these trees in the same manner as Robinson Crusoe did. *Pentandra* refers to the five fold plan of the flower.

Trees of this species are found wild in many places, but the best qualities are those cultivated on the island of Java. Many fine plantations are to be found there where the process of selection has made the product very uniform and valuable. The United States is trying to encourage the culture of kapok in the Philippines but so little care has been given to selective cultivation, that the quality is much inferior to that grown in Java.

As the uses for kapok increase other grades find their way to market from India, Cochin-China, Peru, Ecuador, Mexico, etc. These uses are limited at present to but a few industries. Mattresses hold the first place in volume, since they are cheaper and lighter when filled with kapok than with hair or cotton. Undoubtedly the most important use is for life-saving purposes. Coats, vests, and other garments are lined with this material in such a manner that the wearer cannot sink. Such clothing is neither cumbersome nor bulky and its buoyant qualities are permanent.

Air filled life preservers are unreliable and cork is clumsy, heavy, and in time becomes dangerous as it disintegrates and loses all its virtue. At present for life saving purposes, air filled preservers are not approved and cork preservers are fast giving place to kapok.

The making of kapok fabrics has been attempted in many places, but it has attained a commercial importance only in Germany, as far as the writer knows. In France this has also been accomplished, but in a more experimental way. The fibres are very straight, and slippery and they vary greatly in length, just the qualities that make them difficult to spin. Fig. 1 shows a magnified kapok fibre, while Fig. 2 shows one of cotton. You will at once note the absence of "hooks" or twists in the kapok which are necessary for one fibre to cling to another.

FIG. 1

Kapok is really not so simple as it looks and its buoyancy depends on many things. Among these are its natural quality, its treatment before use, and the manner of its application. The writer has conducted a large number of tests during the past three years in the laboratory of the Kapo Mfg. Co., and has discovered many facts ihtherto unknown. Fig. 3 represents a test recently made under the supervision of the U. S. Steamboat Inspection Service. The horizontal axis represents time given both in hours and days, the vertical axis represents the buoyancy in pounds of dead weight supported.

It is noteworthy that there is a sharp decline of the curve during the first few hours and a more gradual decline later. These are from different causes. After 24 hours immersion this life preserver sustained over 20 lb. of weight per pound of kapok. This is a good record; under exceptional conditions, 25 lb. may be attained.

Another life preserver containing the same amount of fibre, but made by those who do not understand its application thoroughly, sustained but 12 lb. of dead weight per pound of kapok, the conditions of the tests being the same in each case. Kapok fibre per se has only about one-half the buoyant value usually attributed to it, the balance being due to special contributing conditions.

FIG. 2

In time the fibre attains total saturation, but after drying there is a partial recovery, the permanent loss being largely due to the removal of the natural oil. In one test with half a pound of the fibre total saturation occurred after an immersion of 93 days.

In a series of tests with a garment immersed for an hour each working day, covering a period of four months, or 108 immersions, the maximum loss of buoyancy was less than 7 per cent.

In aviation three uses are found for kapok. The more common is the garments made for the use of aviators. Besides the buoyant quality, they have warmth, the kapok being an excellent insulator.

The other use is on the machine itself. Rodman Wanamaker's "America" was provided with kapok mattresses for the furnishing of the cock-pit.

At present kapok floats are also being designed for the "blimps," illustrated in AVIATION AND AERONAUTICAL ENGINEERING for March 1. These are two cigar shaped receptacles each containing about fifteen pounds of specially prepared kapok, being some seven feet long and eighteen inches in diameter. These are covered with heavy waterproof canvas and are secured to the skids in four places, so that they are held with sufficient rigidity to withstand the air pressure. The coverings and straps for each of the floats would weigh about ten pounds, making the total weight of the pair fifty pounds. They would sustain the required weight of six hundred pounds for many hours.

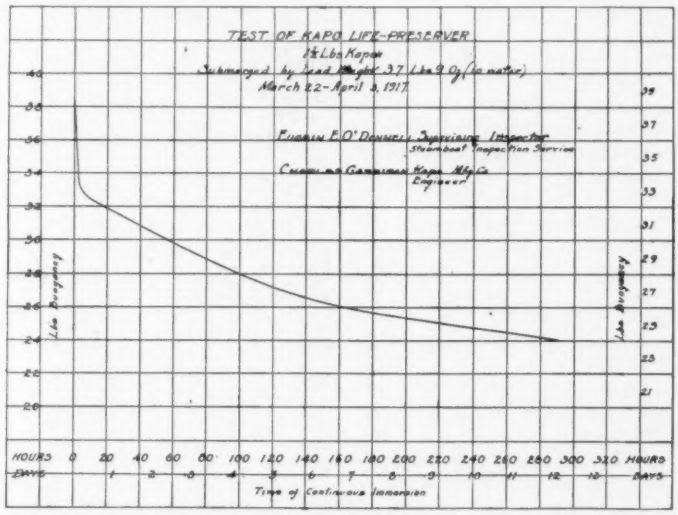

FIG. 3

Testing Altitude Instruments

During May 100 instruments for measuring altitude, or speed of ascent, were submitted for test to the Bureau of Standards, Department of Commerce. These included ordinary aneroids, altigraphs, and ratanoscopes, and were mainly from the Army and Navy. The number of altitude instruments actually tested during the month was 121. The average rate of arrival of altitude instruments during the calendar year 1916 was 12 per month. The Bureau endeavors to give immediate and unofficial reports on the tests of these instruments.

Extracts from Inspectors' Manual Aviation Section, Signal Corps, U.S.A.

General Remarks on Inspection

Inspectors will bear in mind the fact that the Government specifies material of a definite quality and it is the duty of the inspector to make certain that material fully meets requirements.

Army inspectors will examine only such material as has been in some way clearly indicated as inspected by the manufacturers' inspectors.

No parts rejected by inspectors will be used in any assembly intended for Government use except by written authority from the Office of the Chief Signal Officer.

An inspector will exercise a general supervision over raw material received at the factory and likely to be used for the Government.

Following the production and acceptance of a machine of any type, complete working drawings will be furnished by the manufacturer to the inspector. All other machines of this type will be made in accordance therewith and no departures therefrom permitted without written authority from the Office of the Chief Signal Officer.

It is understood that the manufacturer may try out in the sample machine experimental features, but that in all other machines built under the same contract there will be no experimental design, material, or workmanship.

Material proved defective may be rejected at any time in the course of manufacture or assembly, even though having already been passed by an inspector.

It is understood that the manufacturer reserves the right to reject any material or parts already accepted by the Government inspector if such rejection is approved by the Government inspector.

The Engineering Division of the Signal Corps has assigned Signal Corps numbers to all airplanes, engines, and propellers on order for the Aviation Section of the Army.

Name Plates

It is desired that when these plates are applied they should be close to the surface and be bedded in shellac to keep anything from getting back of same and also to keep them from being pulled off. Fasten with escutcheon pins about ⅛ diameter and ¼ inch or ⅜ inch long.

If applied to metal parts, bed in shellac or air drying Japan for the reason as stated above. Drill hole for escutcheon pins the same size as pins and flatten pin slightly to be sure they will hold.

Marking of Number Plates

A set of steel dies, consisting of letters and figures, has been furnished inspectors for use in marking all material accepted for the Signal Corps. Whenever it is required to use such letters or dies, this office directs that the wording and notation to be put on the number plates which have been furnished for material ordered be placed there only by the United States Army inspectors and under the direction of the senior inspector at each factory. This applies to number plates already furnished by this office for engines as well as any other number plates that may be furnished in future.

(C) *Harris & Ewing*

MAJOR HENRY SOUTHER, CHIEF, AIRCRAFT ENGINEERING DIVISION

Engine Tests

The question has arisen as to how thorough a retest of an engine should be in case of failure during the investigation test or the six-hour test.

It is not desired to submit the manufacturer to unnecessary expense in this connection, but it is desired to ascertain beyond doubt whether or not the engine is really a serviceable engine for airplane usage.

As a general rule it is safe to state that the failure of any vital part should be followed by complete retest of engine. This is subject to modifications in accordance with the following illustrations:

Assume the failure of a valve spring. It is due to one of three things—design, material, or workmanship. It should be the duty of the inspector to discover by a practical method in which class this failure may be. If due to design it can be only determined by repeated tests. If any continuous test is interrupted by valve springs it is a suspicious circumstance, and the following procedure will probably discover whether it is due to design or material. Take other valve springs at random. Break them in any convenient manner. If the grain of the steel at the fracture is coarsely crystaline in all of them, then it is fair to presume that all the valve springs of the entire lot are defective and that the steel has been improperly heat treated or tempered. If, on the other hand, the grain of the steel shows a fine grain fracture, characteristic of good valve spring steel, then it is probable that repeated failure is due to improper design. If the inspector finds that the springs are either faulty in design or material there is no use in calling for repeated tests until a new lot of springs is obtained.
procedure shows a good grain spring steel, and in the opinion of the inspector the design is good, the failure was probably due to accidental causes and the springs may be replaced and the test continued without complete retest.

In cases of this kind, where the inspector is in doubt, samples of the broken part should be submitted to this office, where analysis or further examination may be made to determine the real cause of the trouble.

In cases of failure of magneto, it may be due to the magneto itself, or to the magneto drive, which may transmit to the magneto stresses and shocks that should not be possible in connection with good engineering design.

Where the inspector feels that the design is at fault, he should so report, and with his report submit detailed blue prints or sketches of conditions existing, if possible, and suggestions for improvements.

In case of failure of bearings, trouble may be due to lubricating system being designed wrong, or to accidental failure of it. The inspector should be able to discriminate and to know whether retest is necessary.

An engine with an improper lubricating system will fail repeatedly, and retest will be called for if the inspector suspects this cause of failure. If the failure is proven to be accidental, then only such a portion of retest should be demanded as inspector considers necessary.

It is not desirable to enumerate all details that may fail, but if failures are handled in the above-suggested manner, a reasonable conclusion should be possible and one that will at all times be fair to the manufacturer and at the same time protect the Government against all defective engines.

So far as possible in connection with engine tests, observations shall be taken in accordance with standards adopted by the Society of Automotive Engineers.

The following suggestions should be adhered to as closely as possible in reference to Specification 1002, Section No. 11, investigation test. These suggestions do not refer to final acceptance test, which will be covered later. The inspector or inspectors viewing the investigation test should bear in mind the fact that the engine to be tested is a finished product, and no vital parts will be allowed to be changed during the continuance of the run. The following adjustments will be considered permissible:

Gaskets may be replaced only once, one complete set of spark plugs may be substituted, two valve springs may be replaced, water, oil or gas leaks may be remedied, pumps may be adjusted, carbureters may be adjusted, magnetos may be adjusted, valve timing may be adjusted.

Other replacements will not be permissible during this or the final acceptance test. Time required to make any of the above adjustments should be added to the total time of run.

Inspectors will submit detailed reports on such tests to this office, and it is suggested that they make frequent notations as to the test proceedings.

The following should receive close attention by inspectors during the final acceptance test of six hours. (Re. Specification 1002, Sec. 11.) This test is to be given every engine built for the Government before being accepted by the Army inspectors. The entire test should be run at the maximum horsepower at rated revolutions per minute of the engine, and only such adjustments as are given under investigation tests will be permitted without an entirely new run of the engine.

When the engine is disassembled after this run the inspector should view every part liable to breakage or wear, and in case of excessive wear should insist on replacement of the part. When such replacement involves a vital part, such as a piston, bearing, or cylinder, the engine should be returned to the stand and entire retest made over. After this retest the engine should be disassembled and inspected as before.

The final-hour test is to be made on every engine sold to the Government and on a suitable dynamometer. The engine should never develop less than 4 per cent of its maximum horsepower at any time during the run. Inspectors should take their own readings and assure themselves that the engine is up to specifications in every detail. It is recommended that in addition the engine be run at 300 to 400 revolutions per minute for at least 10 minutes and then the throttle to be opened quickly to ascertain if carburetor is adjusted properly and that all cylinders are firing at low engine speeds.

Inspection of Cylinders

1. Cylinder jackets should be tested for leaks while submerged in water with air pressure. Pressure to be at least twice that of normal water pressure.
2. Cylinder bore should be checked carefully at four points both top and bottom, for being out of round, for being over or above tolerance in size, and for finish of bore.
3. Cylinder studs must be of proper height and square with surface.
4. Valve seats should be inspected for uniform width and location.
5. Valves after being ground to a gasoline tight seat should be inspected for leaks in three positions approximately 120 deg. apart without removing the gasoline from the cage.
6. Valve springs should be of specified strength and when compressed should not be compressed more than drawing limits.
7. All valve mechanism should be inspected for workmanship.
8. Intake manifolds are inspected internally and externally for workmanship; surfaces of manifold joints and valve cage joints must be true and of good surface. These surfaces should be checked on surface plate.

Inspection of Crank Case Upper Half

1. Check distances from center line of crank shaft to deck, both front and back, and between crank shaft and cam shaft.
2. Check distances from each end of cam shaft to top of deck, and on V type engines to both decks.
3. Check cylinder centers, also bore of cylinder holes.
4. Check cam follower guide holes for centers against cam shaft cam centers.
5. Check thrust bearing bore for size.
6. Check all studs for cotter hole placement, alinement, threads, and all tapped holes for threads with plug gauge.
7. Check cam-shaft bearing to main bearing for size, alinement, and condition of bore.
8. Check magneto-boring bore for distance from cam shaft and size.
9. Examine case for sand holes, gas holes, and defects such as shifting of cores.
10. Measure the thickness of all walls and decks.

Inspection of Crank Case Lower Half

1. Inspect lower case for center distances of oil and water pumps.
2. Inspect for oil leaks when filled with kerosene.
3. Joints of upper and lower case should be good fit.
4. Check location of gear cover holes and surfaces.

Inspection of Crank Shafts

1. Stamp manufacturer's number and S. C. number on shaft.
2. Measure each bearing at four points 90 deg. apart.
3. Measure thrust bearing.
4. Measure gear bearings and seats.
5. Try taper and spline.
6. Propeller hub thread.
7. Thrust-bearing thread.
8. Try bored hole for starter.
9. Try width of throws.
10. Try width of bearings.
11. Measure length dimensions.
12. Try oil holes for location and size.
13. Examine for checks and flaws.
14. Try bearings for run out.
15. Scleroscope test for quality of steel, usually about 40-52.
16. Inspect and measure taper with great care.
17. Inspect and measure spline or keys with great care.
18. Inspect and check threads with plug gauge.
19. Examine running and standing balance.
20. Inspect holes and threads for oil system in shaft.
21. Make oil-pressure test for leaks in oil system.

Inspection of Cam Shaft

1. Cam shafts should be tested for hardness by both Brinell and Scleroscope tests.
2. Shafts should be set up in centers and each cam tested for opening and closing points, neutral period, amount of opening, size and condition of bearing surfaces, and distance between cams.
3. Ground surfaces should be inspected for finish.
4. Keyways should be inspected for placement.

Inspection of Spur Gears

1. Engine spur gears should be inspected while running on their own centers with two-thousandths back lash. This includes only spur gears.
2. Engine bevels should have six-thousandths back lash and are inspected on their own centers.

Inspection of Engine

The following questions should receive the inspector's approval before he passes the engine for Government use:

Is engine fastened down properly when assembled in machine?
Are all connections made in the most approved manner?
Is carburetor adjusted properly?
Is oil pump working O. K. and is oil pressure good?
Are valves timed right and do valve stems have proper clearance?
Do valve stems have safety pin to prevent valve dropping in cylinder in case valve spring washer pin breaks?
Does engine have good compression?
Is cam shaft in proper alinement so that valves on all cylinders open at their proper relative time? (This should be checked carefully before cylinders are put on case and should be kept within close limits.)
Is there any suspicious noise to be heard at any engine speed?
Are any of the valve springs weak?
Do rocker arms hit valve stems squarely?
Are push rods bent, or do they bind in any way?
Is propeller tight on crank shaft or jack shaft?
Are there any leaks in gas manifold, water manifolds, exhaust manifolds, oil pipes, or air line?
Does engine function properly at low speeds as well as high and with quickly opened throttle?
Has engine any bad "rough" point?

Inspection of Cable Wire, Turnbuckles, and Fittings

Cable.

Are there any kinks in the cable?
Are loops properly made?
Are thimbles used in eyes?
Are ends wrapped properly (wrap must be at least 15 times diameter)?
No splicing of cable is permitted.
Has acid struck cable during soldering?
Are any of the strands broken?
Are wrapped ends stream-lined and show the result of skilled workmanship?

Roebling Hard Wire.

Are there any file cuts or flaws to weaken it?
Is loop well made?
Is ferrule put on correctly?
Are there any sharp bends or kinks?
Are wires too loose or tight in machine?

Fittings.

Is workmanship good?
Is material good?
Are holes drilled correctly to develop proper strength?
Are there any deep file cuts or flaws to weaken it?
Is rivet or pin fastening wire put in properly?
Are thimbles of large enough diameter?

Turnbuckles.

Any file cuts, tool marks, or flaws in shanks or barrel?
Are there too many threads exposed?
Is turnbuckle of right strength and size to develop full strength of wire?
Are shanks bent?
Are threads on shank or in barrel well made?
Is barrel cracked?
Is turnbuckle properly wired (see sketch under "Approved Method of Wiring Turnbuckles")?

(To be continued.)

A Three Years' Flying Experience*

By Capt. B. C. Hucks, R.F.C.

The past three years, although normally a short space of time, yet measured by the advance of aviation, has been a veritable lifetime. Many thousands of people are now deeply engrossed in the subject. Most of you who have honored me with your presence here to-night have studied flying from the very highly technical and scientific side, in fact far too technical and scientific for me, and you certainly know a great deal more about the subject from that point of view than I do. I hope that this plain, non-technical account of things, hardly touching upon the war, connected with my flying which have been brought to my notice during these three years, may interest you a little and perhaps form the basis of a discussion.

I think I am right in saying that through the war aviation has advanced more than it would have done in eight or ten years of peace conditions. In fact, the rate of improvement in aircraft is so fast, the pace so alarmingly rapid, that it is almost impossible for manufacturers to keep pace, for it seems that by the time the latest and most efficient type of machine is manufactured in sufficiently large numbers to gratify half the requirements of the services, that type is out of date and obsolete.

Progress Owing to the War

That you may realize at a glance the remarkable strides that have been made over this period I will show you some diagrams which, without giving any figures that may be military secrets, should convey a fair idea how the capabilities of aircraft have improved. I have taken the average performances of five different types of service machines used at the beginning of the war and compared them with the average performances of five different types of late patterns now in use in France.

The first diagram represented the growth in three years of the maximum speed capacity flying level. The second diagram consisted of two curves showing the increase in machines' capacity for climbing against time. The next diagram represented the growth of horse-power developed by aero engines. And lastly, the increase in the number of certified pilots during the past three years.

A pilot has only to take a short flight on a 1914 type machine and then fly the latest 1917 pattern as a comparison to really appreciate this colossal advance.

Some little time ago I had occasion to again fly, after a considerable lapse of time, a 50 h.p. Gnome Blériot, a one-time premier machine, in fact a type used quite a lot by ourselves and the French at the very beginning of the war. At first I believed the machine to be a very bad specimen of the species, but ultimately, after flying it for some time and acquiring a sort of lost art of balance, like a skater who has not skated on ice for years and has to get his legs again, I realized that it was quite a good specimen of the type, but that it takes quite a time to again get used to such inefficiency. The advance seems to have been along, one might say, quite conventional lines, that is, improvements on what might be accepted as standard designs, and no good results have been obtained from any departure from that standard. Perhaps the furthermost departure from what I call standard, and that is very slight, has been the triplane. The results obtained with the quadroplane have not justified the experiment.

The Inherently Stable Machine

During the past three years the first marked improvement, to my mind, which asserted itself was the inherently stable machine, attained apparently by such slight detail alterations as sections of planes and elevators that it required an experienced eye to detect a stable or unstable airplane by casual inspection when standing together. Then came the synchronized timing gun-gear, which enabled the machine guns to be fired through the propeller on tractor machines. This device is really so simple that one is at a loss to understand why it had remained so long undiscovered. It had the effect of giving the tractor type of machine a new lease of life; although a more efficient aerodynamically than the pusher, it had been falling into disfavor as a fighter on account of the inability of the pilot to shoot straight ahead of the machine.

Improvements in engines, to my mind, are responsible for present-day performances to a far greater extent than improvements in machines, chiefly through sheer increase of horse-power. And cases have occurred where certain obsolete types have been made serviceable simply by fitting an improved type of engine.

The improvements in the machines themselves seem to have been limited to details, such as wing sections, attention to head resistance, soundness of construction, etc.

The very efficient freak machine has yet to make its appearance.

I will not attempt to discuss the future of aviation, but setting aside the boundless commercial possibilities, I am more and more convinced that if we find it necessary to keep up an enormous navy, say a two-Power standard to protect our island, it will be essential to maintain at least the same standard in the air. That in itself guarantees a colossal future for aeronautics.

But to return to the subject of my paper to-night, I would like to place before you a few points as I have found them during a further three years of piloting.

Difference in Machines

I have flown many different types of airplanes, and considering the extraordinary variations in the types the difference in the actual piloting of any modern machine, to my mind, is remarkably small. I am of the opinion that a pilot who is thoroughly efficient with any particular type will in a very short time be master of any.

I find that on stepping out of a very fast small scout into a really big twin-engine machine the difference in the manner of piloting is very slight compared with the vast difference in the machines. Precisely the same methods are employed, the same trouble and risks are to be avoided; the chief characteristics seem to be that the smaller and faster machines are more difficult to land but are easier to handle in the air. In the case of "crashes," the larger and heavier the airplane the less damage is likely to occur to the occupants, as a tremendous amount of the impact is absorbed by the machine. Very much larger and heavier machines than those at present in use might be comfortably flown single-handed, no extra effort being required for the controls, provided the controlling surfaces are properly balanced.

To the lay mind it might appear that with such contrasts in the outward appearance of the smaller and larger machines, it would be necessary to train pilots specially and extensively for each type, but in my experience this is not so. I certainly think the best results are obtained when pilots are allowed to specialize. This, however, I understand has many drawbacks on active service.

Crashes are mainly due to three causes, viz., engine failure, faulty piloting, and faulty machines.

Engine Failure

Engine failure undoubtedly is responsible for most of the crashes, often because of the hopeless unsuitability of the landing ground at the pilot's disposal. To many pilots engine failure is most disconcerting, and it is then they are called upon to use rather more judgment and skill, so that even with a fairly suitable landing

Decorating Two French Aviators on the Somme Front

* Paper read before the Aeronautical Society of Great Britain.

ground available they very often crash. In my experience, embracing the testing of hundreds of new machines, it is seldom that a serious defect in the engine "lets one down," it is nearly always due to a small detail. I think I have had to make more forced landings through failure of the petrol supply than all the other troubles combined. This is due more often to failure of the pressure feed than to a choke in the supply pipes and very seldom to severed connections in the feed system.

Because of the absence of a float chamber to the carburetor in the rotary engine, even a variation of the gasoline pressure is more serious than in the rigid stationary type. In the former case the amount of gasoline that gets to the engine is controlled by the pressure and a fine adjustment. If the pressure increases unduly, the engine chokes from overrichness of mixture; on the other hand, if the pressure drops away the mixture is unduly weakened. This variation can be controlled by the fine adjustment to a large extent; but when that limit is exceeded the engine will fail. Most of the trouble seems to be caused by failure of the pump, which in some cases forms an integral part of and is driven by the engine; in others it is a separate unit, driven by a small airscrew. These failures are usually through valves sticking up and pistons becoming dry. Other causes of failure are in the relief valve not being pressure tight or sticking down. At any rate the present system of pressure feed, to my mind, is such a bugbear that it is high time something was substituted.

As far as the non-rotary engine is concerned, to my knowledge this matter is being tackled. I have been flying recently a machine fitted with a gasoline pump in place of the air pressure pump, the gasoline being pumped direct from the main tank to the carburetors and the surplus is returned to the tank through an adjustable spring-loaded relief valve, so that gasoline is delivered at any desired pressure to the engine. So far it has proved most satisfactory, with this advantage, that a punctured tank does not put it out of action. Dirt in the gasoline tank accounts for quite a large proportion of engine failures in new machines. This form of trouble ought to be avoided. It is an important matter which manufacturers should be made to recognize, and a very thorough system of tank washing employed before installation in the machines.

The dirt in the tank usually takes some time to work its way into and accumulate in the feed pipes or filters sufficiently to choke them. The machines are often by that time being delivered by air by pilots who are none too familiar with them, consequently engine failure means a good chance of crashing.

I remember having four forced landings while delivering a new B.E.2C. from Farnborough to Dover on this account. Another simple cause of engine failure which might easily be guarded against is that gasoline cocks in many cases have no definite locking device to insure that they remain in the open position during flight, consequently they are liable to vibrate into the "off" position, thus cutting off suddenly the gasoline supply. Many instances have come to my notice where gasoline cocks are fitted in such a manner that the tendency is, through the weight of the cock lever, to fall shut instead of the reverse. This is such a simple and yet such an important point that it really is surprising mistakes like this are continually allowed to be made. I have had engines cut out suddenly on three occasions during the past two months from this cause alone; one meant a forced landing because the gasoline cock was not accessible to the pilot, the other two were opened again in the air. It often leads to serious results, as the gasoline fails suddenly and it is seldom that the cause is discovered before the forced landing is made. Having a somewhat limited time at my disposal this evening I will not touch on what I have found to be other causes of engine failures, but I can assure you that as far as my experience shows they are a small proportion compared with those due to gasoline supply, and improvements in this direction will reduce engine failures enormously.

Faulty Piloting

Errors of judgment or faulty piloting account for nearly or perhaps as many crashes as engine failure.

The most common error made even by experienced pilots is losing flying speed on a turn which starts a side-slip, and given sufficient height terminates in a nose dive, or the more serious predicament, a spin. This mistake is often made under the stress of circumstances, when engine failure calls forth extra effort on the part of the pilot to reach a certain landing spot. The trouble is nearly always incurred by turning too flatly until the wing drops and the machine side-slips, generally in the effort to get into more suitable ground than that available straight ahead. This is always a dangerous maneuvre, and in nine cases out of ten when smashes have resulted probably less damage would have been caused had the pilot kept his machine from turning and pancaked straight ahead. I have found that most of the later type machines can be stalled (*i.e.*, speed reduced well below flying speed) without any risk of side-slipping, provided they are kept in a straight course and laterally level, as they will automatically drop the nose as soon as the speed becomes so low that the elevators have little or no effect. Most of the serious accidents start at a height insufficient for the machine to get out of its side-slip before striking the ground. Others strike the ground at the later stage, usually a nose dive, but in some cases a spin. If sufficient height remains after the machine assumes a nose dive there is no reason why it should not be pulled out and a normal glide resumed, but in the other event, although it is possible to get out of a spin, it is far more difficult a proposition than the instinctive maneuvre of pulling up out of a nose dive.

A spin is the extraordinary turning movement that some machines only too readily take up after being stalled on a turn or being turned too flatly even with plenty of flying speed. This is due to the machine suddenly meeting the air a great deal out of the parallel with its longitudinal axis either through side-slipping, skidding, or yawing in the air. Having had more than one involuntary spin, but having been fortunate enough to have sufficient height to get out again, I feel the matter is not to be treated too lightly. The position a machine assumes in a spin is a rapidly revolving side-slip or a fairly steep spiral dive, with this rather serious drawback that the more one tries to pull it up by means of the elevator the faster it spins. No matter how high one is, if one persists in trying to pull it out in a normal way, it will remain out of control because the elevator has now become the rudder, and instead of pulling it out, increases the speed of turning. If the controls are abandoned, the machine will come out of its own accord, but personally I have always found the best and quickest remedy for spins is to straighten the rudder and shove the joy-stick forward; a clean nose-dive will then reesult out of which the machine can be pulled.

I think in the matter of spins, prevention is better than cure, and it is up to the designers to see that their machine is of the non-spinning type, as however clever and quick the pilot may be in applying his pet remedy, he may not have height enough to do so, and the results are usually disastrous.

The errors of judgment which are made in landing account for crashes galore, but these, fortunately, are usually a small matter compared to those made in the air, seldom resulting in more than a smashed landing chassis. Flying experience is the only remedy for this particular fault.

Landing with the wind will sometimes end in a crash through the machine overrunning the limit of the landing ground; whilst landing side to wind will buckle wheels and wreck chassis. Neither of these troubles is always the direct fault of the pilot.

An easily distinguishable standard type wind-vane on every recognized landing ground would considerably lessen crashes from these causes.

Faulty Construction

Accidents directly due to faulty construction of the airplane are, fortunately, comparatively rare, as when they happen the results are so often fatal. They occur, however, even on standard types. In some cases the airplane is not entirely at fault, as in these days of heavy high speed efficient machines with so little head resistance and which attain colossal speeds on diving, it is such an easy matter for the pilot to increase the load beyond the highest factors of safety. One has only to consider the load on the wings of a machine dived at 160 m.p.h. when it is pulled out with a heavy hand.

Constructional failures of machines in the air can sometimes be traced to damage inflicted by imperfect landing, usually to the back part of the body in the region of the tail skid. This gets overlooked and subsequently the tail gives way under any extra stress whilst flying.

I should like here to be permitted to make a suggestion for the consideration of our chairman for what it is worth, *i.e.*, that a detailed record be kept of every engine failure, forced landing or accident of every kind and description that happens, at any rate, at all home stations. These records to be collected and classified so that valuable data may always be available. However, some such system as this may already be in operation.

I now come to a few points which might be brought forward from my experience with instruction of pilots.

Medical Tests for Prospective Pilots

I think that a great deal of time and expense might be saved if some form of medical test were applied to prospective pilots, such as I understand is done in France, where the effect of sudden shocks upon the system of the candidate is recorded by mechanical means, and other tests are made which are supposed to give a fair indication at once of the medical fitness and the possession of the necessary qualities, such as nerve, judgment, and the presence of mind required for the making of a pilot.

There are many pupils on whom a lot of time and material has been wasted in the endeavor to make pilots of them who simply do not possess these ordinary qualities, and it is not until they have had smash after smash that it is discovered they simply have not got it in them. Now

the French method should weed out the non-suitable candidate beforehand.

Personally I consider that the nearest equivalent to the art of flying is that of motor-car driving; a person who thoroughly understands and who can drive a car really well should possess the qualities required for piloting an airplane. General Brancker, in the paper he read a short time ago before the Society, mentioned a good horseman as the type possessing the necessary qualifications. I agree that good hands, a good head, steady nerves and judgment are essential qualities all of which should be found in a good motorist, with this advantage, that the good motorist is more likely to be naturally mechanical, a faculty inborn and not easily acquired, and so important in the matter of flying.

Types of Airplanes for Instruction

Time and material would be saved, in my opinion, if the modified "penguin" type of machine were more generally used for the very earliest training. I refer to the small-powered machine, incapable of leaving the ground, but designed solely for taxi-ing about the aerodrome, which was generally in vogue at the Blériot Schools before the war. On this machine the pupil can be loosed off alone immediately after preliminary explanation with comparatively no risk, and at the same time he would get used to controlling his engine, have plenty of practice in the use of that important control, the rudder, and lastly, but not least, he would have to be left to his own resources, use a little initiative, and get used to the noise and wind from his motor. This type of machine might be modified in such a way that the other controls might be brought to play an active part in piloting the "penguin" over the ground. The whole body and wings might be supported independently of the landing chassis (or rather the rolling chassis) in a sort of gimbals, so that it could be banked and elevated by the control lever whilst running along or turning. I think an hour's taxi-ing on a machine of this type would, as a preliminary, be of more assistance than the same amount of dual control, as the pupil would know at least more about the use of his rudder.

The best type of airplane to use for instruction in actual flying and the question as to whether it should be stable or not is a very debatable point. I do think, however, that the less efficient within certain limits the early training machine is, the better and sounder will be the elementary knowledge and experience gained by the pupil. Such experience is likely to be very valuable when, later in his career, he is confronted with engine failures or similar predicaments, where his reserve of engine power will no longer cover up his multitude of sins in piloting. To illustrate this point, let us assume that there are two pilots, A and B. A has qualified for his Aero Club Certificate on a box-kite, *i.e.*, early Henry Farman type biplane, fitted with 50 h.p. Gnome. B gets his certificate on a much more powerful machine, one that can climb quicker, and can even be turned and climbed a bit at the same time. He knows this is so because he has done it on his last flight. But A finds that to get round really comfortably on his he feels compelled to drop the nose a little, as it feels a little sloppy otherwise. At a later date, on valuable service machines, both A and B have engine failures. A lands successfully, B crashes badly through turning too flatly. A has learned from the beginning that he was always on the safe side in dropping her nose a bit on a turn; B always thought it unnecessary.

Personally I do not think that the stable machine is the best for training. If it is considered so on the score that once in the the air it will look after itself and so reduce the chances of the pupil crashing, then we have only to assume, for the sake of argument, that a self-landing training machine has been devised that will automatically land itself correctly, do away with the smashes on landing, and ultimately, with a few more improvements, all the pupil need do would be just to sit still and take the air, as everything would be done for him, but after many hours of joy-riding on this super-school machine he would have learned very little about piloting. For securing Aero Club Certificates for pupils at so much a head as a commercial proposition, this sort of machine might be excellent, but the unstable machine should be used as the basis of training to get the best results in the end.

The Use of Instruments for Training

I now come to another question, over which there is a deal of controversy. It is the use of instruments for training. I consider instruments as valuable accessories to any machine, but only under certain circumstances are they necessities, and in training they should not be regarded as indispensable. It is the wrong system, in my opinion, for the pupil to be made to rely on them too much. Although flying is largely a mechanical procedure, there is a tremendous lot of the personal sensation and feel that the pilot should acquire which, when once acquired, will take the place of practically any instrument devised. For instance, could an ice-skater learn to do the outside-edge merely by looking at a bubble of a spirit-level fixed in front of him? I should say no, but once he had acquired the feeling that he had correct balance, which only practice can give, he will make his sharp turn on the outside-edge at the correct angle better than any instrument could show him. Therefore I say let the pupil acquire without delay that naturally instinctive feeling so absolutely essential for a good pilot. Whilst he is taught to rely on his instrument too much to climb, turn, or even try and land, he will be long, if ever, in acquiring the art that will make him independent of instruments.

Personally I seldom use an instrument as an assistance to piloting. Do not assume that I am sneering at instruments; in fact, as I have stated, there are times when they are a necessity. In fact, I am going to suggest that one more instrument be fitted as a standard equipment, an instrument to reduce the risks connected with flying in clouds.

Flying Through Clouds

It may not be generally known that there have been such a large number of fatal accidents during the last three years entirely due to flying through clouds, and I consider this subject wants going into pretty carefully. The accidents to which I refer have not been questions of a want of height; the machines have become hopelessly out of control. I will give you an instance which happened to myself a few weeks ago in the West of England. You will then realize why I consider this is a serious matter requiring particular attention. I set out on a very cloudy, windy day to do a test climb to 10,000 feet on a late type two-seater. I had so often on previous occasions succeeded quite comfortably in reaching this height in spite of cloudy, overcast days by pushing up through the clouds, usually only a matter of a few minutes, into bright sunlight and the bluest of skies, and, after reaching the desired height, coming down again through the clouds, having flown by compass and time. On this particular day, however, the wind was very gusty, and on reaching 1,200 feet we got into a dense rain cloud, but carried on to beyond 5,000 feet, still in the cloud, when the compass apparently began to swing (really it's the machine that begins swinging, not the compass), and efforts to check the compass had the effect of causing it to swing more violently in the other direction. The air speed then rushed up far beyond normal flying speed; all efforts to pull her up checked her only slightly; then the rudder was tried, back went the air speed to zero; there was an unusual uncanny feeling of being detached from the machine, and I knew her to be literally tumbling about in the clouds. All efforts to settle down again to a straight flight seemed to be unavailing, until we emerged from the cloud very nearly up-

Method Used to Conceal Auto Machine Guns from Hostile Aircraft

side down. Assuming control again was then an easy matter. This sort of thing has happened to me more than once, and, in the Flying Corps vernacular, "it puts the wind up you," and it has happened many times with other pilots. In some cases they emerge from the clouds in a spin, others are known in which the planes have collapsed under the strain of the sudden pull-up from the vertical nose-dive. A few days ago a squadron commander told me that on one occasion when in France everything loose in his machine fell out whilst in a cloud. A week or so ago, on the South Coast, a machine disintegrated in a cloud and the main planes landed half a mile from the body. From my own experience this is a very unpleasant state of affairs, and in consequence I avoid clouds when possible. Let us try and examine the cause of this. First of all you must realize that in a cloud you see nothing whatever but your machine around you. There is no fixed point visible. The only means by which you can tell if you are flying in a straight course is by your compass and your air speed. The compass should give you your direction horizontally, your air speed your direction vertically. The first thing that happens, and very readily, too, if windy and bumpy, is that your compass card will begin to move slightly. It really appears to you that the compass was suddenly affected by the cloud, and you are still flying straight ahead. How often you hear a pilot say that as soon as he got into a cloud his compass started spinning. The moment the compass starts moving it requires extremely delicate ruddering to get it back to a steady position; in fact, one invariably over-corrects the compass movement and so the trouble begins. Once the compass starts on a good swing I have found it nearly an impossibility to get it steady again until out of the cloud. Before your compass starts to move your machine has already started to turn. You rudder the opposite way to check it, over-correct it, and turn sharper the other way on to a bank turn; then the nose drops and the speed goes up. Pulling back your elevator lever has little or no effect, for if you are banked above an angle of 45 degrees the elevator becomes the rudder. All this occurs without the pilot being in the least bit aware of the position that his machine is taking relative to the ground. The instruments available are of little service once he loses his control.

Of what use is his air speed indicator to him indicating 150 m.p.h. if the machine is on a spinning spiral and he imagines that he is merely descending too fast on a steep, straight glide? He naturally tries to pull up, but with no effect. The bubble does not help him, as centrifugal force will send that anywhere. It may be argued that if a stable machine is left alone under these circumstances it will right itself eventually and assume a normal glide. It very likely would if the pilot could steel himself to let it entirely alone, but before it did so it would have to be left to do a sheer vertical nose-dive for some moments, and in these days of big weights and little head resistance one is liable to attempt to pull out too suddenly from the dangerous high rate of speed attained on this dive. What I want to see fitted is an instrument which will show a constant vertical or horizontal line and be independent of centrifugal force. I have no ideas upon the subject nor suggestions as to how this is to be brought about, unless something in the nature of a small gyroscope driven by an air-screw could be employed in some way to meet the requirements of flying in clouds, but until something is provided so that the pilot can see a fixed line, I think we shall continue to have accidents from this cause.

Flying at Great Altitudes

There are lots of other points that I should like to touch upon, but as my time is getting short I shall now deal with the subject of flying at great altitudes as I have found it. The most marked development in the modern machine is its extraordinary capacity for climbing to a great height in a short time. At the beginning of the war the average height flown on active service was 4,000-5,000 feet, simply because few of the machines then in use with the impedimenta carried could get much higher. To-day a height of 20,000 feet is, I believe, on certain occasions reached, and it is fairly certain that if progress continues at its present rate, heights a great deal beyond this figure will be reached as a usual thing. These great altitudes bring forward many difficulties which will have to be seriously considered. The first trouble in the winter will be the extreme cold to which the occupants will be subjected unless they are protected by special cowling, which will gather in the warmth given off from the engine. This, to a certain extent, is the natural advantage obtained in the tractor. The question of the difference in the comfort of machines in this respect was shown to me in a very marked manner last winter. I was testing the fall-off of engine power at a height on a tractor two-seater, in which it was specially arranged that the warm air from the radiator and engine passed along the body to the pilot and then to the passenger, and although at a height of over 21,000 feet with the thermometer below freezing at ground level, I did not suffer in the least from the cold, neither did my passenger, who sat behind, complain until we shut off to descend. As a contrast to this, a few days later I was on a single-seater at an altitude of 17,000 feet, and although it was a tractor with a rotary motor, I suffered intensely from the cold, and became so numbed that my vitality must have been something akin to a dormouse under the snow, and, in spite of being well gloved, I had frostbitten finger tips, which pained for many days afterward. Surely this is a very inefficient state for a pilot at the front to have to take on an air fight or other exacting work? Put two pilots up to a great altitude, one kept well warmed and comfortable, the other half dead with the cold, and it would be easy to surmise which would be most likely to do the best work.

I really believe it is more by accident than design that the pilot or passenger have benefited at all in the past from the heat of the engine, with the exception perhaps of the late S. F. Cody's machine. He purposely placed the radiator of his pusher in front of the pilot to keep him warm. I know from my experience when flying in France in the cold weather that the discomfort owing to the extreme cold became intense when flying only at 6,000 feet on a two or three hours' reconnaissance flight. This is a point to which designers should give attention, especially as machines are now easily capable of reaching great heights. During summer weather conditions would probably be tolerably comfortable, but in winter it would be well nigh impossible unless better arrangements are generally made.

Cold also affects the engine pretty seriously. This is more noticeable with the water-cooled type. Unless some provision is made for blanketing the radiator surface at heights it becomes far too cold for efficient running. Cases are known of the freezing of the water system on a descent from a great height, with pretty serious results to the engine, as well as the difficulty of getting the engine to run again efficiently through being too cold to effect a landing. In the future war machine the pilot must have a very wide range of control over the water-cooling system.

Effects Due to Flying at High Altitudes

I will now touch lightly on effects that I have experienced on high flights. I have found the effect of high, *i.e.*, rarefied, air to be felt slightly at about 10,000 feet increasing with the altitude. Breathing becomes affected, respiration shorter and quicker, there is a curious oppressive sensation and a bulging feeling in the head until the height of about 20,000 feet is reached. I am told by a medical friend who has made rather a study of the subject that there is always a risk of a sudden collapse, and oxygen should be used whether the aviator feels fit or not. Of course, the effect felt varies considerably with individuals, and with the state of one's health. About 18 months ago I suffered slightly with my heart, and found I could not get very high without feeling giddy, and after returning from a flight to 12,000 feet I had palpitation which lasted until the following day. In consequence I had to abandon high flying until treatment got me fit again. This year I have made a number of high flights and have felt no ill effects whatsoever; in fact, I find the more one gets accustomed to going up high the less the effects are felt. I am told that this also is the case in mountaineering. I can remember the unpleasantness of my first flight to 15,000 feet. It was very marked, especially the pain experienced in the drum of the ears on descending. The fact that a flight now to 21,000 or 22,000 feet does not have so much effect I put down entirely to acclimatization. I use oxygen as a precaution when ascending beyond 20,000 feet for the previously mentioned reason. A small bottle is carried, fitted with a special reducing valve, which is fixed in the body within easy reach of the hand. No special regulation is required as it is set to pass only the necessary amount of gas into the face mask which acts as a mixing chamber, with its inlet and outlet air valve. The apparatus weighs 16 lb., and contains sufficient oxygen for one hour's continuous use. After reaching 20,000 feet I find it is only necessary to use the oxygen intermittently, and accordingly I simply hold the mask after turning on the gas over the mouth and nose and take a few breaths of it, perhaps every half minute. The effect on me is remarkable; most of the oppressive feeling vanishes, and, excepting for the unpleasant bulging feeling of the head, which you experience with a bad cold, the sensation is one of suddenly being again at ground level. The only after-effects upon landing from these high altitudes are that you seem to acquire a pretty good thirst, due, I suppose, to the use of oxygen. If the speed of climb continues to improve at the rate it has for the past three years, it looks as though aviators will become subject to what is known as "Caisson Disease," due, I am told, to the sudden reduction in atmospheric pressure, such as divers are subjected to when they come to the surface from a great depth, owing to the nitrogen which has been absorbed by the system, in proportion to the atmospheric density, forcing itself too rapidly at any lower pressure from the system.

There are many other points that I intended touching on in this paper, but I find that to do full justice to the subject it would occupy considerably more than the limited time at my disposal.

The Cleveland Aero Engine

The following interesting details of the new Cleveland engine have been supplied by the manufacturers:

The requirements of an aviation engine today seem to be maximum possible power which can be crowded into certain limited space without excessive weight, economy of operation in regard to both fuel and oil, reliability for extended periods of time, and lightest possible weight. In developing the Cleveland aero engine these points have been considered and incorporated in its design.

There seem to be limiting speeds beyond which a propeller loses some of its efficiency and absorbs a certain amount of power from the engine which it cannot convert into effective thrust. These limiting speeds are considerably below the practical maximum rotary speeds for the high-powered gas engine. These being the facts, the logical solution of this problem is to design a machine for high piston speeds and gear down from the crankshaft so that the propeller makes a lesser number of turns. In any ordinary type of fixed cylinder machine this is accomplished through reduction gears which compare in an airplane to the transmission in a car; in other words, becomes a separate and intermediate unit.

The Cleveland aero engine has incorporated these speed-reducing gears in the design of the engine as an integral part of the machine, practice having proven that it is entirely feasible, especially in the smaller types of engines, to operate the engine at twice the propeller speed or more. In this engine the propeller speed is exactly one-half that of the crankshaft, and the parts are so arranged in the design that no separate camshaft is required, eliminating in itself a number of parts ordinarily used and thereby also reducing weight.

In order to obtain the highest practical economy of both fuel and oil, water cooling is used. This makes possible carrying the cylinder compression much higher than would be practical by direct air cooling, which in itself makes for much greater fuel economy. The comparatively low temperatures of cylinders and pistons conserves the oil supply and assists in making possible a larger radius of action on a given weight of oil.

In connection with the question of lubrication, another feature of this motor is worthy of attention. There are no plain bearings in the crankcase structure of this engine which ordinarily require pressure oiling systems of extremely high efficiency in order to prevent overheating of these bearings under the heavy duty required of them. This being the fact, special methods for cooling lubricating oil become unnecessary, thereby saving an additional weight and complications required for such cooling. In addition to that, the all ball-bearing construction makes possible the delivery of a far greater percentage of the indicated horsepower through the propeller.

The entire design has been worked out with a view of developing a machine specially suitable for working into stream-line body form. The machine is compact, and its parts so located that the operator has all features usually requiring attention immediately in front of him, so that their operation may be watched and adjustment made even in flight, as might become necessary.

From a thermal standpoint, the machine is highly efficient. It is also capable of developing practically the maximum amount of horsepower per inch of piston displacement. The shape of the combustion chambers and the details of cylinder design and assembly make these things attainable.

The Akimoff Dynamic Balancing Machine

This apparatus is of interest to engine builders. It is based on the principle that lack of dynamic balance (in a statically balanced body) is due only to a centrifugal couple acting in an axial plane. This can only be balanced by introducing another centrifugal couple of the same magnitude but of opposite sign, in other words by drilling two holes or adding two weights.

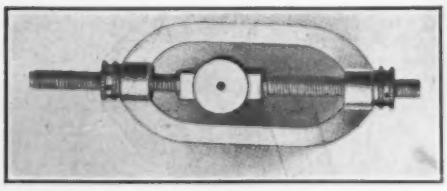

FIG. 1

The apparatus consists of a clamp (Fig. 1) very carefully made and calibrated, which is firmly secured to the outer end of the shaft of the body, the other end of which is fastened in a chuck of a plain engine lathe (Fig. 2). The end carrying the clamp is resting on the rollers of a yielding support, firmly secured to the shears of the lathe, and provided with an ordinary dial gage indicator and that is all.

By trial the clamp is adjusted in its proper position on the shaft, throwing it off center through a certain amount; thus

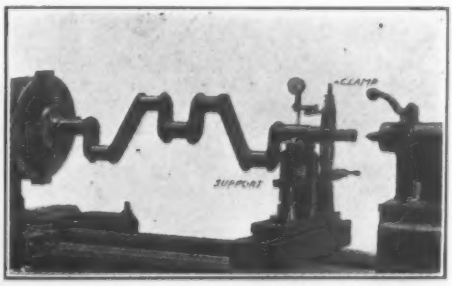

FIG. 2

an unbalanced centrifugal force is produced, acting directly upon the body itself; and in consequence of the reaction of the fixed end of the shaft, such an unbalanced force can be made to counteract the disturbing unbalanced couple of the body.

All that has to be done is to read the off-center displacement of the clamp and to take into account the distance of the clamp from the chuck; and an immediate reference to specially constructed tables or curves gives a quick answer as to what to do, how and where to drill, etc. Fig. 3 represents a data sheet, referring to a four-cylinder crankshaft of a well-known car.

These clamps are standardized and range in 1-in. intervals like ordinary micrometers; for instance: the smallest size is 0 to 1 in.; the next size is 1 to 2 in., etc. Several sizes are carried in stock, while special sizes can promptly be made to order, there being absolutely no limit to the size in which a clamp can be made.

The yielding supports are so proportioned that one size can take care of a great variety of shaft diameters.

This equipment need not be operated at excessive speeds during the tests; the results are quite independent of the r. p. m. An average mechanic can learn the operation in about two hours. In two days he

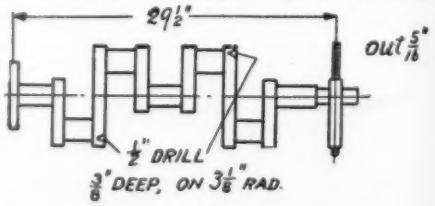

FIG. 3

becomes an expert; he has no calculations to make and must but follow the easy instructions and charts supplied with each device.

$640,000,000 Aviation Bill Passes House

Gas Plant at Langley Field

Contract has been awarded at $379,856 for constructing and equipping the hydrogen gas plant of Langley Aviation Experiment Station and Proving Grounds at Hampton, Va., where the Government will expend millions of dollars. The Improved Equipment Co. of New York received the contract, and contract for building a dock and railway to connect the aviation plant with Back River has been awarded at $22,000 to the Vaughan Construction Co. of Shawsville, Va.

The gas plant will include these features: Hydrogen generating building; flash charging building; steam boiler plant; blue-gas generator; No. 6 horizontal positive-pressure blower for blue gas; blue-gas exhauster; blue-gas holder of 25,000 cubic feet capacity; blue-gas scrubber; blue-gas meter; multiple vertical retort-type hydrogen furnace with hydraulic main and scrubber; hydrogen-gas exhauster; hydrogen-gas holder of 200,000 cubic feet capacity for 15x12-foot oxide purifiers for blue gas; hydrogen-gas relief holder of 5000 cubic feet capacity; four 10x6-foot hydrogen-gas purifiers; two steam hydraulic elevators; capacity 3500 cubic feet per hour when operating 22 hours daily, with provision for increasing to 7000 cubic feet per hour.

The Aviation Bill, carrying an appropriation of $640,000,000 for Army aeronautics, was passed by the House of Representatives July 14, without a dissenting vote, and with very brief debate.

The measure will now come before the Senate, where its passage without serious opposition is anticipated.

$45,000,000 Asked for Naval Aeronautics

The Secretary of the Navy has recommended to Congress the appropriation of $45,000,000 for naval aeronautics, in addition to the amounts already made available.

Discussing the need of this appropriation, Secretary Daniels said:

"The value of aircraft has been abundantly demonstrated in the present war, and the Navy is making efforts to build up an air force of sufficient size to operate as scouts from naval vessels, to patrol the waters off the extensive coasts of the United States and our insular possessions, and also to cooperate with naval forces abroad in anti-submarine warfare.

"The $45,000,000 recommended will be required to maintain and expand the existing schools and stations, to establish new stations and training schools and to purchase the necessary aircraft—seaplanes, dirigibles and kite balloons—for use on the high seas and from coastal stations at home, and in cooperation with our allies.

"The additional personnel required for the operation of the naval aircraft is being enrolled in the Naval Reserve Flying Corps. Applications continue to be received in large numbers, and the successful candidates are being taken into the service as rapidly as possible."

MAKING PROPELLERS IN A FRENCH AVIATION CAMP NEAR SALONICA

Testing Laboratory for Engines

The National Advisory Committee for Aeronautics authorizes the following:

At a recent meeting of the subcommittee on power plants of the National Advisory Committee for Aeronautics, preparations were made for the development at the Bureau of Standards of a laboratory for testing aircraft engines under conditions of altitude and temperature similar to those encountered in flights at an altitude of 20,000 feet or more. The laboratory and its experimental equipment will be organized under the auspices of the Advisory Committee, and the investigations will be directed by the subcommittee on power plants.

The special immediate purpose of this proposed equipment is the prompt testing out of the so-called "All America" airplane engine, now under development, in order to be able to immediately put it under controllable conditions corresponding to any altitude and any atmospheric conditions which would be met in the air.

Radio Division Established

A Radio Division of the Office of the Chief Signal Officer has been established. This office will handle radio matters for both the Aviation Section and the Signal Corps proper.

Major Nugent H. Slaughter, U. S. R. has been designated as the officer in charge of this division, with headquarters at 1710 Pennsylvania Ave., Washington, D. C. Capt. Clarence C. Culver has been transferred from the Aircraft Engineering Division to the Radio Division.

Spokane Plans Landing Stations

Spokane is to be one of the first cities in the United States to lay out and maintain regular landing stations for passenger, freight and postal airplanes.

The selection and assignment of these stations will be one of the first duties of the new city planning commission, the establishment of which will be voted upon at the November election.

Commissioner C. M. Fassett has called attention to the necessity for such stations in view of the rapidly increasing use of aircraft.

"It's a logical duty for the commission to plan such stations," he declared.

Traffic After War

The end of the war will see the United States, not only with thousands of planes, but with such facilities for the rapid turning out of new flying machines, that private planes will become common, Mr. Fassett believes.

City planning committees which are at work all over France, getting ready to rebuild German-destroyed cities and towns, are paying special attention to the selection and adaptation of tracts of land for airplane stations. The French example, Mr. Fassett says, should be followed at Spokane.

Present apparently available locations in Spokane include the park board's property between Mission, Sinto, Cook and Regal, the up-river golf course and some raw land southwest of the Northwest Boulevard.

The preparation of the landing stations is not a complicated business. The land is cleared of all big rocks, huge markers are laid out to guide aircraft approaching the city, illumination is provided for night work, and workshops, where machines may be overhauled and repaired, are constructed and equipped.

"All America" Airplane Engine Ready for Tests

Announcement that the new airplane engine with which America's air fleet will be equipped has been built and is ready for final tests has been made by Brig.-Gen. George O. Squier, Chief Signal Officer, testifying before the Military Affairs Committee of the House. The committee was considering the Administration bill for the organization of the first contingent of the air fleet.

The new engine will be an American development, though its designers have had the benefit of all information and experience of our allies abroad. Howard Coffin of the Council of National Defense, one of the most successful automobile engine designers in the country, is understood to be largely responsible for the new engine, which is said to promise a big advance in sustained flight and weight carrying power.

Ground School Graduates

With the graduation of 142 candidates for appointment as aviation officers it became evident that the plans of Brig.-Gen. George O. Squier, Chief Signal Officer, are working out successfully with respect to personnel. Eleven days before any of these candidates entered the schools of military aeronautics assurances were given that 120 students would be graduated at the ground schools at Cornell and other colleges on July 14. This number was exceeded by twenty-two.

There were graduated from the aviation schools at the University of Illinois, twenty-five; the University of Texas, nineteen; Cornell, twenty-eight; the Massachusetts Institute of Technology, twenty-three; the University of California, twenty-four, and the University of Ohio, twenty-three students. There are now more than 1,200 candidates undergoing training at these schools, and 100 are being trained at the ground schools which were opened at Princeton and the Georgia Institute of Technology on July 2. The six ground schools first named are expected to graduate an average of 150 a week from now on, and beginning five weeks hence, when Princeton and the Georgia Institute also will begin to turn out graduates, the total for the country will be swelled to 200 a week, or a prospective 10,400 graduates during the next year.

The men who have done no flying but who have gone through an intensive training in all ground work up to the point of flying have been assigned to the aviation schools at Chanute Field, Ill.; Selfridge Field, near Mount Clemens, Mich.; San Diego, Cal., and Mineola, L. I. After successfully passing examinations as fliers they will be commissioned as first lieutenants in the Aviation Reserve Corps.

Flying to Begin This Week at Rantoul

Flying will begin this week on the first of the big new Government aviation training fields, at Rantoul, Ill., Howard Coffin, chairman of the Aircraft Production Board of the Council of National Defense, announced on his return from a visit to the training fields now under preparation at Rantoul, Dayton, Ohio, and Mount Clemens, Mich. There will probably be twenty fliers on the ground at Rantoul this week and all three fields will be completed by July 15.

"The construction work on Chanute Field at Rantoul has broken all records," Mr. Coffin said. "A half million dollars' worth of buildings have been put up practically within a month. They form a village a mile long and the speed with which they have virtually sprung out of the ground has been deeply impressive. A few weeks ago the big mile-square space was simply a collection of cornfields.

No Disagreement Among Men

"The explanation for the speed with which the work has been done is the spirit which has filled the men engaged in it. Union men and non-union men are working side by side in the effort to advance the national interest. The only outward distinction is that the union men are working behind a big American flag which is advanced as the job progresses. The sole idea which has occupied the minds of the workmen has been the desire to break all records on this war work. There are 2,000 men on the job and there has not been a disagreement or row of any kind since it started. I was impressed with the fact that these men were doing their part in the Nation's service just as earnestly as though drilling in the ranks with guns on their shoulders.

Work on Other Fields

"There are 3,000 men working on the Wilbur Wright Field at Dayton and 2,000 on the Selfridge Field at Mount Clemens. The Dayton field is the most impressive, as it is more than twice the size of the others. It is intended to accomodate four squadrons instead of two and is about 1¾ miles wide and 2¼ miles long. Orville Wright is actively superintending the work at Dayton.

"The preliminary training schools now training cadets will be prepared to send quotas of students to the training fields as soon as the fields are ready and the work will be in full swing by the last of July. Arrangements have already been made for training planes and although the full quota of machines will not be available by the 15th the shortage will not be serious."

Realize Size of Task

"The Aircraft Production Board has no illusions as to the size and character of the job before it," a statement issued by the Board the other day says, "but the whole task is one of industrial organization for quantity production, and in this we Americans are above all other nations fitted by experience and tradition to break records. The new permanent air craft exhibit should furnish a valuable aid to the process of familiarizing the industry with the task and organizng for its accomplishment.

Marine Corps Aviation Station

A camp has been opened at the Philadelphia Navy Yard for the new marine aviation corps.

The corps is commanded by Capt. A. A. Cunningham, and he is assisted by Capt. F. T. Evans, Capt. W. M. McIlvain, Lieut. Edward Chamberlain and Lieut. W. E. McCaughtry. There are 178 enlisted men in the organization, recruited from chauffeurs, engineers and others familiar with delicate machinery.

Spark Plugs for Airplane

To find an American-made spark plug that would satisfactorily take the place of the foreign plug heretofore used in the airplane engines which they are building for the United States and certain allied governments the Hall-Scott Motor Car Co. of Berkeley, Calif., has just completed a series of exhaustive tests. After what it terms "the most rigid tests any American plug has ever withstood the company gave an order for a quantity of Rajah Rajite waterproof plugs to Hughson & Merton, Coast distributors. In the test the Rajah plug was run for fifty hours wide open upon one of the Hall-Scott 150-h.p. engines.

The tests just concluded have extended over a period of eight months, during which time every available American plug was tested under conditions for safety's sake even more severe than prevail in actual airplane use.

Sturtevant Co. Assisting in Ground School Work

W. E. Barrett, of the Sturtevant Aeroplane Co., is lecturing at the School of Military Aeronautics of the Massachusetts Institute of Technology, on the transportation of machines.

One of the mechanics from the same company is giving instruction in sail making and splicing, and the company is giving valuable assistance to the school in many other ways.

Dayton Wright Expanding

Official announcement has been made that the Dayton Wright Airplane Co. has taken over the Moraine City factory of the Domestic Engineering Co. for production of airplanes for the United States Government.

An initial order of 500 machines to be completed by the end of the present year, has been received with additional orders expected to follow.

Several hundred acres surrounding the factory will be made into an aviation field, for testing machines. One new building will be constructed at once for assembly purposes.

These industrial undertakings will give employment to thousands of men, women and children. Twenty minute service will be given between Dayton and Moraine City for people employed at that place.

THIS PHOTO OF A NIEUPORT SCOUT SHOWS CLEARLY THE ARRANGEMENT OF THE BRACING WIRES, THE TWO FLYING WIRES COMING TO A POINT AT THE BODY HINGE AND THE TWO LANDING WIRES AT THE JUNCTION OF THE OUTER STRUT

Curtiss School Record

The Curtiss Aeroplane Co. advise that their instructors at the Atlantic Coast Aeronautical Station during the past few months have flown Army Reserve Corps men a total distance of 104,000 miles, without any serious accident to the Corps. This is a creditable record, speaking volumes for instructors, machines and for the safety of flying.

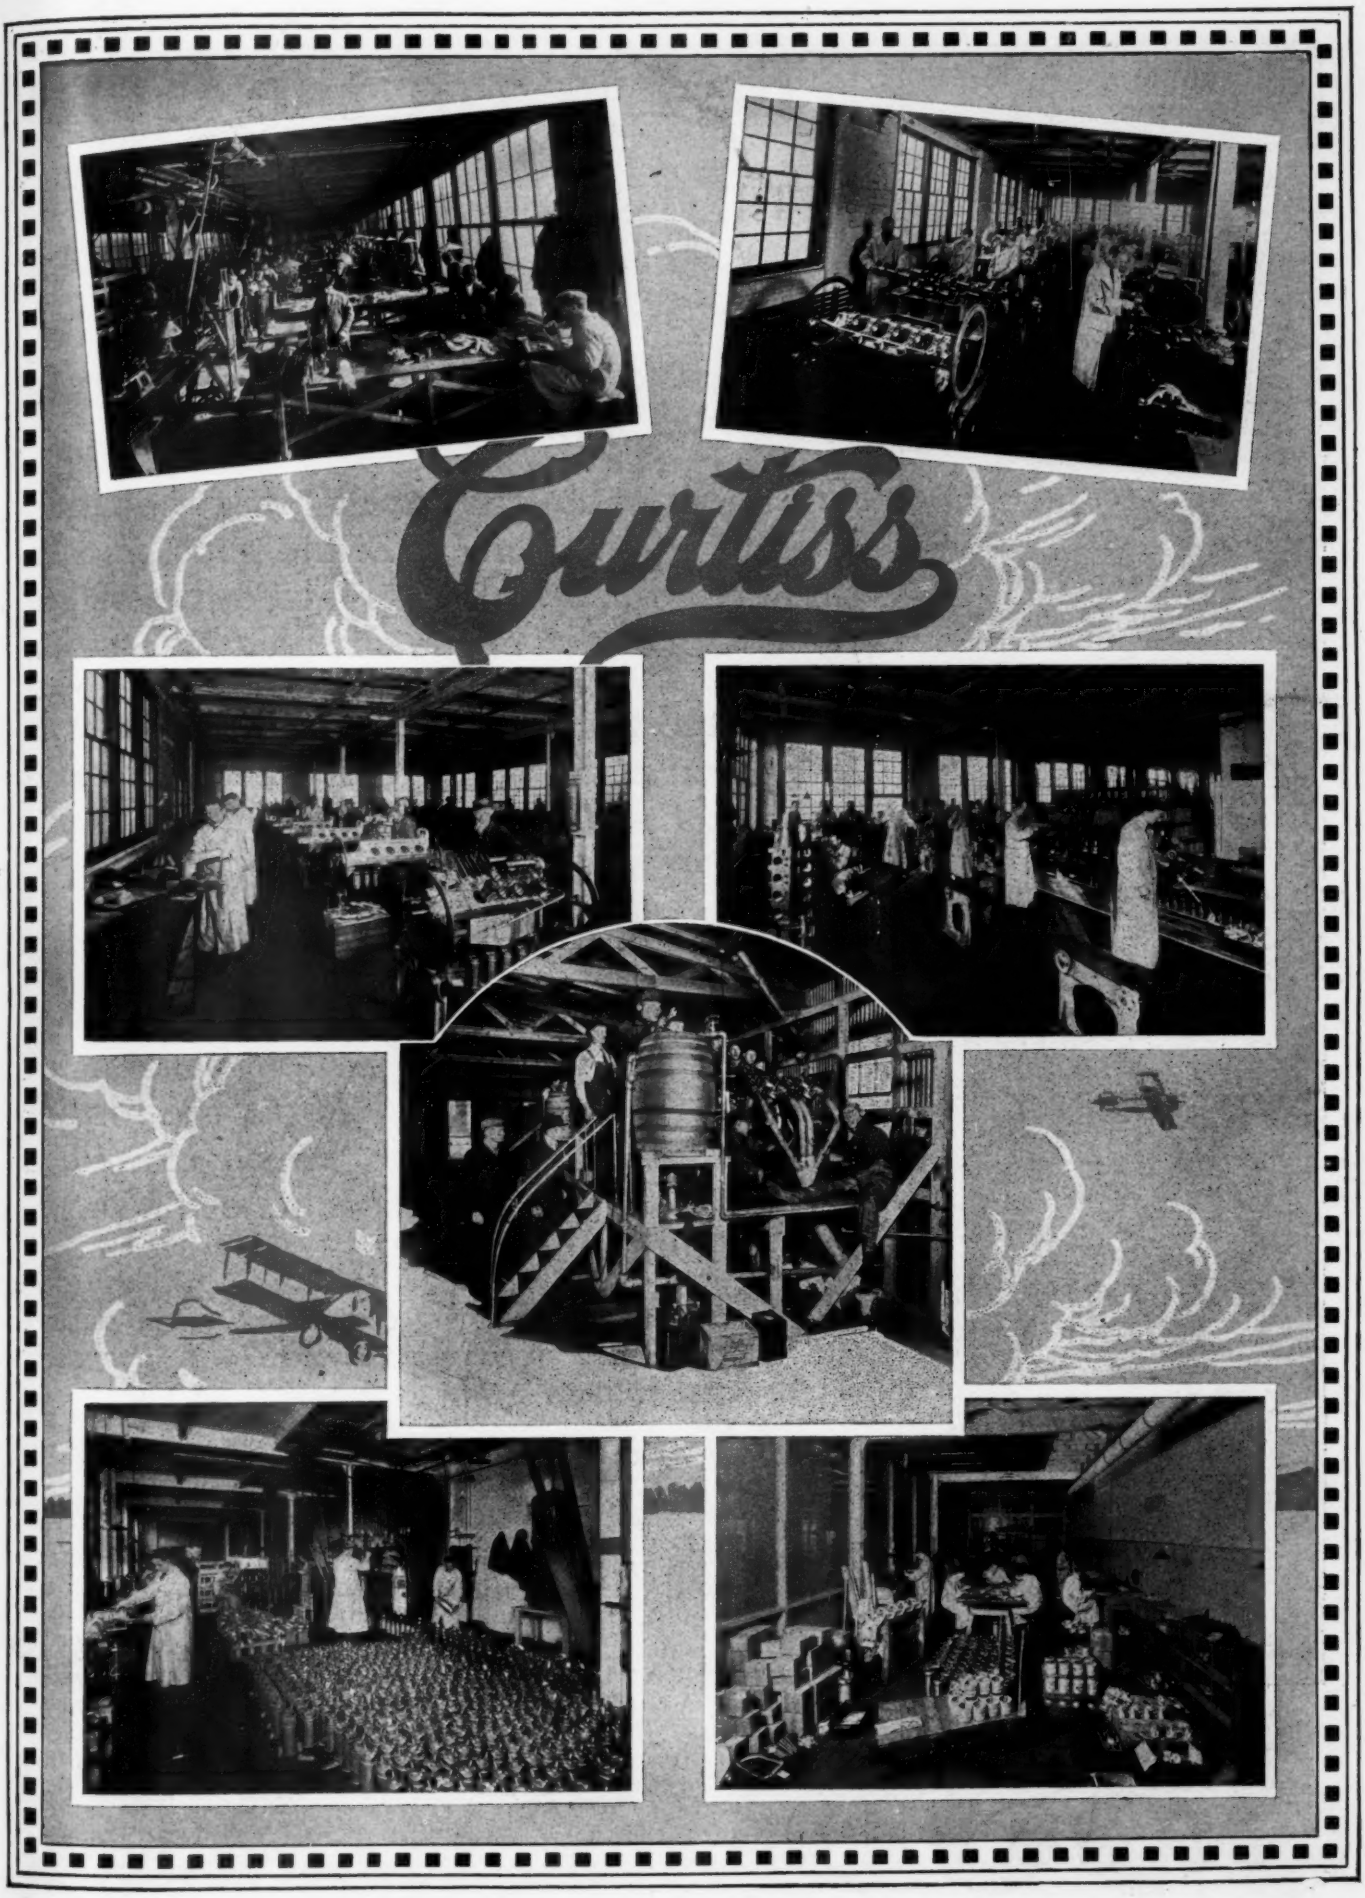

THE CURTISS AEROPLANE AND MOTOR CORPORATION, BUFFALO, N. Y.
Member Aircraft Manufacturers' Association, Inc.
America Trans Oceanic Company, 280 Madison Ave., New York City, New York Agents.

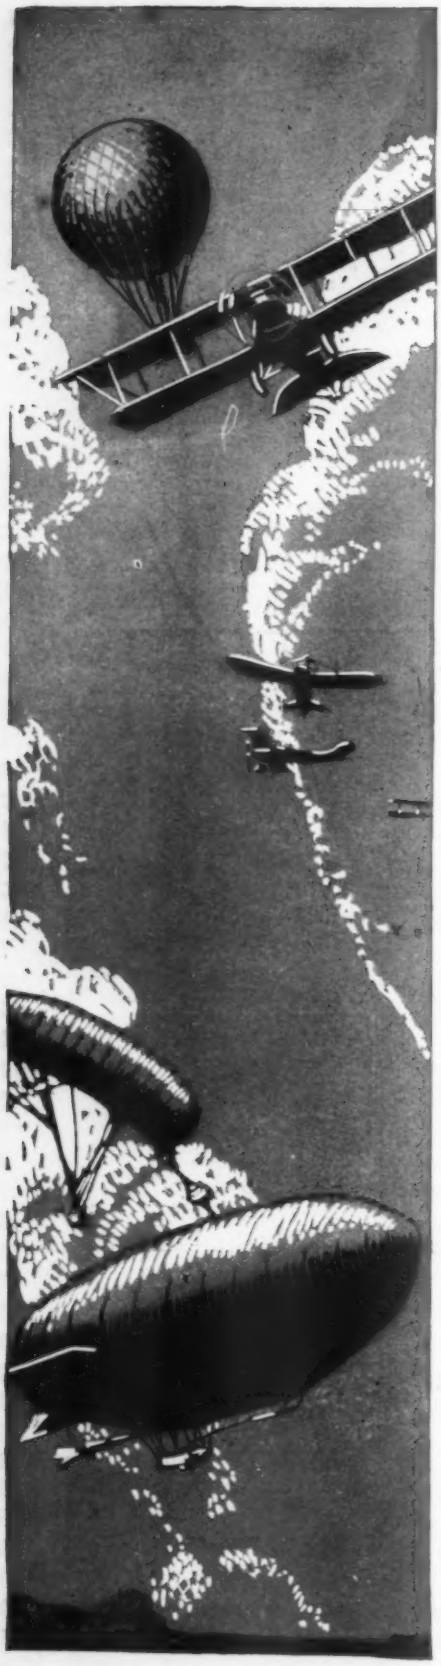

The Eyes of the Guns

THE Great War has shown clearly that the observing airplane is not all-sufficient for the artillery.

The needs of the guns must often be served by more unwavering eyes.

The stable and readily available kite balloon is an indispensable eye of the guns, and its further development is as imperative as the perfection of any of the other aerial services.

Before the new Goodyear Kite Balloon was tested and approved, the problems demanding better solutions were the primary ones of *material* and *stability*.

In both, Goodyear has made a decided advance.

Our work for many years on balloons of any size and every type has put the former on a standardized basis, which simplifies specification and makes definite the direction of further progress.

The latter demanded newly directed labor in design and ungrudging research in the field — in our own country and abroad.

The result is the new Goodyear Kite Balloon.

Even as years of achievement have justified its Goodyear fabrics, exacting tests have justified its reinforced tail cups and the design of every part.

The Goodyear Tire & Rubber Company, Akron, Ohio

GOODYEAR
AKRON

AIR SERVICE JOURNAL

A Weekly News Magazine Devoted to the Interests of the Army and Navy Air Services

PRINTS ALL THE NEWS OF THE AIR SERVICES; PERSONAL ACTIVITIES OF INTEREST TO THE SERVICES; FOREIGN EVENTS IN THE AIR; DEVELOPMENTS IN THE AIRCRAFT INDUSTRY AND NOTES OF THE FLYING FIELDS.

SPECIAL ARTICLES ON MILITARY AND NAVAL AERONAUTICS OF INTEREST TO OFFICERS AND ENLISTED MEN APPEAR IN EVERY ISSUE.

THE LATEST AND BEST PHOTOGRAPHS ILLUSTRATING AERIAL HAPPENINGS ALL OVER THE WORLD ARE FEATURED.

THE PROGRESS AND ACHIEVEMENTS OF THE AIR SERVICES RECORDED IN BRIEF AND ATTRACTIVE FORM.

Published every Thursday by

AIR SERVICE JOURNAL

120 West 32d Street NEW YORK, N. Y.

SUBSCRIPTION PRICE

$3.00 a Year, Foreign $4.00 *Single Copies 10 Cents*

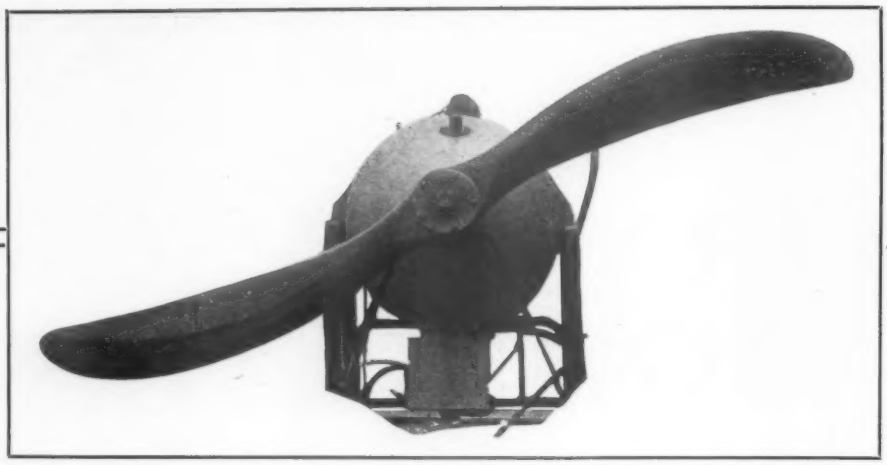

The 100 H.P. Cleveland Aero Motor

AN EFFICIENT AIRCRAFT POWER PLANT THAT OFFERS MANY DISTINCT ADVANTAGES TO THE AEROPLANE CONSTRUCTOR.

Reliability :: Dependability :: Power

Write for complete information.

CLEVELAND AERO MOTOR CO.
ENGINEERS BUILDING
CLEVELAND, OHIO

J. ROBINSON HALL

AEROPLANES, MOTORS
AND EQUIPMENT

PACIFIC COAST
REPRESENTATIVE

FOREIGN AND AMERICAN
MANUFACTURERS

C. M. SOMMERVILLE
SALES MANAGER

609-611 Merritt Bldg., Los Angeles, California

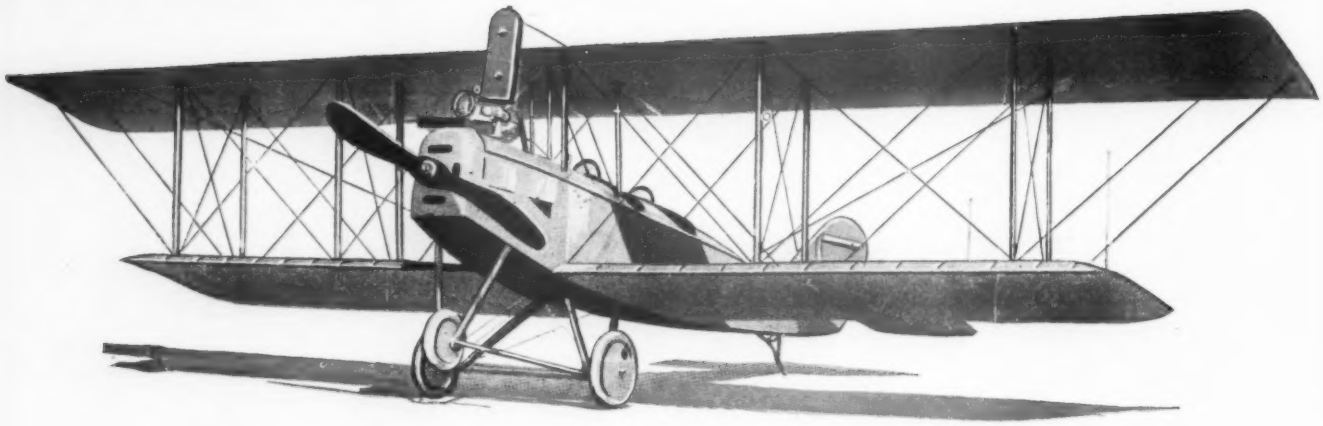

Airplane Parts!
Immediate Delivery!

Fortunately, the present crisis finds the Standard Parts Company ready to help you greatly in the rush demand for airplanes.

We are able to ship immediately necessary parts for the construction of airplanes the government must have in a hurry.

You can order from us at once such parts as:

Steel Tubing
Stabilizer Tubes
Push Rod Tubes

Tubing formed per B/P's and straight tubing in diameters ranging from ¼" to 2½", 14 gauge (.083") to 22 gauge (.028")

Special Rod Assemblies

Rims of all sizes to government specifications

Bearings
Tire Rims
Springs
Forgings.

For years we have made oval and "D" shaped tubing for the Curtiss Airplane Co.

Let us help you make your estimates.

Write us for information at once before you submit your bids for airplane construction.

If you have already made a contract, wire or write us immediately and take advantage of the instant service we can render you.

The factories of this company have been among the foremost in the field of motor-driven vehicles since the earliest days of the industry. Our engineering department and our laboratories are among the most complete in the world.

The Standard Parts Company, Cleveland, Ohio, U. S. A.

Famous for Stanweld Rims, Tubing, etc., Perfection Springs, Bock Bearings, Axles, Perfection Heaters, Forgings, Hubs, etc., etc.

The Cutler CURTAIN Kilns

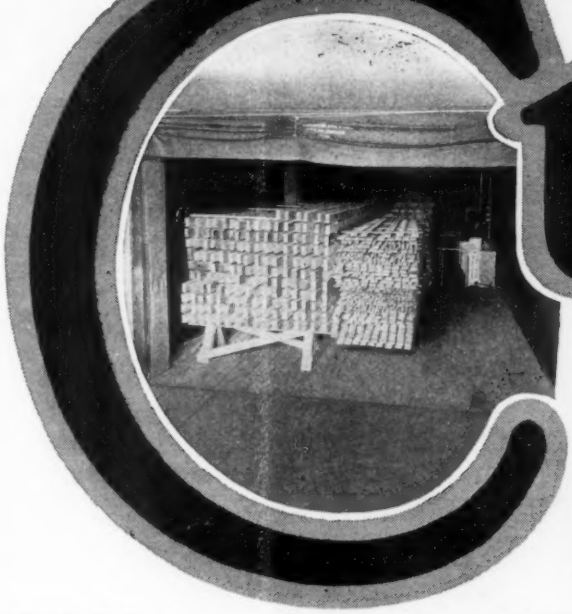

FOR two years the CUTLER CURTAIN KILNS have been successfully used for conditioning spruce, by the CURTISS AEROPLANE CO. After an exhaustive investigation of all makes, this company has adopted the CUTLER as regular equipment for all their plants. We produce ideal conditions for seasoning aeroplane spruce. Automatically controlled. Used by the Aircraft Division of the U. S. Government. Write for full details.

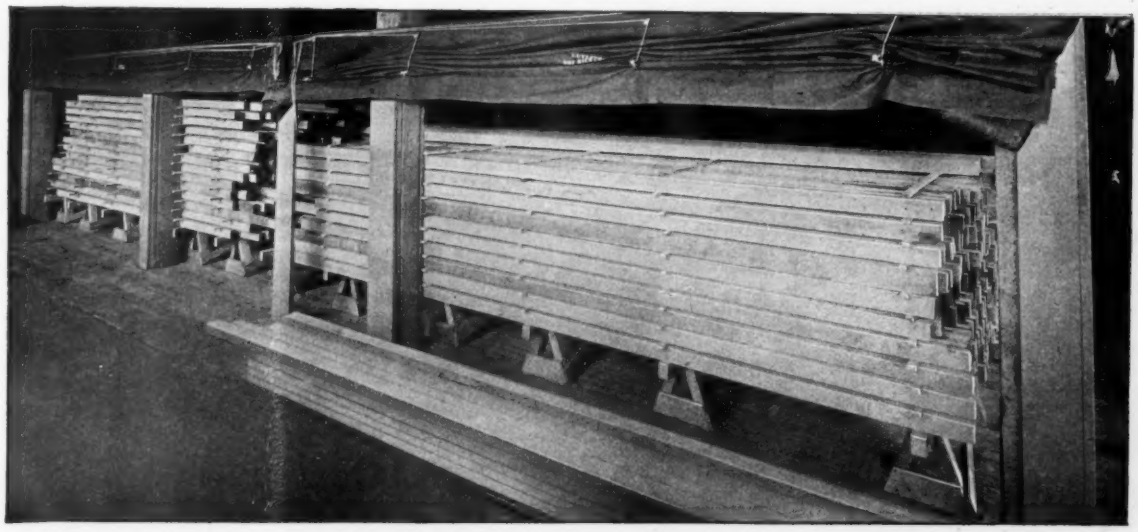

The CUTLER DRY KILN CO., Inc.

14-64 Churchill St. Buffalo, N. Y.

A practical quality oil for aeroplane motors

BEING engaged in the business of lubrication, the Swan & Finch Company has concentrated the effort of its engineering department on the problem of finding the most efficient and most practical oils for aeroplane motors.

In taking up this work some time ago, we found an apparent haze of mystery around the whole subject of aeroplane lubrication. As our investigations and tests progressed, we became more and more convinced that the problem was *not* complicated.

Laying aside the doubtful questions as to the effect of altitude, temperatures at high altitudes and other special conditions surrounding aeroplane usage, the question resolves itself in its simplest terms to this:

The lubrication of an exceptionally fine motor operating continuously under maximum load.

The very fineness of the mechanism, accuracy of manufacture and the fine tolerance of dimensions, makes the problem simpler rather than more complicated.

Hence, we have produced Aerol —not an oil of mystery—but a practical quality lubricant based on conditions to be met (except for rotary motors).

Aerol is, first of all, a very high grade oil, free from impurities.

Its lubricating values are very high, because it is an exceptionally good oil, made from a good crude to begin with, by a process developed through years of knowing how.

The drop in viscosity with the increase in heat is (relatively) unusually small. It is made in three grades of viscosity to meet the requirements of different types of motors.

Aerol is a practical oil because it is easily handled, flows easily. This feature is of practical utility where oil is drained off and cleaned out frequently. Also, where external feed systems are used.

Aerol is a quality oil—a fine lubricant, but not extravagantly so—and a practical lubricant because it meets the requirements of practical usage at a reasonable cost. Full details, characteristics and tests will be furnished to government officials, aeroplane manufacturers or others interested in the subject of aeroplane motor lubrication.

Technical and Research Department

SWAN & FINCH

COMPANY

165 BROADWAY, NEW YORK

Quality Oils Since 1853

Aluminum Company of America

PITTSBURGH, PA.

Manufacturers of Aluminum

Ingot, Sheet, Tubing, Wire, Rod, Rivets, Moulding

General Sales Office, 2400 Oliver Building, Pittsburgh, Pa.

Branch Offices:

Boston.....131 State Street
Chicago.....1500 Westminster Building
Cleveland.....950 Leader-News Building
Detroit.....1512 Ford Building
Kansas City.....308 R. A. Long Building
Los Angeles.....494 Pacific Electric Building
Pierson, Roeding & Co., Agents
New York.....120 Broadway
Philadelphia.....1216-1218 Widener Building
Rochester.....1112 Granite Building
San Francisco.....731 Rialto Building
Pierson, Roeding & Co., Agents
Washington.....509 Metropolitan Bank Building

Send inquiries regarding aluminum in any form to nearest Branch Office, or to General Sales Office

METAL AIRPLANE FUSELAGES

AIRPLANE TUBING

Especially made to your own requirements

We are at present manufacturing for the larger airplane constructors our high grade tubing for almost *overnight deliveries*.

We are also manufacturing three distinct types of metal fuselages.

Special inquiries solicited.

The Empire Art Metal Co., Inc.

College Point, N. Y.

DYNAMIC BALANCE

for crankshafts, etc.

Send for pamphlet describing my latest *Dynamic Balancing Apparatus*

MODEL 1917

It is just as scientific as was my last year's model (*not now made by me*), although entirely different in principle and construction, much cheaper and yielding still better results.

No Agents, Representatives or Licencees!

Made and Distributed EXCLUSIVELY by

N. W. AKIMOFF, Harrison Building, Philadelphia

(Originator of the Dynamic Balancing Machine still known by his name.)

WALDEN-HINNERS COMPANY

BUILDERS OF AIRCRAFT

MILITARY AIRPLANES
SEAPLANES
FLYING BOATS

OFFICE AND FACTORY
EDGEWATER, N. J.

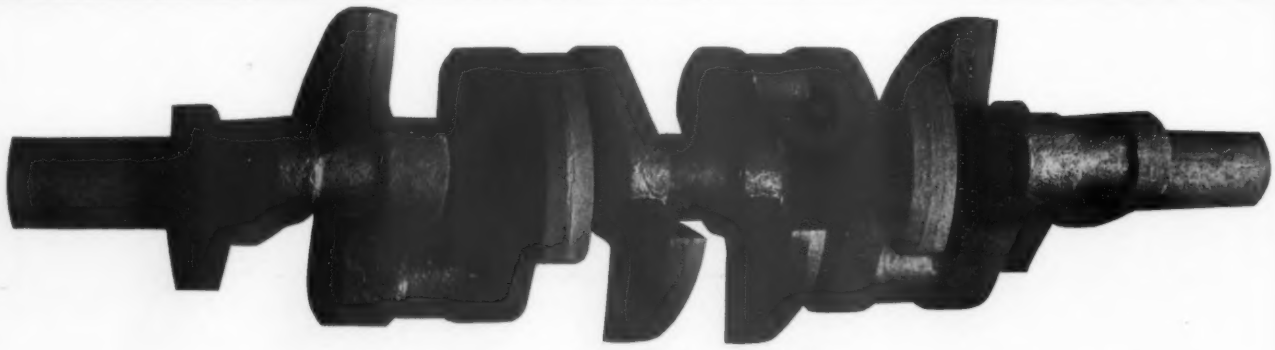

a counterbalanced aviation crankshaft . . . .

one of the 18 different
models we are now making
for 14 aviation motor companies . . .
reduces vibration and eliminates bearing pressure

We have shipped 48,324 Counterbalanced Crankshafts to July 14th, 1917

THE PARK DROP FORGE CO. CLEVELAND, OHIO

GREAT BRITAIN KNOWS
AND THE RESULT IS
11000
FOXBORO
TRADE MARK
Airplane Thermometers
FOR THE
BRITISH AIR FLEET.

"Uncle Sam" realizes in this as in other matters, that

EXPERIENCE COUNTS

and "Foxboro" Airplane Thermometers and Air Speed Indicators have been approved and are being bought for use on United States Government Airplanes, thus taking advantage of Great Britain's EXPERIENCE in the air and more than 25 years of EXPERIENCE in the design and manufacture of measuring instruments which stands behind every "Foxboro" Instrument.

Investigate and be convinced.

THE FOXBORO CO., INC., FOXBORO, MASS., U. S. A.

NEW YORK CHICAGO SAN FRANCISCO

From an actual night photograph without retouching.

Taken with no light except the glow of Marvelite itself.

Aviation Barometers Equipped With

MARVELITE

self-luminous Radium compound of quality

Are proving so useful and so entirely satisfactory that no manufacturer can longer afford to delay investigating the merits of this remarkable new material. Correspondence solicited, samples furnished and any reasonable demonstration gladly made for makers of barometers, compasses, sights, clocks and watches.

COLD LIGHT MFG. COMPANY
DENVER, COLORADO

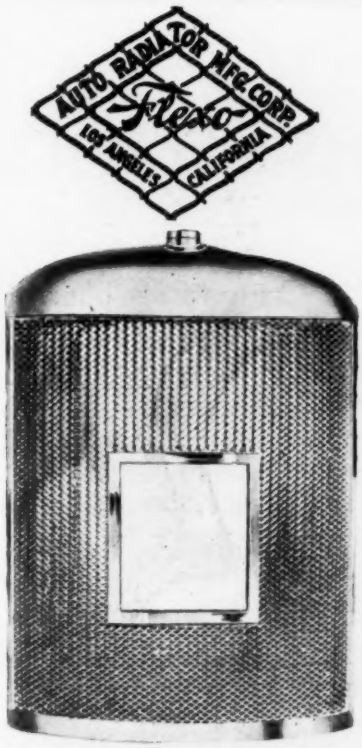

"Flexo" Front Type
Used by the U. S. Government.

Having just completed large orders for the Allies we are in better position than ever to take care of our trade

AUTO RADIATOR MFG. CORP.
219-225 W. 12th STREET, LOS ANGELES, CAL.

WALDEN-HINNERS COMPANY

BUILDERS OF AIRCRAFT

MILITARY AIRPLANES
SEAPLANES
FLYING BOATS

OFFICE AND FACTORY
EDGEWATER, N. J.

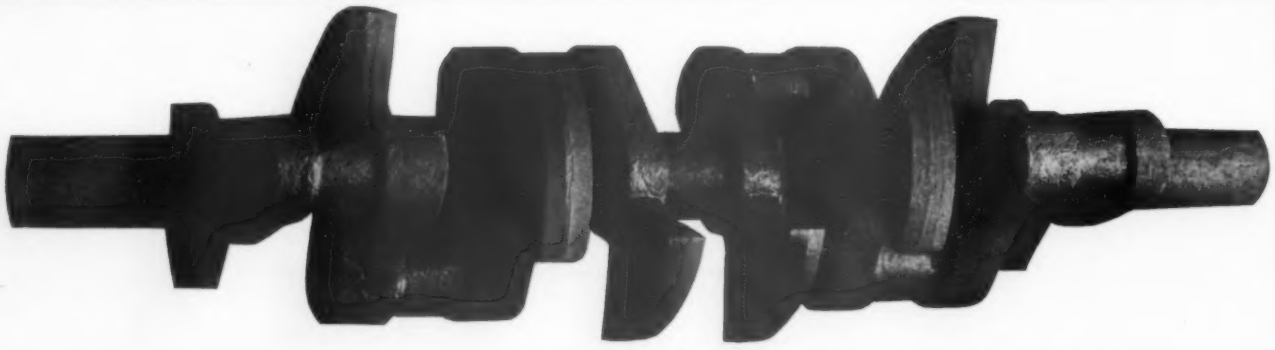

a counterbalanced aviation crankshaft . . . .

one of the 18 different
models we are now making
for 14 aviation motor companies . . .
reduces vibration and eliminates bearing pressure

We have shipped 48,324 Counterbalanced Crankshafts to July 14th, 1917

THE PARK DROP FORGE CO. CLEVELAND, OHIO

GREAT BRITAIN KNOWS
AND THE RESULT IS
11000
FOXBORO
TRADE MARK
Airplane Thermometers
FOR THE
BRITISH AIR FLEET.

"Uncle Sam" realizes in this as in other matters, that

EXPERIENCE COUNTS

and "Foxboro" Airplane Thermometers and Air Speed Indicators have been approved and are being bought for use on United States Government Airplanes, thus taking advantage of Great Britain's EXPERIENCE in the air and more than 25 years of EXPERIENCE in the design and manufacture of measuring instruments which stands behind every "Foxboro" Instrument.

Investigate and be convinced.

THE FOXBORO CO., INC., FOXBORO, MASS., U. S. A.

NEW YORK CHICAGO SAN FRANCISCO

From an actual night photograph without retouching.

Taken with no light except the glow of Marvelite itself.

Aviation Barometers Equipped With

MARVELITE

self-luminous Radium compound of quality

Are proving so useful and so entirely satisfactory that no manufacturer can longer afford to delay investigating the merits of this remarkable new material. Correspondence solicited, samples furnished and any reasonable demonstration gladly made for makers of barometers, compasses, sights, clocks and watches.

COLD LIGHT MFG. COMPANY
DENVER, COLORADO

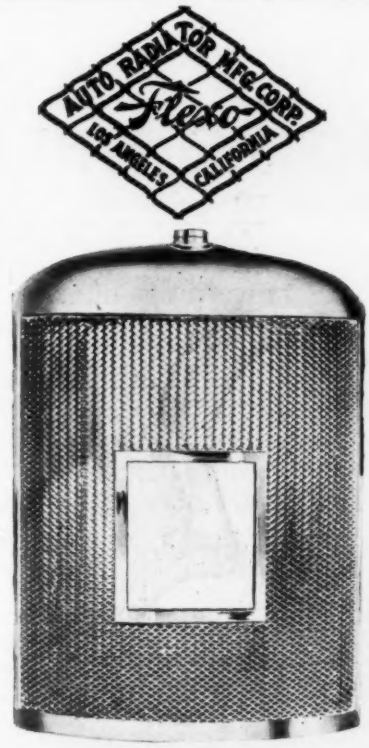

"Flexo" Front Type
Used by the U. S. Government.

Having just completed large orders for the Allies we are in better position than ever to take care of our trade

AUTO RADIATOR MFG. CORP.
219-225 W. 12th STREET, LOS ANGELES, CAL.

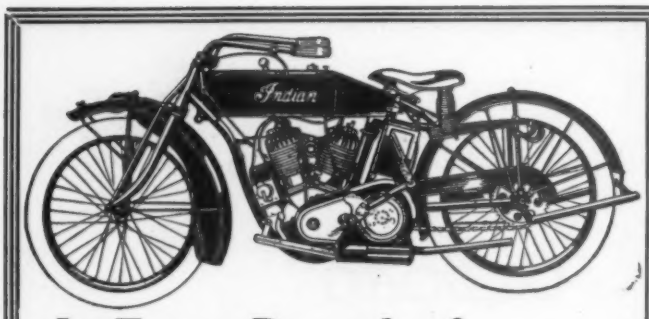

In Every Branch of Military Service

—Engineering Corps, Aviation Section, Quartermaster Corps, and general Patrol, Scout, and Dispatch service—you will find the 1917

Indian Motocycle
With Powerplus Motor

Greatest strength, endurance, speed, power, and all-round dependability.

We will be pleased to arrange demonstrations of all 1917 Indian models for interested military officials.

Illustrated 1917 Indian Catalog and other descriptive literature sent anywhere on request

HENDEE MANUFACTURING COMPANY
(Largest Motorcycle Manufacturers in the World)
859 STATE ST. SPRINGFIELD, MASSACHUSETTS

Sturtevant
(REG. U.S. PAT. OFF.)

Aeroplane Company

Jamaica Plain Boston

Member Aircraft Manufacturer's Association

AIRPLANE
RIMS and WHEELS

Rims furnished punched for spokes and valve, ready to be built into wheels.

Wheels supplied less tires,—complete with all parts. Made to our own design or from manufacturer's Blue Prints.

Manufactured by the oldest and best known steel rim and wire wheel makers in America.

Careful experienced workmen and best grade of materials.

Quotations gladly submitted.

The MOTT WHEEL WORKS
Utica, N. Y.

Heavy Elastic Aviation Cord

We manufacture a full and complete line of heavy elastic aviation cord. We are the originators and the largest manufacturers in the world of heavy elastic cord.

Standard H-3 equipped with our cord

J. W. WOOD ELASTIC WEB CO.
STOUGHTON, MASS.

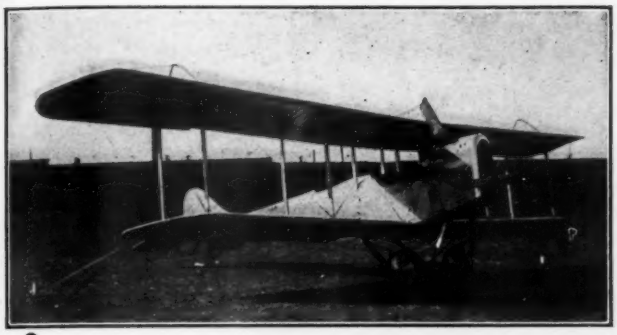

Wittemann-Lewis Model T-T, 90 h. p.

WITTEMANN - LEWIS AIRCRAFT COMPANY

NEWARK, N. J.

Main Office and Factory:

Lincoln Highway, near Passaic River

Telephone, Market 9096

"THE TANDEM BIPLANE"

INHERENT LONGITUDINAL STABILITY

Richardson Aeroplane Corporation, Inc.

New Orleans, La.

ELJ-5

Officers of the Heavier-than-air Services of the United States and their Allies are invited to inspect the

Janney Aircraft Company's

New Model Training Tractor Biplane ELJ-5

With Hall-Scott A-5 Six Cylinder Engine

Detailed Description upon request

JANNEY AIRCRAFT CO.

MONROE, MICH.

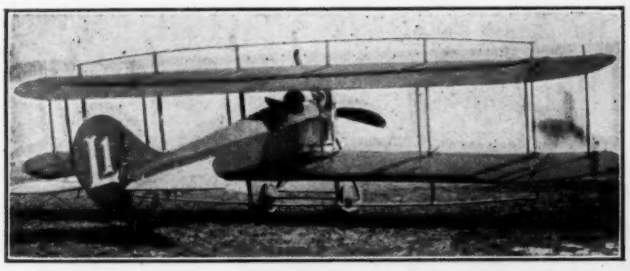

With the manufacturing facilities of three large factories in New York, Tennessee and New Jersey we are in a position to execute with despatch orders for the LANZIUS CHANGEABLE ANGLE OF INCIDENCE AIRPLANE in any type for land or water, or for Standard and Special Design Aircraft, either wood or steel construction. We furnish with our standard equipment Duesenberg Motors, recognized as one of the most powerful and efficient Aeronautical Motors on the market.

LANZIUS AIRCRAFT COMPANY

Executive Offices

608-609-610 Singer Building, 149 Broadway, New York

Telephones 6710-6711 Cortlandt

WESTMORE
PROPELLER

will not warp or split

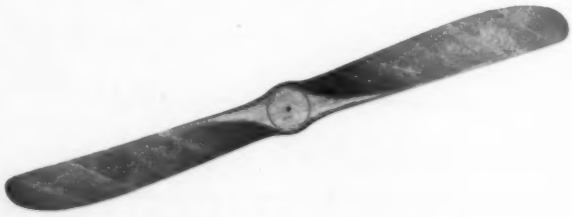

Built for high power motors
Water proof and heat proof

Quantity Production

WRITE FOR INFORMATION

Address AIRCRAFT DEPARTMENT

SCHWEIZER & WEST MFG. CO.
308-324 N. Ada St., Chicago

Cable address "SWESCO"

Cabinet makers with over thirty years' successful business behind them

WISCONSIN AVIATION MOTORS

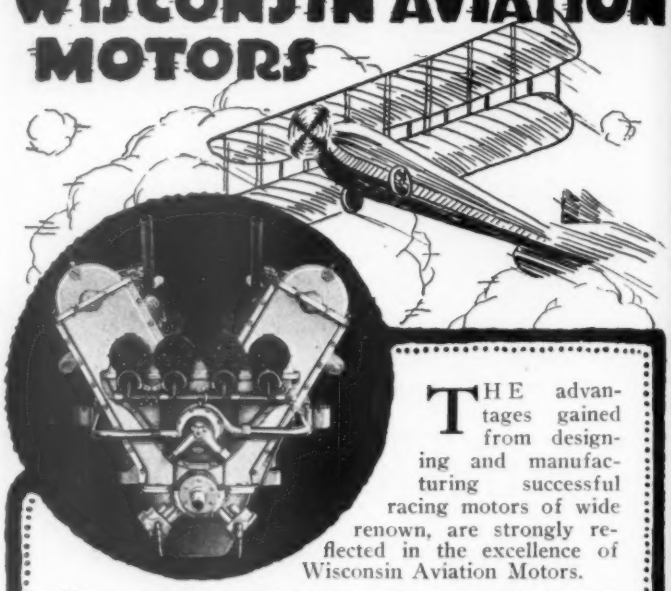

THE advantages gained from designing and manufacturing successful racing motors of wide renown, are strongly reflected in the excellence of Wisconsin Aviation Motors.

Chrome Vanadium Steel, double heat treated, is used throughout. Chemical analyses, physical tests and rigid inspections make sure that each motor maintains the high Wisconsin standard.

Wisconsin
CONSISTENT

aviation motors are built in six- and twelve-cylinder sizes. Write for specifications.

WISCONSIN MOTOR MFG. COMPANY
Station A, Dept. 338, Milwaukee, Wisconsin, U. S. A.
New York Branch: 21 Park Row. T. M. Fenner, Factory Representative

GRAND RAPIDS LUMBER TESTER

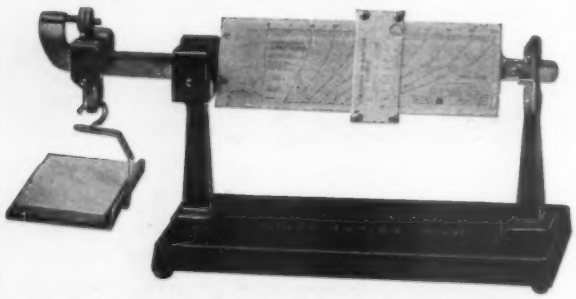

KNOW the MOISTURE CONTENT of your LUMBER

DIRECT READING—NO COMPUTATION—NO GUESSWORK

All air-dried lumber for AIRPLANES should be tested to insure uniformity.

Lumber should contain from 5 to 10 per cent: moisture for manufacturing purposes, according to kind of work.

Lumber containing less will absorb moisture from the air and expand.

Lumber containing more will expel the surplus and shrink.

Determine time required for drying by testing before loading kiln.

Determine if lumber is dry by testing before "pulling" kiln.

The Grand Rapids Lumber Tester is based on "bone dry" or constant weight and is scientifically correct, according to the standards of the U. S. Forest Laboratory at Madison, Wisconsin.

GRAND RAPIDS VAPOR KILN

Manufactured by GRAND RAPIDS VENEER WORKS
Grand Rapids, Mich. Seattle, Wash.

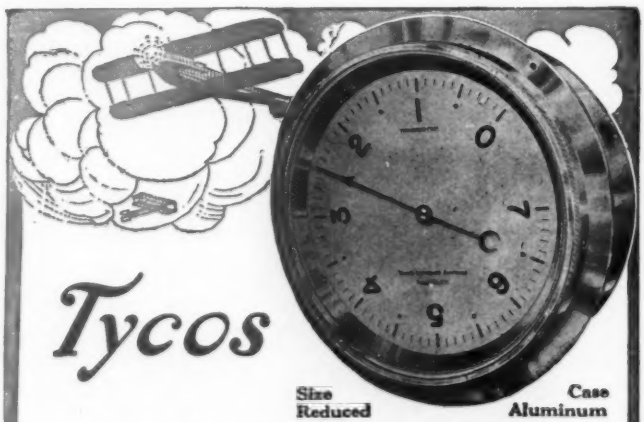

Tycos

Size Reduced — Case Aluminum

Aviation Barometer

Made in United States.

Movement compensated to overcome changes in temperature. Dial revolves so zero of altitude can be set at the hand at start of flight without showing error, as scale is equally divided.
Supplied to U. S. Navy, U. S. Signal Corps, leading manufacturers and to different Foreign Governments.
In material, workmanship, pride of manufacture, no effort is lost, no expense spared to make this Barometer worthy of the Tycos Reputation.
Let us submit information on this Barometer as well as on Inclinometers and Pocket Altitude Barometer—the purchasing we leave to your discerning judgment.

Taylor Instrument Companies
Rochester, N. Y. U. S. A.
For sixty years makers of scientific instruments of superiority

ACIERAL METAL

Light as Aluminum *Strong as Steel*

Non-corrosive by salt water

CASTINGS *RODS* *SHEETS*

Prompt Deliveries

ACIERAL CO. OF AMERICA

Main Office:
26 Cortlandt Street
NEW YORK CITY

Plant:
20 Orange Street
NEWARK, N. J.

A POPULAR PRICE LAND OR WATER PLANE

TWO PLACE LAND MODEL $3,000

TWO PLACE WATER MODEL $3,100

KYLE SMITH AIRCRAFT CO., -:- -:- WHEELING, W. VA.

STIMPSON-RIVETS

LARGE STOCK REGULAR SIZES

COPPER

ALUMINUM

SPECIAL TO ORDER

WE MAKE SCREW HEAD NAILS AND RIVETS FOR EVERY PURPOSE.
EYELETS, HOOKS, GROMMETS AND WASHERS FOR SHOES, SHELTER TENTS, CORSETS, LEGGINS, MAIL BAGS.

70 FRANKLIN AVENUE 70 BROOKLYN, NEW-YORK

The Perfect Starter

Tested and Approved by United States, British, Dutch, Norwegian and Swedish Governments

A device convertible to an air motor for starting, or an air compressor for storing in a suitable tank the air for its own energy. Entirely self-contained and couples direct to crankshaft of engine without gear reduction or any adaptation other than a suitable coupling.

Model C—For starting engines up to 250 H.P. Weight 39 lbs.—complete with fittings for single engine 70 lbs.; twin engines 110 lbs.

Write for complete information

Model D—For starting engines up to 150 H.P. Weight 34 lbs.—complete with fittings for single engine 58 lbs.; twin engines 96 lbs.

The Motor-Compressor Co., Newark, N. J., U.S.A.

WE ILLUMINATE INSTRUMENT DIALS
WITH "LUMA"—BEST LUMINESCENCE

Permanently Visible in the Dark

Specify "LUMA DIALS" to Your Instrument Maker

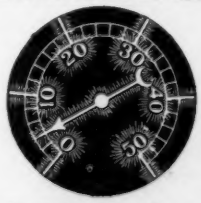

RADIUM DIAL COMPANY
Forbes & Meyran Aves., Pittsburgh, Pa.

AIRPLANE CRANKSHAFTS

With a Perfect Record

WYMAN-GORDON COMPANY

Every precaution known to science to safeguard quality is found in our factory methods.

WORCESTER, MASS., U. S. A.

ESTABLISHED 1883

McADAMITE-ALUMINUM COMPANY

57-83 Isabella Ave. DETROIT, MICH.

PATENTED McADAMITE METAL THE STRONGEST LIGHT METAL

Highest-Grade—Strongest

ALUMINUM CASTINGS

Tensile strength.....	44,250	lbs. Sq. In.
Compression	126,000	" " "
Transverse	87,200	" " "
Torsion	66,300	" " "
Fusing Point.....	1040	Degrees F

LARGE CAPACITY PLANT

Quick Deliveries Guaranteed

THE RELIABLE HOUSE DUTTON

OUR SPRUCE LOGS

Are perhaps the best on the Pacific Coast. Our facilities for supplying Air-plane Spruce are unsurpassed.

A. C. DUTTON LUMBER CORPORATION

Mills
SOUTH BEND, WASH.
TACOMA, WASH.

General Sales Department
SPRINGFIELD, MASS.

Wharves, Warehouses and Storage Yards
POUGHKEEPSIE, N. Y.

ORDNANCE ENGINEERING CORPORATION

NEW YORK OFFICE
120 Broadway, Equitable Building

LONDON OFFICE
19 Queen Anne Chambers, Westminster, S. W.

Government Contractors : : Consulting Engineers

Manufacturers of Illuminating Shells, Trench Howitzers, Hand Grenades, etc., etc.

Naval and Military Appliances and Parts designed, developed and perfected

Designers and Builders of Military and Naval

AIRCRAFT

CAPACITY QUALITY

DU PONT

WHERE LARGE PRODUCTION CONVERGES WITH THE MOST RIGID STANDARDS OF QUALITY AND EFFICIENCY

¶ Du Pont facilities and capacity can be depended upon to keep pace with the increased demands of the airplane industry.

¶ Du Pont technical skill and experience will insure strict maintenance of the quality that has made **DU PONT DOPE** the standard for airplane surfaces.

Du Pont Chemical Works

E. I. du Pont de Nemours & Co., Owner

120 Broadway **New York**

Radium Luminous Material

SHINES IN THE DARK

SELF-LUMINOUS REQUIRES NO MAINTENANCE OVER A PERIOD OF YEARS

INNUMERABLE USES IN ITS ORIGINAL POWDERED FORM OR APPLIED WITH ADHESIVE

A SAFETY DEVICE FOR WAR

ON

MACHINE GUN, PISTOL AND RIFLE SIGHTS; RANGE SCALES; AUTOMATIC TELEPHONES; WIRELESS APPARATUS; NAVIGATING INSTRUMENTS OF ALL FLYING AND SAILING CRAFT; DECK CLOCKS; WRIST, STOP AND POCKET WATCHES; SIGNALS; PLOTTING BOARDS; ETC.

Radium Luminous Material Corporation

FIFTY FIVE LIBERTY STREET

SEES AT NIGHT

NEW YORK CITY

Fahrig Anti-Friction Metal

The Best Bearing Metal on the Market
A Necessity for Aeroplane Service

Fahrig Metal Quality has become a standard for reliability. We specialize in this one tin-copper alloy which has superior anti-friction qualities and great durability and is always uniform.

When you see a speed or distance record broken by Aeroplane, Racing Automobile, Truck or Tractor Motor, you will find that Fahrig Metal Bearings were in that motor.

FAHRIG METAL CO., 34 Commerce St., N.Y.

ROME AERONAUTICAL RADIATORS

Developed from years of experience in building all types of radiators.
They possess every feature and qualification necessary for a high grade product.

STRONG
EFFICIENT
DURABLE

Used on the best American flying machines.
Our engineering department is at your service.

Rome - Turney Radiator Company
Rome, N. Y., U. S. A.

AIRPLANE CRANKSHAFTS

With a Perfect Record

WYMAN-GORDON COMPANY

Every precaution known to science to safeguard quality is found in our factory methods.

WORCESTER, MASS., U. S. A.

ESTABLISHED 1883

McADAMITE-ALUMINUM COMPANY

57-83 Isabella Ave. DETROIT, MICH.

PATENTED McADAMITE METAL THE STRONGEST LIGHT METAL

Highest-Grade—Strongest

ALUMINUM CASTINGS

Tensile strength.....	44,250	lbs. Sq. In.
Compression	126,000	" " "
Transverse	87,200	" " "
Torsion	66,300	" " "
Fusing Point.....	1040	Degrees F

LARGE CAPACITY PLANT

Quick Deliveries Guaranteed

THE RELIABLE HOUSE DUTTON

OUR SPRUCE LOGS

Are perhaps the best on the Pacific Coast. Our facilities for supplying Air-plane Spruce are unsurpassed.

A. C. DUTTON LUMBER CORPORATION

Mills
SOUTH BEND, WASH.
TACOMA, WASH.

General Sales Department
SPRINGFIELD, MASS.

Wharves, Warehouses and Storage Yards
POUGHKEEPSIE, N. Y.

ORDNANCE ENGINEERING CORPORATION

NEW YORK OFFICE
120 Broadway, Equitable Building

LONDON OFFICE
19 Queen Anne Chambers, Westminster, S. W.

Government Contractors : : Consulting Engineers

Manufacturers of Illuminating Shells, Trench Howitzers, Hand Grenades, etc., etc.

Naval and Military Appliances and Parts designed, developed and perfected

Designers and Builders of Military and Naval

AIRCRAFT

CAPACITY QUALITY

DU PONT

WHERE LARGE PRODUCTION CONVERGES WITH THE MOST RIGID STANDARDS OF QUALITY AND EFFICIENCY

¶ Du Pont facilities and capacity can be depended upon to keep pace with the increased demands of the airplane industry.

¶ Du Pont technical skill and experience will insure strict maintenance of the quality that has made **DU PONT DOPE** the standard for airplane surfaces.

Du Pont Chemical Works

E. I. du Pont de Nemours & Co., Owner

120 Broadway New York

Radium Luminous Material

SHINES IN THE DARK

SELF-LUMINOUS REQUIRES NO MAINTENANCE OVER A PERIOD OF YEARS

INNUMERABLE USES IN ITS ORIGINAL POWDERED FORM OR APPLIED WITH ADHESIVE

A SAFETY DEVICE FOR WAR

ON

MACHINE GUN, PISTOL AND RIFLE SIGHTS; RANGE SCALES; AUTOMATIC TELEPHONES; WIRELESS APPARATUS; NAVIGATING INSTRUMENTS OF ALL FLYING AND SAILING CRAFT; DECK CLOCKS; WRIST, STOP AND POCKET WATCHES; SIGNALS; PLOTTING BOARDS; ETC.

Radium Luminous Material Corporation

FIFTY FIVE LIBERTY STREET

SEES AT NIGHT

NEW YORK CITY

Fahrig Anti-Friction Metal

The Best Bearing Metal on the Market
A Necessity for Aeroplane Service

Fahrig Metal Quality has become a standard for reliability. We specialize in this one tin-copper alloy which has superior anti-friction qualities and great durability and is always uniform.

When you see a speed or distance record broken by Aeroplane, Racing Automobile, Truck or Tractor Motor, you will find that Fahrig Metal Bearings were in that motor.

FAHRIG METAL CO., 34 Commerce St., N.Y.

ROME AERONAUTICAL RADIATORS

Developed from years of experience in building all types of radiators.
They possess every feature and qualification necessary for a high grade product.

STRONG
EFFICIENT
DURABLE

Used on the best American flying machines.
Our engineering department is at your service.

Rome-Turney Radiator Company
Rome, N. Y., U. S. A.

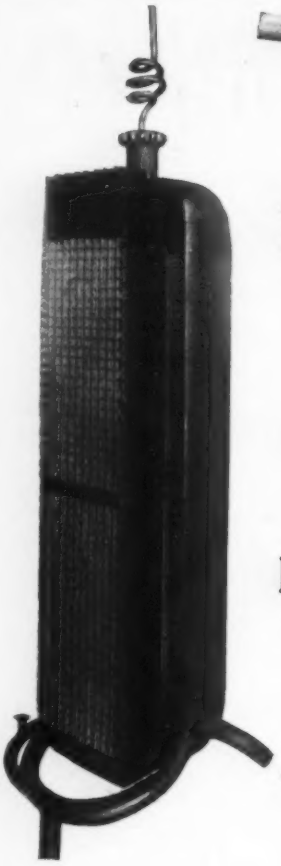

AJAX
Auto and Aero Sheet Metal Co.

Manufacturers and designers of

AERO RADIATORS INTAKE and EXHAUST PIPES

LINDER & MEYER
245 W. 55th St.
New York

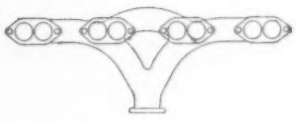

Factors of Safety

These Count in Aeroplane Construction

NON-INFLAMMABLE

Cellulose Acetate Base

Celestron Cloth Varnishes

provide another SAFETY FACTOR

NON-INFLAMMABLE

Celestron Sheets AND Films

Transparent — Waterproof

MANUFACTURED BY

Chemical Products Company
93 Broad Street **Boston, U. S. A.**
Manufacturers of Cellulose Acetate for nearly 15 years

Fowler Airplane Corporation

Office and Factory
128-130 Twelfth Street
San Francisco, Cal.

Erie Specialty Co.

Main Plant
Erie, Pa.
Executive Offices: **25 Pine St., New York**

Manufacturers

AIRCRAFT METAL PARTS, BOLTS, NUTS, CLEVIS PINS, SHACKLES, EYE BOLTS, MACHINE SCREWS, ETC., ETC.

Fittings, Forgings, Castings

We are increasing our equipment in every department—foundry, forge shop, stamping, automatic screw machines, tool and die shop.

All our products are rigidly inspected and meet all Government requirements.

Are you on our catalog mailing list?

TURNBUCKLES

of the

Highest Quality

Bolts and Nuts

to Satisfy the Most
Exacting Requirements

Standard Screw Co.

(of Pennsylvania)

CORRY, PA.

New York Office: Woolworth Building

Longren Airplane Co.

TOPEKA, KANSAS

Designers and Constructors of

Military Airplanes
SPEED SCOUTS

built on order

TRAINING MACHINE
READY FOR DELIVERY

C. A. Herrmann

DESIGN AND CONSTRUCTION

Covering All Branches of Aviation

Bath, N. Y.

WOOD WORKING MACHINERY

SPECIALLY ADAPTED

FOR

Aeroplane Factories

Write for information catalogue No. 97

OLNEY & WARRIN

406-412 Broome Street

Tel. Spring 4425 NEW YORK, N. Y.

METAL HOSE

For every Airplane Requirement

Write for specifications and prices

PENNSYLVANIA FLEXIBLE METALLIC TUBING COMPANY

Broad and Race Sts., Philadelphia

New York Boston Chicago Detroit Cleveland

For Your Flying ← Boats Use

All the prominent builders of flying boats use this glue in combination with linen between the veneer of the diagonal planking on all their flying boats, pontoons and floats. It is not only waterproof and elastic but will waterproof and preserve the linen indefinitely. Experience has shown that when this glue is used, owing to its elasticity, the inside layer of diagonal planking will remain perfectly water tight although the outside layer may be badly broken.

L. W. Ferdinand & Co.
152 Kneeland Street
Boston, Mass., U. S. A.

PUNCH PRESS WORK AND STAMPINGS

Specializing particularly in Aeroplane work where accurate workmanship is absolutely necessary.

Also—Aeroplane Machine Work.

CENTURY TELEPHONE CONSTRUCTION COMPANY

BUFFALO, N. Y.

Vellumoid Gaskets

Oil Proof—Gasoline Proof—Water Proof

Tough—Compressible—Flexible

If you are not familiar with *Vellumoid* have us send you samples—either sheet or gaskets, cut as per your blue prints.

Expert Gasket Cutting department. Quick service

Fibre Finishing Co., 27 State St., Boston

Special Sheet Metal Work

—for—

Airplanes

Precise Work Executed from Blue Prints or specifications . . . . .

The Auto-Aero Sheet Metal Works

45 High Street, New Haven, Conn.

PONTOONS

and

FLYING BOAT HULLS

Built from your designs or from ours

Palmer-Simpson Corp.

Saranac Lake, N. Y.

BUFFAIRO

AIR-SCREWS

of

PROVEN PROFICIENCY

Detailed information upon request

BUFFALO AEROPLANE CORP.

BUFFALO, N. Y. U. S. A.

Cable Address, "BUFFAIRO"

Type "B1"

Type "B2"

Aeroplane Cylinder Forgings

We make a specialty of hollow forging in dies under our hydraulic presses, aeroplane cylinder forgings of high and low carbon O.H. or alloy steels.

We have furnished cylinder forgings to practically all the engine builders in the United States.

Also Propeller Hubs, Flanges and Shafts, etc.

Miscellaneous steam hammer and hydraulic press die forgings of all types.

Quick service our specialty

TIOGA STEEL & IRON COMPANY

52nd & Grays Avenue Philadelphia, Pa., U. S. A.

DAVENPORT SCHOOL OF AVIATION

Special inducements to students who wish mechanical instruction and actual experience in our airplane factory.

Field training under Chief Instructor

LOUIS BODER.

Write today for booklet

School and Factory at Davenport, Iowa.

Airplane Linen

Used by the United States and British Governments in their air services; also by the large airplane manufacturers

Samples and Specifications sent on application

Robert McBratney & Company

Linen Manufacturers and Importers

121-123 Franklin Street, New York

and at Belfast, Ireland

AMERICAN PROPELLER & MFG. CO.
TRADE MARK
PARAGON
BALTIMORE MARYLAND U.S.A.

LEYGRAND & CO.
120 Broadway, New York

ALUMINUM SHEETS
All Sizes and Dimensions

DON'T SCRAP ALUMINUM PARTS
SO-LUMINUM
repairs cracks, breaks or other defects in aluminum, in half the time at half the cost of acetylene welding. Parts mended with this compound are *stronger* at welded joint than elsewhere. Gasoline torch only thing necessary. No flux needed.
Doesn't take the strength out of metals, make them brittle, nor cause alloy castings to warp or fail to line up. Used by U. S. Army and Navy, leading airplane manufacturers, etc.
Send 50 cents for trial bar. $3.00 pound. *Money refunded if not satisfactory.* Booklet on request.
SO-LUMINUM MFG. & ENG. CO., Inc
Room 25 1790 Broadway New York City

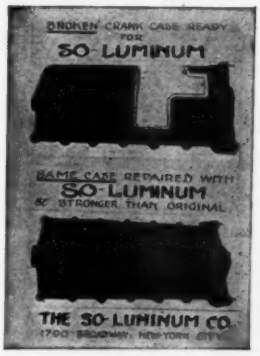

The Beam Airplane Company
(INCORPORATED)
Announce that they are in a position to accept a few students in their Aviation School.
CURTISS *and* EUROPEAN MOTORS
TRACTOR *and* PUSHER MACHINES
CONSTRUCTION EXPERIENCE
FEES *and* LIVING EXPENSES REASONABLE
NO CHARGE FOR BREAKAGE
Correspondence Invited
THE BEAM AIRPLANE COMPANY
CELINA OHIO

All recognized builders of airplane motors in America use *Zenith* on their product.
Zenith Carburetor Company
New York DETROIT Chicago

BOYCE MOTOMETER
MOTOR HEAT INDICATOR
AN ESSENTIAL SAFETY DEVICE FOR AIRPLANES
FOREWARNS OVERHEATING
THE MOTO-METER CO., Inc.

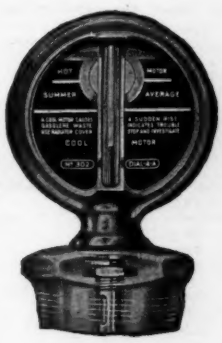

15 Wilbur Ave.
Long Island City
New York

Classified Advertising

10 cents a word, minimum charge $2.00, payable in advance. Address replies to advertisements with box numbers, care of AVIATION AND AERONAUTICAL ENGINEERING, 120 West 32d Street, New York.

FOR SALE—Wright H-S, practically new. Flown but eight hours; just completely overhauled. Ailerons, dual "Dep," cables all over. Good for school exhibitions, passenger carrying or sport. Will demonstrate. I. G. Semeniouk, Signal Corps Aviation School, San Diego, Cal.

FOR SALE—Three airplanes, complete without engines. W. M. Calkins & Co., Suite 1301, No. 90 West Street, New York City.

FOR SALE—A Gyro motored tractor biplane suitable for school or exhibition work. Carl Miller, 1211 E. Franklin Ave., Lansing, Mich.

FOR SALE—Martin Curtiss type "Pusher" Airplane. Equipped with Curtiss Model "O" Motor. Has been slightly used for schooling. In first class condition. Just the machine for the man who wants to learn to fly. "Be prepared." Price $1,400 fob Los Angeles. For further particulars communicate with Wright-Martin Aircraft Corporation, 334 Fourth Avenue, New York City.

FIRST CLASS Aeronautical Designing Engineer, nine years' experience designing, constructing and flying; now with large aircraft corporation wishes change. Address Box 51.

FOR SALE—60 H. P. Elbredge airplane engine. Guaranteed good as new. Noah Smith, San Angelo, Texas.

Aeronautical Trade Directory

AVIATION AND AERONAUTICAL ENGINEERING will furnish information and addresses of all companies listed below. Names of Advertisers in this issue are printed in heavy face type.

ACETYLENE WELDING AND CUTTING

Davis-Bournonville Co.
Searchlight Co.

ACCESSORIES AND INSTRUMENTS

DuVivier, Earnest J.
Moto-Meter, The, Co.
Sperry Gyroscope Co.
Standard Aeronautical Co.
Taylor Instrument Companies

AIRPLANES

Aeromarine Sales and Engineering Corp.
Bates Aeroplane Co.
Benoist Aeroplane Co.
Burgess Co., The
Carter Bros. Aeroplane Co.
Curtiss Aeroplane and Motor Corp.
Dayton Wright Airplane Co.
Flint Aircraft Co.
Fowler Airplane Corp.
Gallaudet Aircraft Corp.
Heinrich, The A. S. Corp.
Herrmann, Chas. A.
Janney Aircraft Co.
L. W. F. Engineering Co.
Lanzius Aircraft Co.
Lawrence-Lewis Aeroplane Co.
Lawson Aircraft Co.
Longren Airplane Co.
Pacific Aero Products Co.
Ordnance Eng. Co.
Richardson Aeroplane Corp., Inc.
Rogers Construction Co.
Rumsey Aeroplane Co.
Smith, Kyle, Aircraft Co.
Standard Aero Corporation.
Sturtevant Aeroplane Co.
Thomas-Morse Aircraft Corp.
Walden-Hinners Co.
Williams Aeroplane Co.
Wittemann-Lewis Aircraft Co.
Wright-Martin Aircraft Corp.

AIRPLANE ENGINES

Aeromarine Plane and Motor Co.
Bournonville Motors Corp.
Cleveland Aero Motor Co.
Curtiss Aeroplane and Motor Corp.
Duesenberg Motors Corp.
General Ordnance Co.
General Vehicle Co.
Gyro Motor Co.
Hall-Scott Motor Car Co.
Harriman Aircraft Motors Co., Inc.
Knox Motors Co.
Maximotor Co.
Miller, Harry A., Mfg. Co.
Orio Motor Co.
Packard Motor Co.
Roberts Motor Mfg. Co.
Sterling Engine Co.
Sturtevant, B. F., Co.
Thomas-Morse Aircraft Corp.
Union Gas Engine Co.
Wisconsin Motor Mfg. Co.
World's Motor Co.
Wright-Martin Aircraft Corp.

AIRPLANE PARTS

Erie Specialty Co.
Leveet, Walker M. Co.
Pressed & Welded Steel Products Co.
Rogers Construction Co.

ALUMINUM

Acieral Co. of America
Aluminum Castings Co.
Aluminum Co. of America
American Metal Co., Ltd.
Leygrand & Co.
McAdamite-Aluminum Co.
Co-Luminum Mfg. & Eng. Co. (Solder)

AVIATION SCHOOLS

America Trans Oceanic Co., The
Beam School of Aviation
Curtiss Training Schools
Davenport Aviation School
Dodge School of Aviation
Flint Aircraft Co.
Hall Flying School
Stinson School of Aviation
Thomas-Morse Aircraft Corp.
Williams Aviation School

BALL BEARINGS

Hess-Bright Mfg. Co.
New Departure Mfg. Co.
Norma Company of America.
S. K. F. Ball Bearings
U. S. Ball Bearing Mfg. Co.

BALLOONS AND DIRIGIBLES

Connecticut Aircraft Co.
Custer Specialty Co. (Statoscope)
French-American Balloon Co.
Goodyear Tire and Rubber Co.
Knabenshue Aircraft Corp.
United States Rubber Co.

BAROGRAPHS AND BAROMETERS

Green, Henry J.
Haustetter, A.
Sussfield & Lorch
Taylor Instrument Companies

BATTERIES

Electric Storage Battery Co.

BEARING METALS

American Bronze Co.
Fahrig Metal Co.
Levett, Walker M. Co.

CARBURETORS

Miller Carburetor Co.
Stromberg Motor Devices Co.
Wheeler and Schebler
Zenith Carburetor Co.

CLOCKS AND WATCHES

Ingersoll, Robt. H., and Bro.
Chelsea Clock Co.
Depollier, J., & Son
Waltham Watch Co.

CLOTHING

Abercrombie & Fitch
Rogers, Peet & Co.
Sanders Co.
Spalding, A. G., & Bros.

COMPASSES

Sperry Gyroscope Co.
Taylor Instrument Companies

DOPE AND VARNISH

Adams & Elting Co.
American Emaillite Co.
Chemical Products Co.
Conover, The C. E., Co.
DuPont Chemical Works
Flexible Compound Co.
National Aeroplane Co.
Pratt & Lambert
Standard Varnish Works
Valentine & Co.
Weeks & Co.

DRIFT INDICATOR

Sperry Gyroscope Co.

DRY KILNS

Cutler Dry Kiln Co.
Grand Rapids Veneer Works

DYNAMOMETER

Sprague Electric Works

ENGINE PARTS

Allegheny Forging Co.
Burd High Compression Ring Co.
Doehler Die Casting Co.
Erie Specialty Co.
Fibre Finishing Co.
Gifford, Leland Co.
Gill, P. H., & Sons
Hydraulic Pressed Steel Co.
Levett, Walker M., Co.
Park Drop Forge Co.
Standard Parts Co.
Taft-Pierce Mfg. Co.
Tioga Steel & Iron Co.
Williams, J. H., & Co.
Wyman-Gordon Co.

FABRICS

Courtral Mfg. Co.
Kursheedt Mfg. Co.
Lamb, Finlay & Co.
McBratney, Robt. & Co.
Scott, Hutchison Co.
Whitman, Clarence & Co.

FIRE EXTINGUISHERS

Fyr-Fyter Co., The
Johns-Manville Co., H. W.
Pyrene Mfg. Co.

GASKETS

Fibre Finishing Co.

GLUE

Ferdinand, L. W., & Co.
Baeder & Adamson.

GAGES

Crosby Steam Gage & Valve Co.
Foxboro Co., The, Inc.
United States Gage Co.

HANGARS

American Bridge Co.
Anchor Corrugating Constr. Co.
Ashley Steel Bldg. Co.
Howell, Field & Goddard, Inc.
Keasby & Mattison
Milliken Bros.
Virginia Bridge & Iron Co.

LIFE PRESERVERS

Universal Safety Mattress Co.

LUMBER

Alcock Co., John L.
American Balsa Corp.
Chetham Lumber Co.
Delatour, J.
Dutton, A. C. Lbr. Corp.
Ludlow, Israel
Mengel, C. C., & Bros. Co.

LUMINOUS COMPOUND

Cold Light Mfg. Co.
Radium Dial Co.
Radium Luminous Material Corp.

MACHINERY

Olney Warren
Warner & Swazey.

MANIFOLDS

Ajax Auto & Aero Sheet Metal Co.

MAGNETOS

Bosch Magneto Co.
Berkshire Magneto Corp.
Ericsson Mfg. Co.
Remy Electric Co.
Splitdorf Electrical Co.

METALS

American Vanadium Co.
Bethlehem Steel Co.
Detroit Pressed Steel Co.
Federal Pressed Steel Co.
Garland Ventilator Co.
Gueder, Paeschke & Frey Co.
Levett, Walker M. Co.

MODEL AIRPLANES

Ideal Aeroplane Supply Co.
Wading River Mfg. Co.

MOTORCYCLES

Excelsior Motor Mfg. Supply Co.
Harley-Davison Co.
Hendee Mfg. Co.
Henderson Motorcycle Co.

OILS AND LUBRICANTS

Baker Castor Oil Co.
Graphite Lubricant Co.
Gulf Refining Co.
Sheppard Ideal Oil Co.
Standard Oil Co.
Swan & Finch
Texas Co.
Vacuum Oil Co.

OIL PUMPS

Wayne Oil Tank & Pump Co.

ORDNANCE

Driggs-Seabury Ordnance Corp.
General Ordnance Co.
Maxim Silencer Co.
Savage Arms Co.

PACKING

Fibre Finishing Co.

PHOTOGRAPHY

Brock, Arthur, Jr.
Herbert & Huesgen Co.

PISTONS

Levett, Walker M., Co.

PONTOONS

Niagara Boat Co.
Palmer-Simpson Corp.
Welen Marine Equipment Co.

PROPELLERS

American Propeller & Mfg. Co.
Aviauto Mfg. Co.
Buffalo Aeroplane Corp.
C. M. O. Physical Laboratory
Excelsior Propeller Co.
Schweizer & West Mfg. Co.

PYROMETERS

Foxboro Co., The, Inc.
Shore Instrument & Mfg. Co.
Taylor Instrument Companies

RADIATORS

Auto Radiator Mfg. Corp.
Ajax Auto & Aero Sheet Metal Co.
A-Z Co.
Bush Mfg. Co.
El Arco Radiators Co.
Livingston Radiator Co.
Rome-Turney Radiator & Mfg. Co.
The English & Mersick Co.

RIVETS

Stimpson, Edwin B. Co.

SCELEROSCOPE

Shore Instrument & Mfg. Co.

SEA SLEDS

Murray & Tregurtha

SHOCK ABSORBERS

Wood, J. W. Elastic Web Co.

SPARK PLUGS

Champion Ignition Co.
Johns-Manville Co., H. W.
Pyro Ignition Co.
Rajah Auto Supply Co.
Splitdorf Electrical Co.

SPEED INDICATORS

Foxboro Co., The, Inc.
Johns-Manville Co., H. W.
Stewart Warner Speedometer Corp.

STABILIZERS

Greene Aeronautical Co.
Martin Arodynamic Stabilizer.
Sperry Gyroscope Co.

STARTERS

Bijur Motor Lighting Co.
Christensen, The, Engineering Co.
Dayton Engineering Laboratories Co.
Motor Compressor Co.
Northeast Electric Co.
Wagner-Hoyt Electric Co.

TACHOMETERS

Johns-Manville Co., H. W.
Nelson Blower & Furnace Co.
Queen-Gray Co.
Stewart Warner Speedometer Corp
Veeder Mfg. Co.

TANKS

Janney, Steinmetz & Co.

TELEPHONES

General Accoustic Co. (Aviaphone)
Streator Electric Co.
Telautograph Corp.
Western Electric Co.

THERMOMETERS

Foxboro Co., The, Inc.
Taylor Instrument Companies

TIRES AND RUBBER

Goodyear Tire & Rubber Co.
Hodgman Rubber Co.
United States Rubber Co.

TOOLS

Browne & Sharpe
Hall-Scott Motor Car Co.

TRUCKS AND TRAILERS

Federal Motor Truck Co.
Four Wheel Drive Auto Co.
Nash Motors Co.
Packard Motor Car Co.
Sechler & Co., The
Service Motor Truck Co.
White Co.

TUBING

Empire Art Metal Co.
Frasse, Peter A., & Co.
Pennsylvania Flexible Metallic Tubing Co.

TURNBUCKLES

Aero Mfg. & Accessories Co.
Ajax Iron Works
C. E. Aeroplane Works
Dillner-Meyer Mfg. Co.
Erie Specialty Co.
National Aeroplane Co.
New York & Hagerstown Metal Stamping Co.
Standard Screw Co.

WHEELS

Ackerman Wheel Co.
Mott Wheel Works

WIRE

American Steel and Wire Co.
Century Telephone Construction Co.
Electric Cable Co.
Roebling's, John A., Sons
Simplex Wire and Cable Co.

WIRELESS

American Radio & Research Corp
American Wireless Tel. Co.
Cutting & Washington.

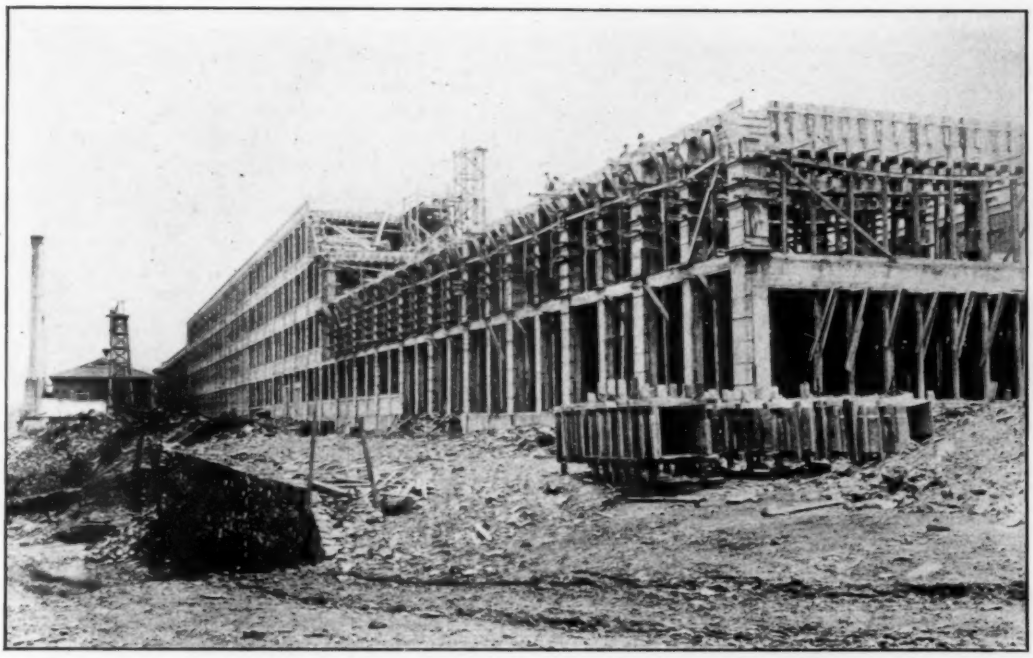

EXTENSIVE plant additions of **strictly fire-proof construction** offer **every facility** for the **manufacture** of **airplanes,** including the **rolling** of **special steel** for **clips,** and the **drawing** of **stream line wire.**

Contractors to U. S. Army and Navy

THOMAS-MORSE AIRCRAFT CORPORATION

Successors to THOMAS BROS. AEROPLANE CO., INC.
THOMAS AEROMOTOR COMPANY, INC. ***Ithaca, N. Y.***

Member Aircraft Manufacturers' Association

AIR UNIVERSITY LIBRARY
MAXWELL ALABAMA

THE WILLIAMS PRINTING COMPANY, NEW YORK

AIR UNIVERSITY LIBRARY
MAXWELL ALABAMA

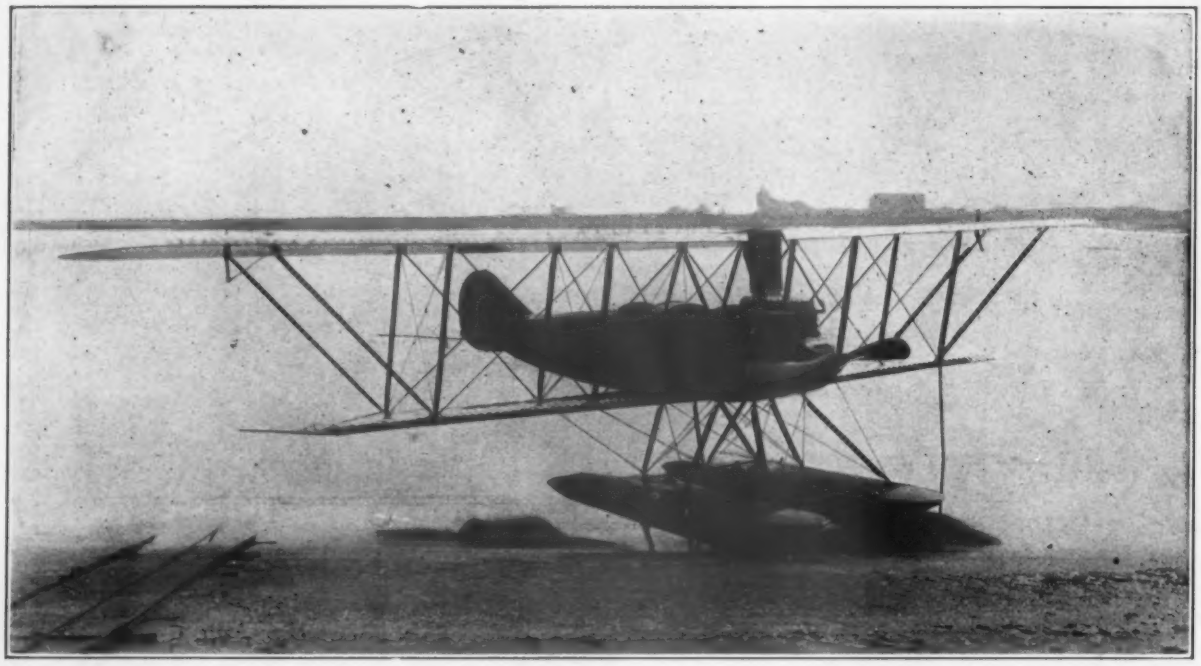

THE MARTIN TWO PLACE RECONNAISSANCE TRACTOR

MODEL R

Convertible Land and Water

Ordered by
the United States Army and Navy

Wright-Martin Aircraft Corporation

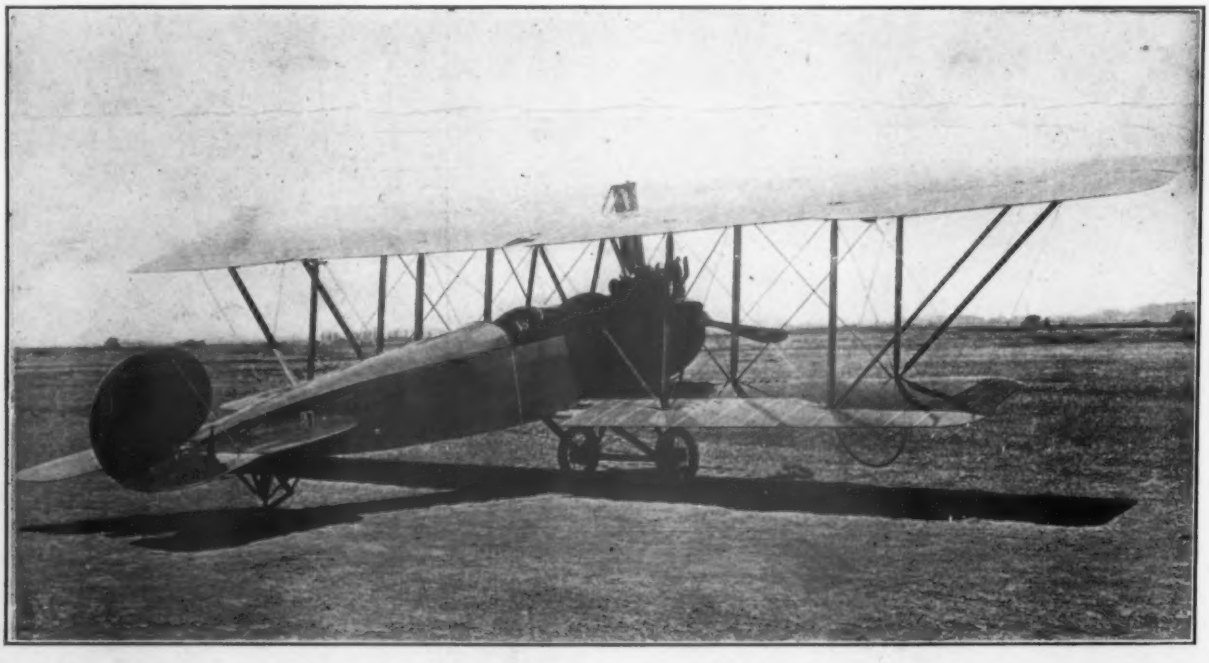

6463